


MICHAEL, D. BARRAM ARCHITECTS, INC.
 ARCHITECTS FOR
 CONSTRUCTION



JEFFREY LEE BASEHORE
 ARCHITECT
 200 LUGER AVE
 EDINBURG, TEXAS 77541
 TEL: 832.321.8650

VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 CANTON, TX 75103

DATE	06/04/2020
PROJECT NO.	1608818045
SHEET NO.	A2.001
1ST FLOOR EXISTING & DEMOLITION	

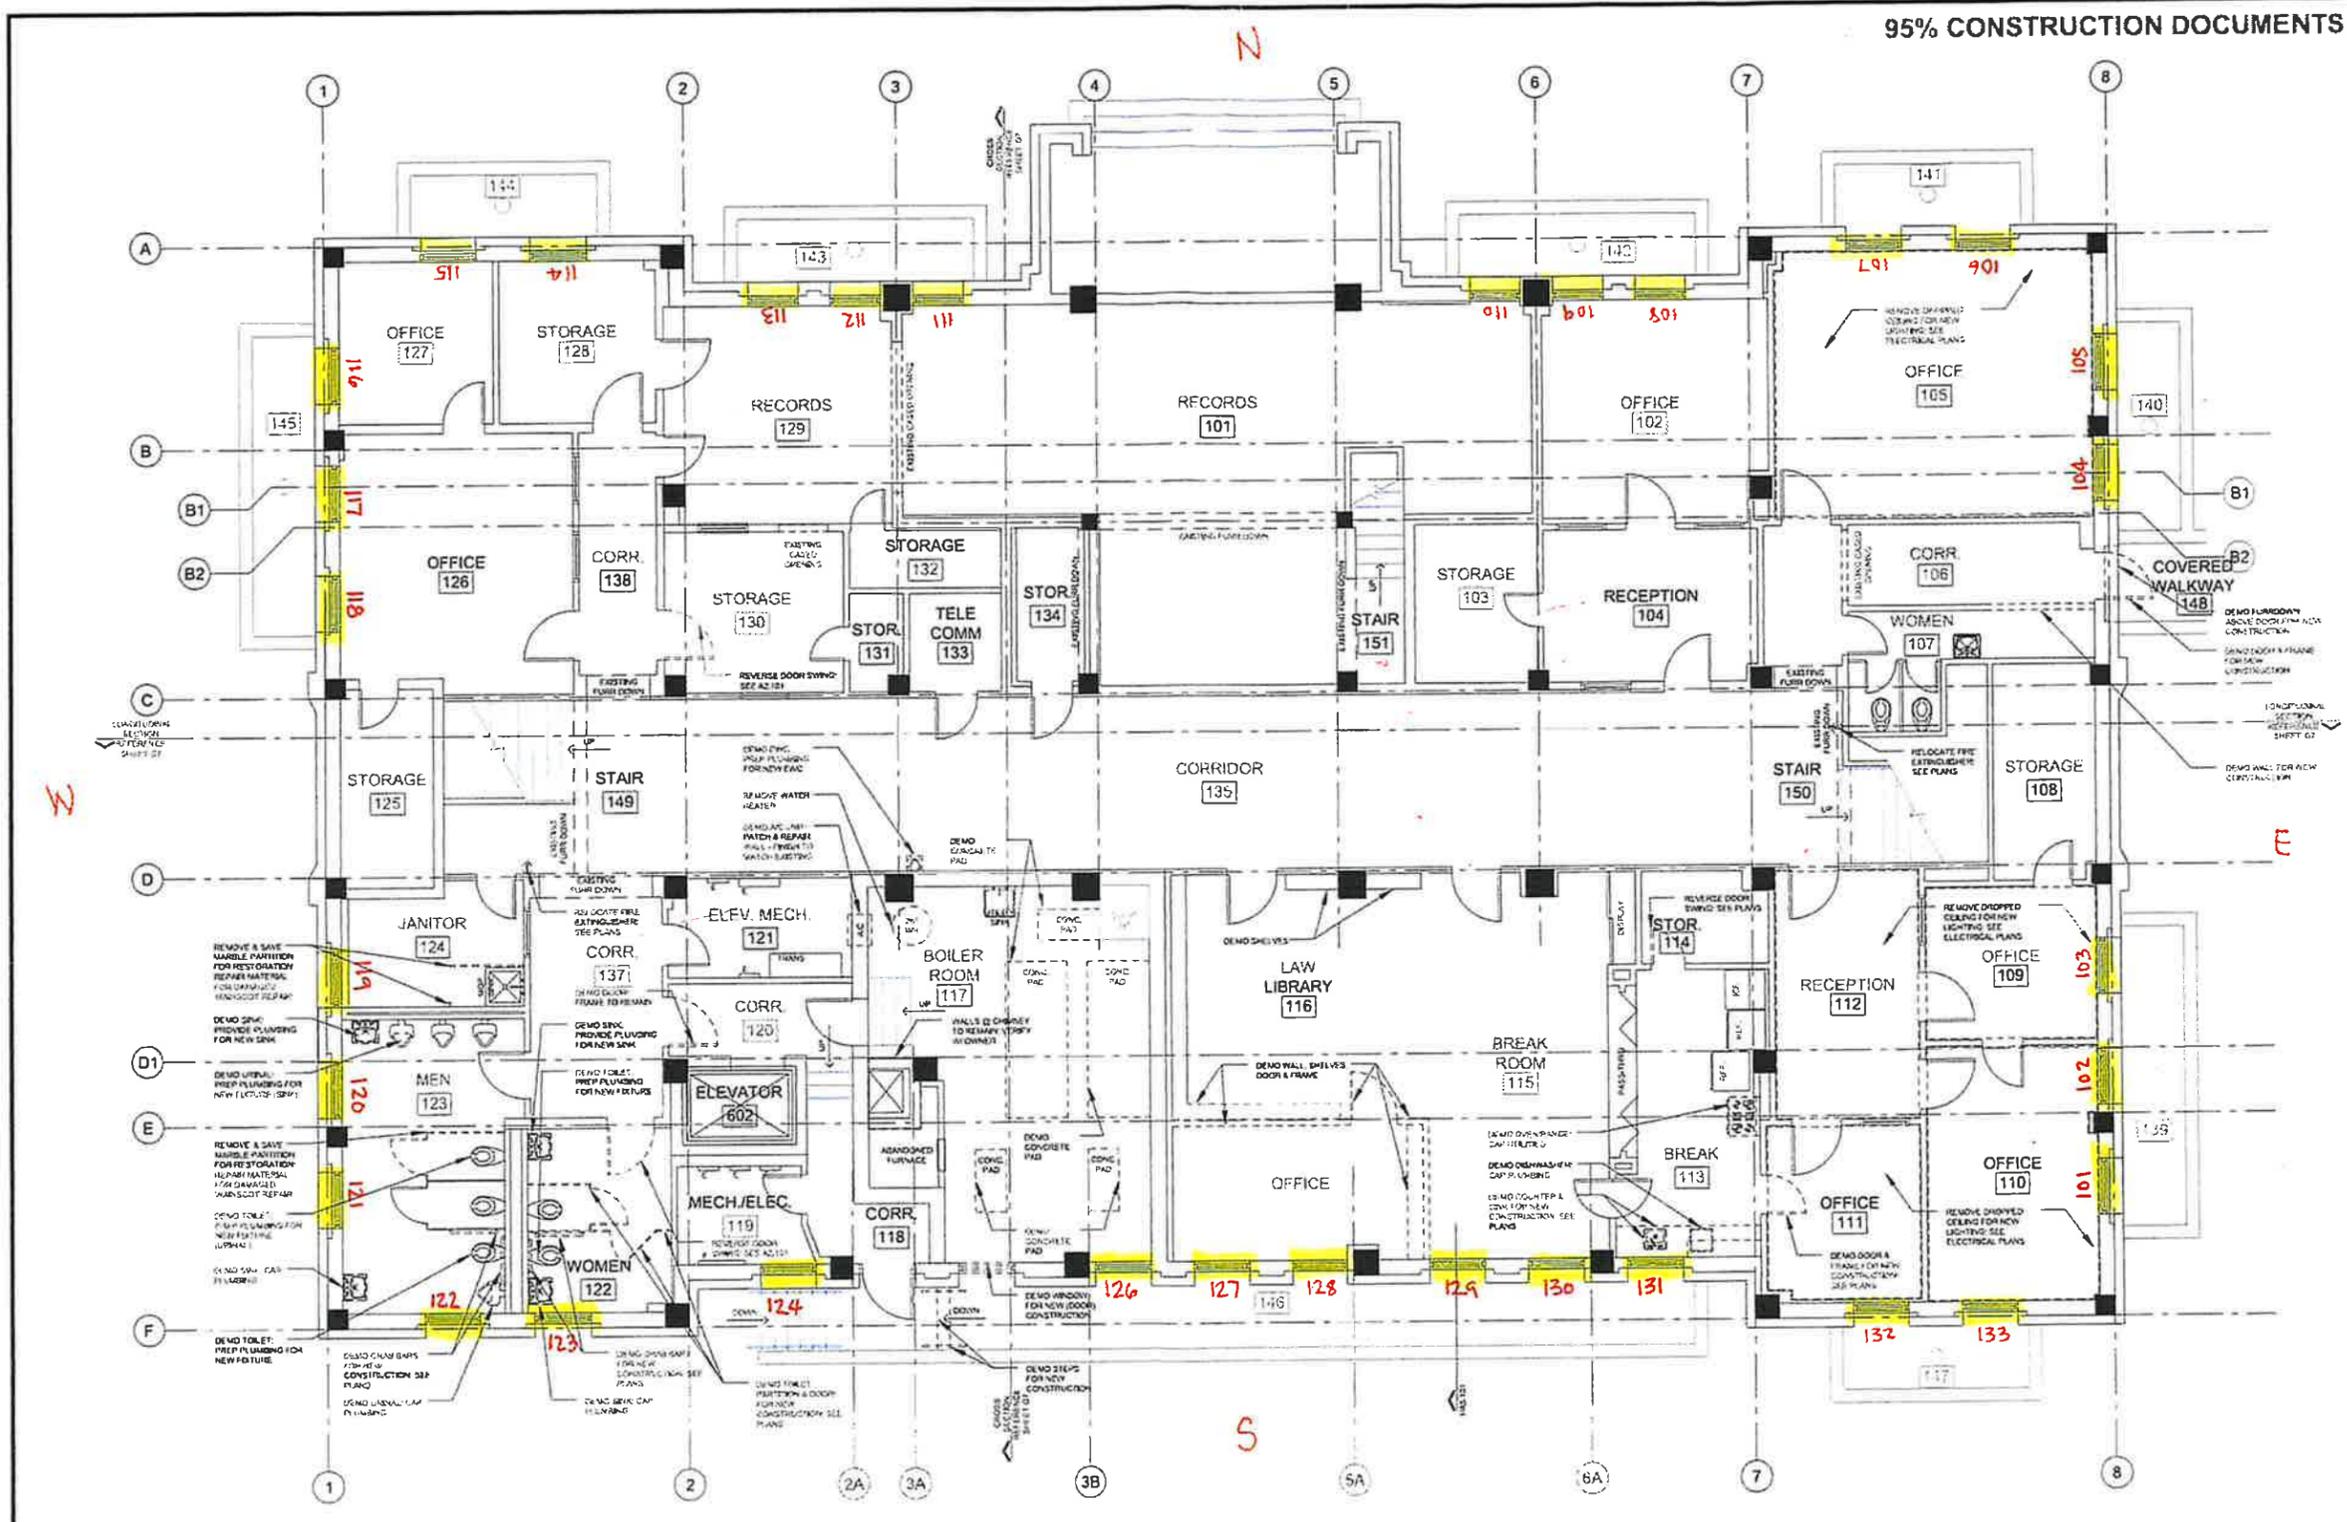

MARBLE NOTE:

ALL MARBLE REMOVED AND RE-INSTALLED FOR REUSE TO MATCH EXISTING

WALL LEGEND


- EXISTING WALLS TO REMAIN
- - - EXISTING WALLS TO BE REMOVED (EXCEPT WHERE NOTED)
- NEW WALL SEAL TO DECK
- EXISTING COLUMNS TO REMAIN (TYPICAL)

KEYNOTE LEGEND:

- # ROOM NUMBER
- # DOOR NUMBER
- # WINDOW NUMBER
- # GENERAL NOTE NUMBER
- # CASELINE NUMBER
- # SECTION MARKER
- # ELEVATION MARKER

1 FIRST FLOOR PLAN - EXISTING/DEMOLITION
 1/4" = 1'-0"
 1,791 SF

VAN ZANDT

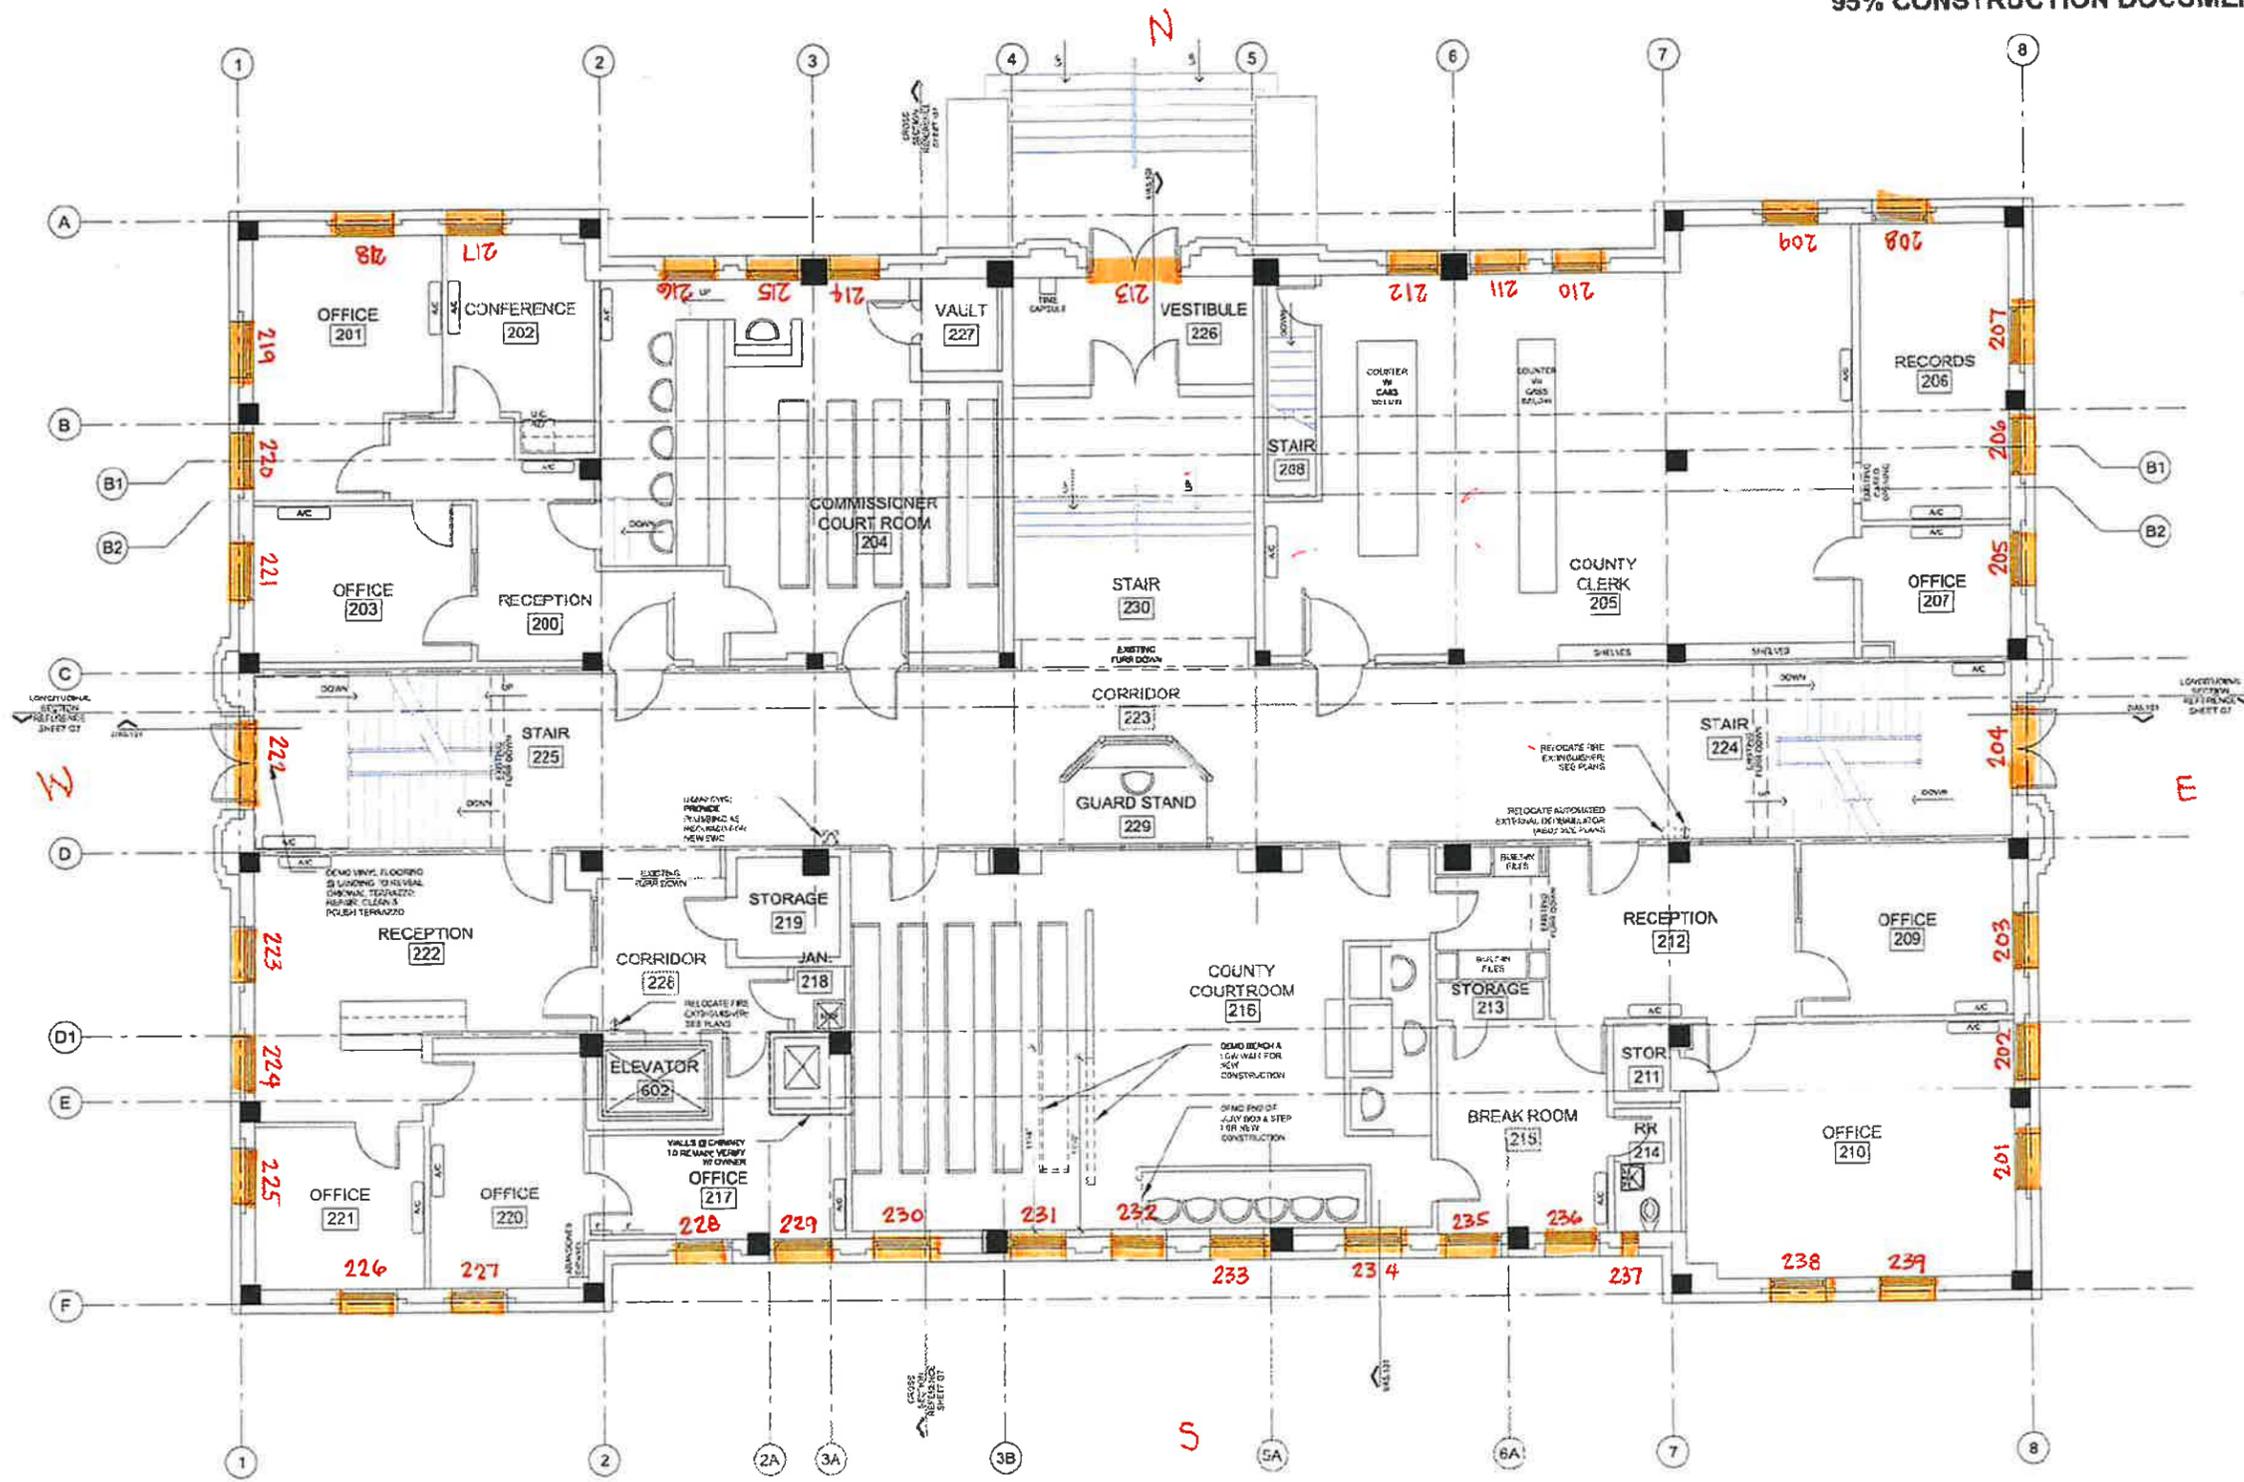

1 SECOND FLOOR PLAN - EXISTING/DEMOLITION
 1/4" = 1'-0" 7808 SF

MARBLE NOTE:

ANY MARBLE REMOVED WILL BE RETAINED FOR REUSE TO PATCH EXISTING.

WALL LEGEND

- EXISTING WALLS TO REMAIN
- - - EXISTING WALLS TO BE REMOVED - EXCEPT WHERE NOTED
- NEW WALL - SEAL TO DECK
- EXISTING COLUMNS TO REMAIN - TYPICAL

NOTE: ALL STUDY BOLTS MAY NOT BE REQUIRED ON THESE CONDITIONS

KEYNOTE LEGEND:

- # ROOM NUMBER
- # DOOR NUMBER
- # WINDOW NUMBER
- # GENERAL NOTE NUMBER
- # GROUND PLAN
- # SECTION MARKER
- # ELEVATION MARKER

NOTE: ALL STUDY BOLTS MAY NOT BE REQUIRED ON THESE DRAWINGS

MICHAEL D. BARRAM ARCHITECTS, INC.
 1100 JEFFERSON ST.
 SUITE 1000
 DALLAS, TEXAS 75202
 TEL: 972.343.1100
 FAX: 972.343.1101
 WWW.MDBA.COM



JEFFREY LEE BASEHORE
 ARCHITECT
 807 W. 20TH AVE.
 FORT WORTH, TEXAS 76104
 817.335.1234


VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 CANTON, TX 75103

COPYRIGHT 2020 MICHAEL D. BARRAM ARCHITECTS, INC.

DATE: 06/04/2020

NO.	DATE	REVISIONS

PROJECT NO. 18098/18048
 SHEET NO. A2.002
 TITLE: FLOOR PLAN EXISTING & DEMOLITION

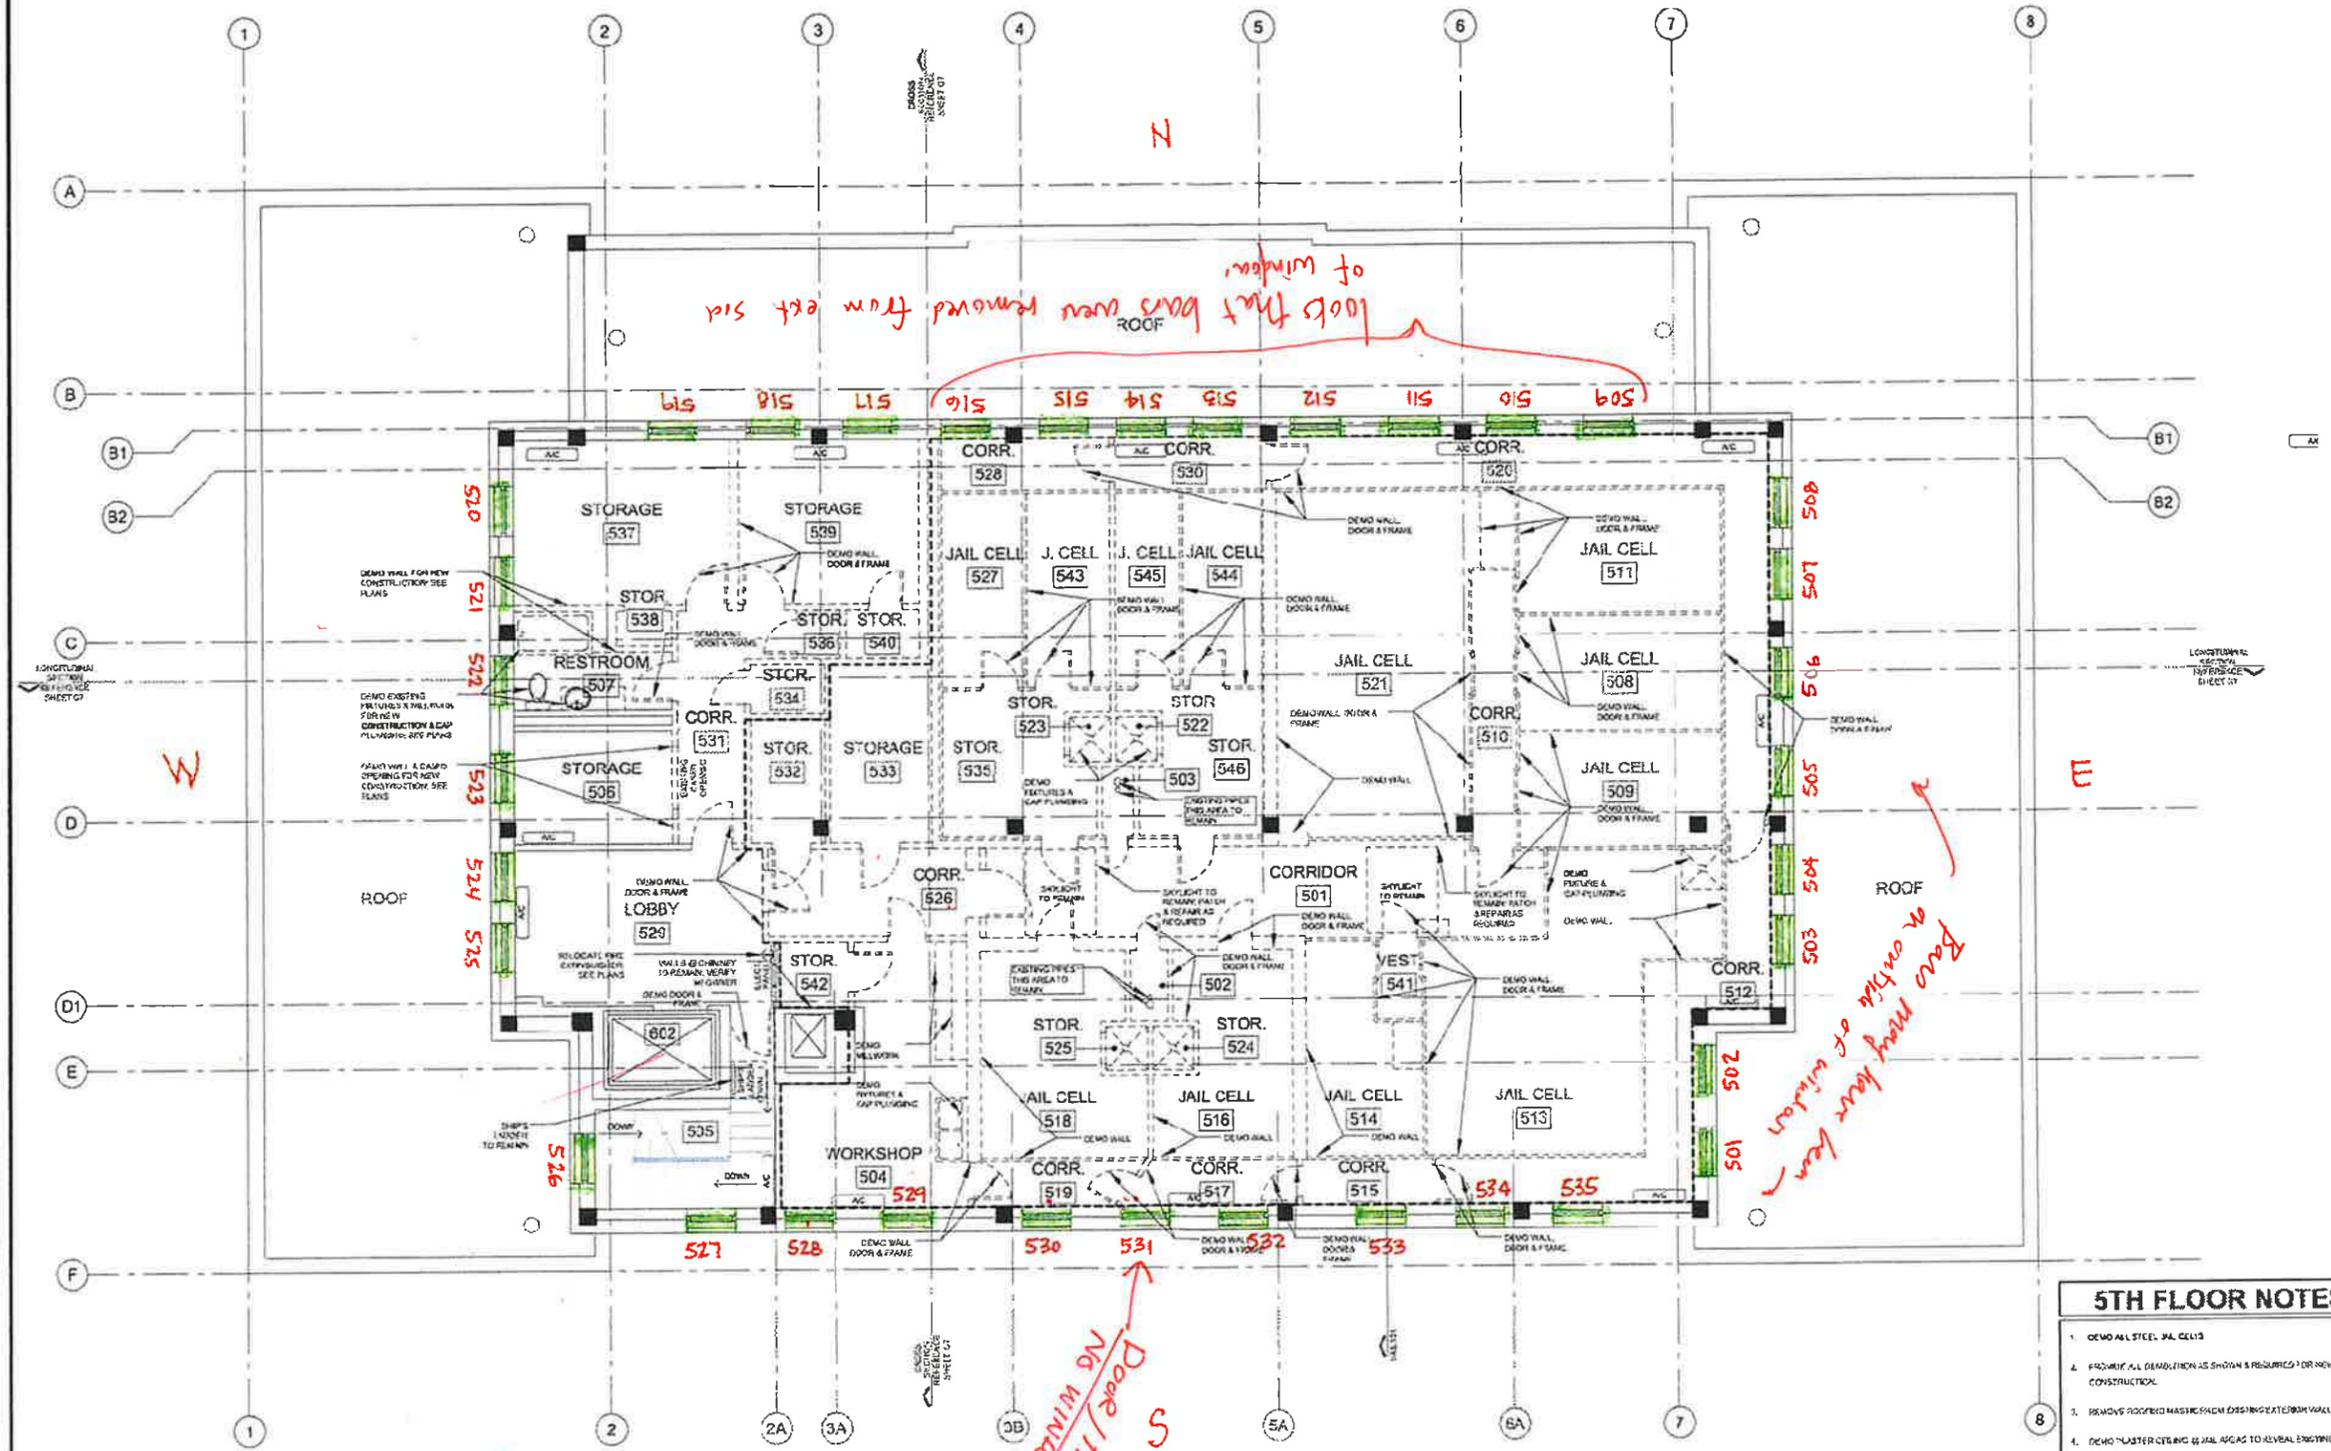

5TH FLOOR NOTES:

1. DEMO ALL STEEL JAIL CELLS
2. PROVIDE ALL DEMOLITION AS SHOWN & REQUIRED FOR NEW CONSTRUCTION
3. REMOVES APPROVED MASSIVE CONCRETE EXISTING EXTERIOR WALLS
4. DEMO MASTER CEILING & JAIL CELLS TO EXPOSE EXISTING CONCRETE STRUCTURE
5. DEMO ALL BASED CONCRETE & ASBESTOS FLOORING (SHOWN WITH SHARED AREA)

MARBLE NOTE:

ANY MARBLE REMOVED WILL BE RETAINED FOR REUSE TO PATCH EXISTING.

WALL LEGEND

- EXISTING WALLS TO REMAIN
- EXISTING WALLS TO BE REMOVED - EXCEPT WHERE NOTED
- NEW WALLS TO BE CONCRETE
- EXISTING COLUMNS TO REMAIN TYPICAL

KEYNOTE LEGEND:

- # ROOM NUMBER
- # DOOR NUMBER
- # WINDOW NUMBER
- ◇ GENERAL NOTE NUMBER
- # PROFILE NUMBER
- SECTION MARKER
- LEVEL MARKER

1 FIFTH FLOOR PLAN - EXISTING/DEMOLITION
 1/4" = 1'-0"
 4243 SF

MICHAEL D. BARNHAM ARCHITECTS, INC.
 ARCHITECTS
 801 UTZER AVENUE
 FLORENCE, TEXAS 75044
 TEL: 972.361.1100
 FAX: 972.361.1110

JEFFREY LEE BASEHORE ARCHITECT
 801 UTZER AVENUE
 FLORENCE, TEXAS 75044
 CAR: 931.521.8850


VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 GANTON, TX 75103

DATE: 06/04/2020

PROJECT NO: 18000118048

SHEET NO: A2.005

5TH FLOOR FLOOR PLAN EXISTING & DEMOLITION

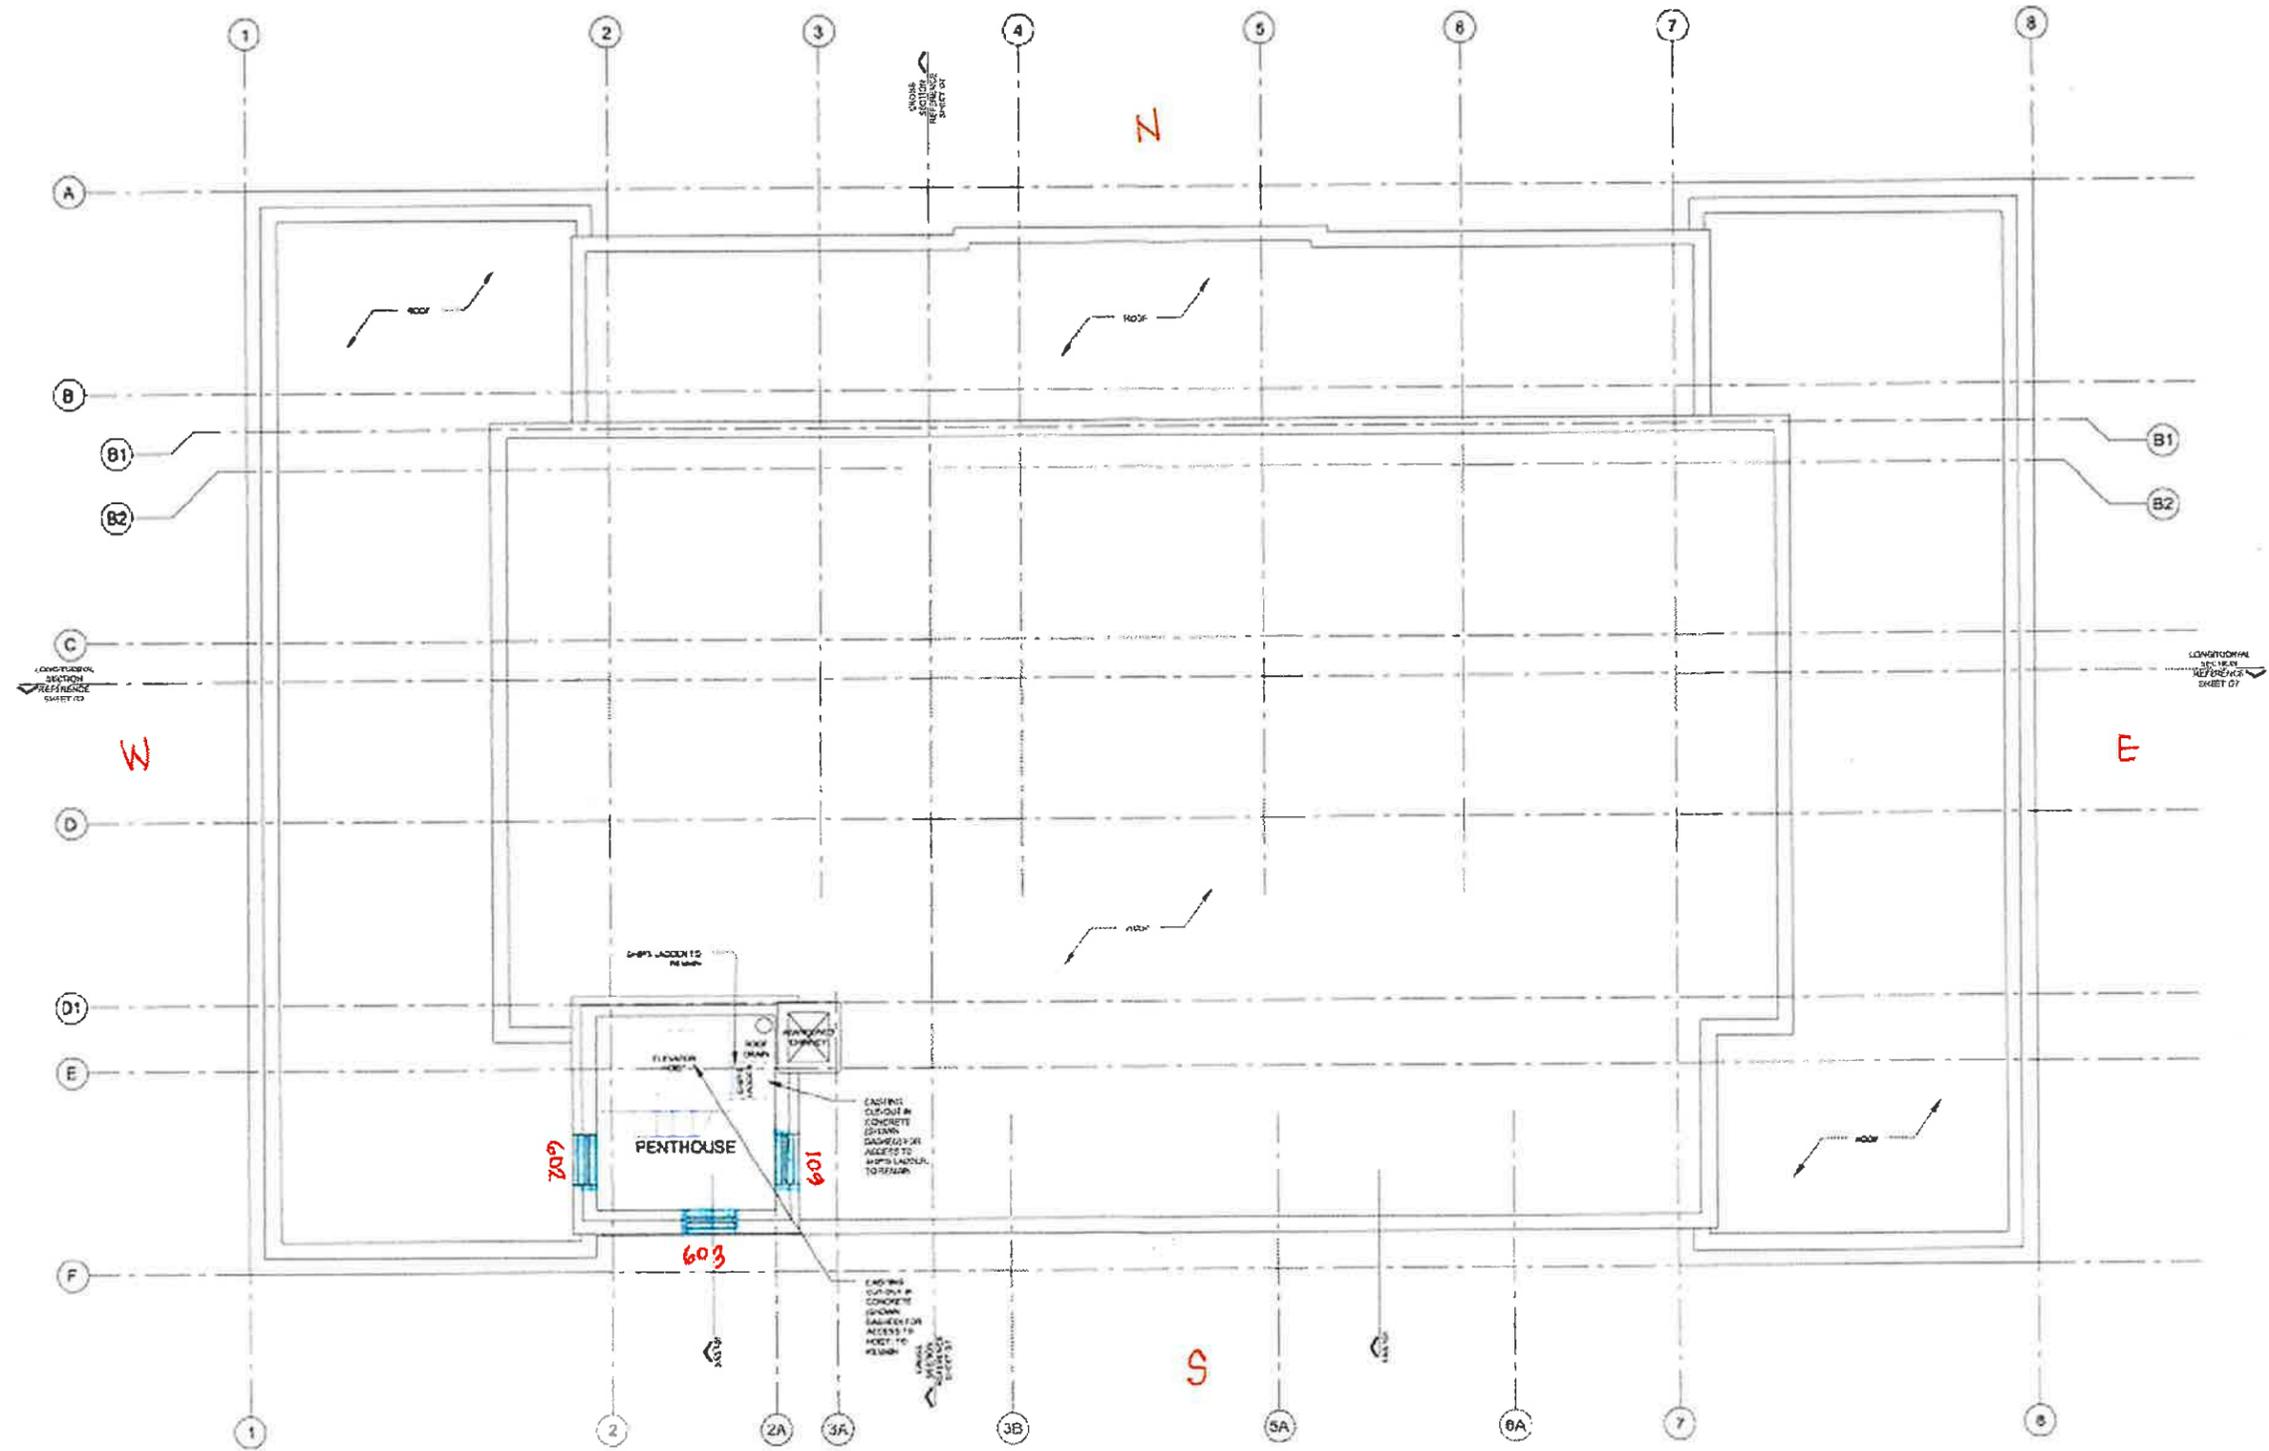

1 SIXTH FLOOR PLAN - EXISTING/DEMOLITION
 1/4" = 1'-0"
 NORTH

MARBLE NOTE:
 ANY MARBLE REMOVED WILL BE RETURNED TO MATCH EXISTING.

WALL LEGEND

EXISTING WALLS TO REMAIN
 EXISTING WALLS TO BE REMOVED - EXCEPT WHERE NOTED
 NEW WALLS TO BE CONSTRUCTED
 EXISTING WALLS TO REMAIN (THIN)

NOTE: ALL SYMBOLS & MARKINGS REQUIRED ON THESE DRAWINGS

KEYNOTE LEGEND:

ANY MARKER
 # DOOR NUMBER
 # WINDOW NUMBER

◇ GENERAL NOTE NUMBER
 # ROOM NUMBER
 --- SECTION MARKER
 ○ ELEVATION MARKER


NOTE: ALL SYMBOLS MAY NOT BE REQUIRED ON THESE DRAWINGS

MICHAEL D. BISHAM ARCHITECTS, INC.
 5001 WESTERN BLVD. SUITE 1000
 DALLAS, TEXAS 75206
 TEL: 972.382.1100 FAX: 972.382.1101

JEFFREY LEE BASEHORE ARCHITECT
 801 VICTOR BLVD. SUITE 1000
 CANTON, TEXAS 75103
 TEL: 972.382.1100 FAX: 972.382.1101

VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 CANTON, TX 75103


PROJECT NO. 190CB18948
 SHEET NO. A2.036
 6TH FLOOR FLOOR PLAN EXISTING & DEMOLITION

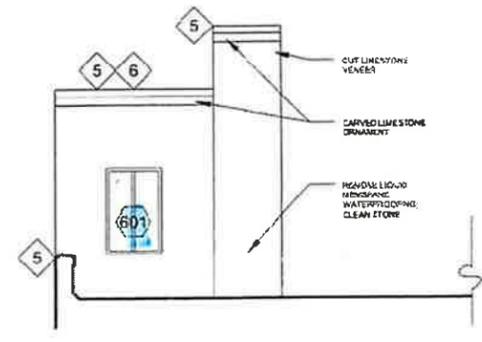

3 ELEVATION - EAST
1/4" = 1'-0"



2 ELEVATION - EAST
1/4" = 1'-0"

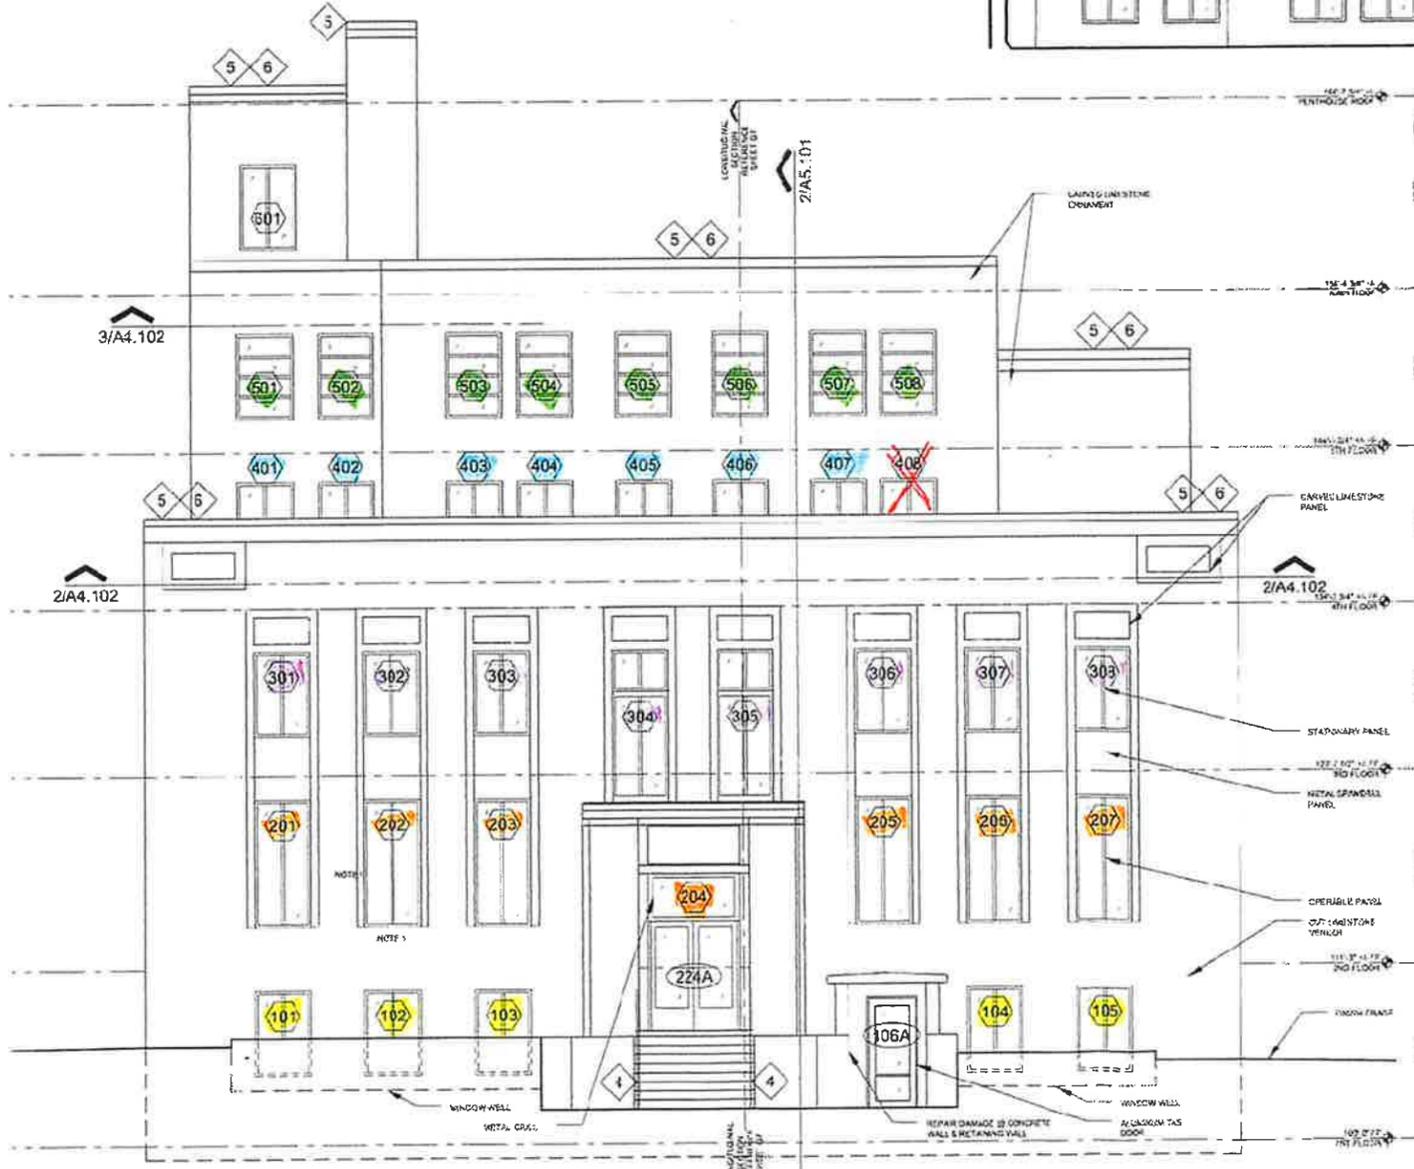

1 ELEVATION - EAST
1/4" = 1'-0"

PHYSICAL PROPERTIES: LIMESTONE AS DEFINED BY ASTM C-110
 STN 1
 LUCAS BUFF ASH L-32
 1. REGION: TEXAS, NECESSARY LIMESTONE QUARRY
 2. LIMITATIONS CONFORMING TO ASTM C-110 WITH THE FOLLOWING PROPERTIES:
 A. COMPRESSIVE STRENGTH: 3.0 COMPRESSIVE STONE, ASTM C-110-06
 B. POROSITY: MAXIMUM "DRIFT" AVERAGE OF 5 CUBES 6.7% P/S
 C. PARALLEL TO FIBER: AVERAGE OF 3 CUBES 4.34 P/S
 3. ABSORPTION AND SPECIFIC GRAVITY OF DIMENSION STONE ASTM C-110-06
 A. ABSORPTION 0.36
 B. SPECIFIC GRAVITY 2.310
 C. UNIT WEIGHT 144.2
 4. FINISH
 A. BLUET MACHINE CUT WITH SMOOTH FINISH
 5. STANDING DIMENSIONS
 A. COURSE HEIGHT: SAWY, BED 1 FOOT 4 INCH COURSE HEIGHTS (VERIFY)
 B. COURSE LENGTH: TYPICAL PANELS 1' 0" X 1' 0"
 C. BED DEPTH: 6 INCHES
 D. COURSE RANGE: NATURAL LAYERS BUFF L-32 MATCH AS2LCS2

LEGEND

	REMOVE & REPLACE ALL LIMESTONE VENEER THAT HAS BEEN PHYSICALLY DAMAGED WITH A DISCHARGE PATCH, ETC. NEW ANCHORS SHALL BE STAINLESS STEEL.
	REMOVE & REPLACE ALL DAMAGED LIMESTONE ORNAMENT. NEW ANCHORS SHALL BE STAINLESS STEEL.
	REMOVE LIQUID MEMBRANE WATERPROOFING, CLEAN & REPAIR ALL WINDOW JOINTS.
	GENERAL NOTE TAG

GENERAL NOTES: *ALL WORK NOTED IS TO MATCH EXISTING HISTORIC MATERIALS*

- REMOVE ALL WINDOW JOINTS AT EXISTING LIMESTONE VENEER. USE SPEC. SECTION 04 2119
- REPAIR/REPLACE WINDOW JOINTS AS DESCRIBED BY ARCHITECT HANDBOOK A. CHANOK. (R)
- REPAIR STONEWORK, SEE SPEC. SECTION 05 402
- EXISTING HANDRAIL & TO GRAB
- INSTALL NEW LIMESTONE PARAPET CAPSTONES
- INSTALL 1" SHARP STAINLESS STEEL CORNICES JOIN BRACKETS. CORNICES UNITS HAVE A CLIP AT EACH CORNER FOR ATTACHMENT AT CORNER PARAPET
- FOR COMPOSITION OF EXTERIOR WALLS TO REMAIN, SEE ORIGINAL DRAWINGS DATED JANUARY 7, 2016 INCLUDED IN THE CONTRACT DOCUMENTS AND AS SHEETS

MICHAEL D. BARRAN ARCHITECTS, INC.
 1800 BENTLEY ST. SUITE 1000
 DALLAS, TEXAS 75201
 TEL: 214.750.1000
 FAX: 214.750.1001

JEFFREY LEE BASEHORE ARCHITECT
 801 VICKER ST. SUITE 200
 EDOM, TEXAS 75754
 TEL: 817.527.1660

VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 CANTON, TX 75103

COMPONENT 200
 MICHAEL D. BARRAN ARCHITECTS, INC.

DATE: 06/04/2020

NO.	REVISIONS	DATE


PROJECT NO: 1800BT0048
 SHEET NO: A4.102
 EXTERIOR ELEVATIONS

- All support material indicates the sand stone facade on the exterior
 - there is much spalling @ the panels which have moved into the jambs of the window openings
- All perimeter caulk is to be replaced
- All sealant @ glass panes is to be replaced
- 5th floor windows @ the roof areas has a secondary frame welded to the historic window frame. These were for bars. These all have to be removed but frames still cover the window frames.

**METAL WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

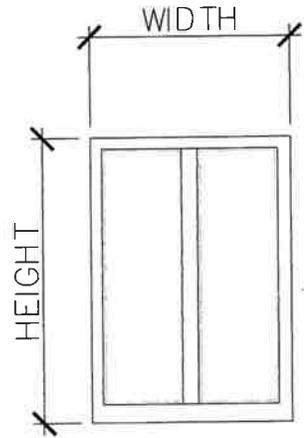

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW			SPECIFIC CONDITION NOTES																			
WINDOW NO. 101	EXPOSURE	TYPE A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
A-101-E		METAL	Good	Good	Good	Good	N/A		BAD	BAD	Good	FAIR	BAD									
SCALE: 1/4" = 1'-0"			WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE			121 E. DALLAS STREET CANTON, TEXAS 75103																			
			TYPE A																			
			Sheet ___ of ___																			

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

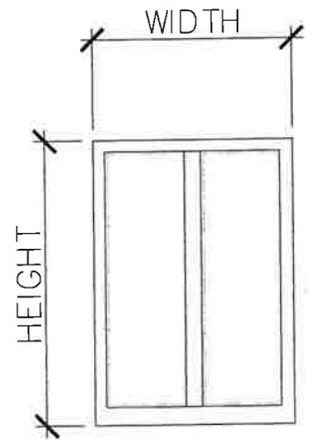

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 102	EXPOSURE	TYPE A		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
A-102-E		METAL	S.G.	Good	Good	Good	Good	N/A	POOR	FAIR	FAIR	Good	FAIR	FAIR				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
				121 E. DALLAS STREET CANTON, TEXAS 75103														
														TYPE A				
														Sheet ___ of ___				

**METAL WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

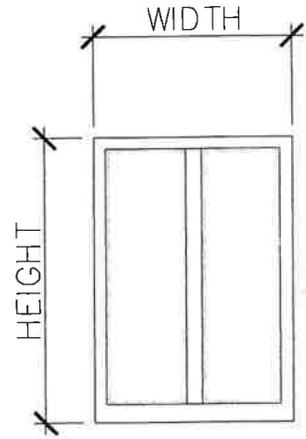

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																		
WINDOW NO. 103	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
A-103-E		METAL		GOOD	GOOD	GOOD	GOOD	N/A	✓	FAIR	FAIR	GOOD	FAIR	FAIR								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																		
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																		
				121 E. DALLAS STREET CANTON, TEXAS 75103																		
														TYPE A								
														Sheet ___ of ___								

**METAL WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

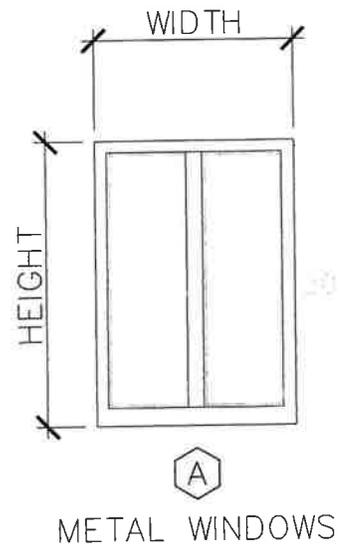


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
WINDOW NO. 105	A	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
A-105-E				METAL	S.G.	<i>Good</i>	<i>Good</i>		<i>Good</i>	<i>Good</i>	<i>N/A</i>		<i>FAIR</i>	<i>FAIR</i>	<i>Good</i>	<i>FAIR</i>	<i>FAIR</i>				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE A							
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___							

**METAL WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

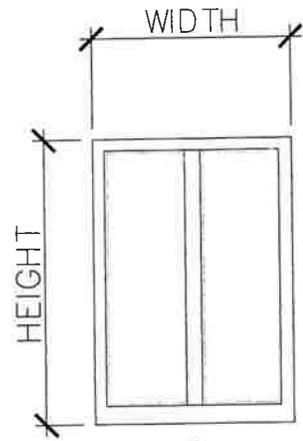

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW			SPECIFIC CONDITION NOTES													
WINDOW NO. 107	EXPOSURE	TYPE A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
A-107-N		METAL	Good	Good	Good	Good	N/A		FAIR	FAIR	Good	Good	FAIR			
SCALE: 1/4" = 1'-0"			WINDOW SURVEY/WINDOW TYPES													
DATE:		JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE													
			121 E. DALLAS STREET CANTON, TEXAS 75103													
													TYPE A			
													Sheet ___ of ___			

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

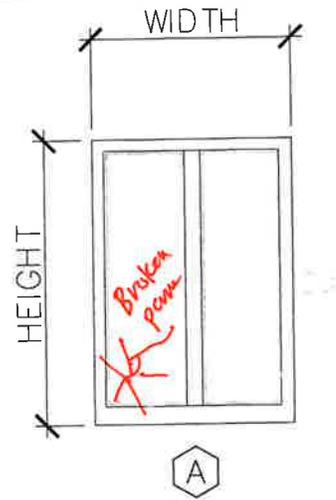

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 108	EXPOSURE	TYPE A																					
A-108-N	METAL	S.G.	GOOD	GOOD	GOOD/BAD	GOOD	N/A		BAD	BAD	GOOD	GOOD	FAIR										
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE A																			
				Sheet ___ of ___																			

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

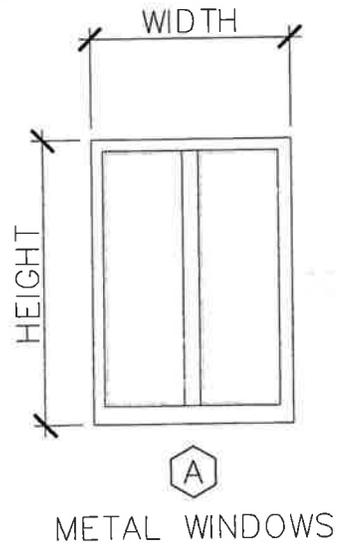

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 109	EXPOSURE	TYPE	A																				
A-109-N		METAL	S.G.	<i>Good</i>	<i>Good</i>	<i>Good</i>	<i>Good</i>	<i>N/A</i>	<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Good</i>	<i>FAIR</i>										
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE A																			
				Sheet ___ of ___																			

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

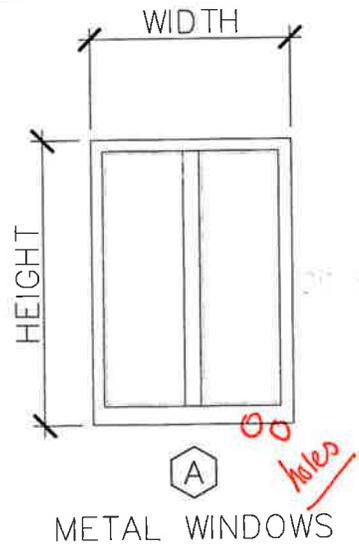

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 110	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
A-110-N		METAL	S.G.	<i>Good</i>	<i>Good</i>	<i>Good</i>	<i>Good</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Good</i>	<i>FAIR</i>				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
				121 E. DALLAS STREET CANTON, TEXAS 75103														
														TYPE A				
														Sheet ___ of ___				

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

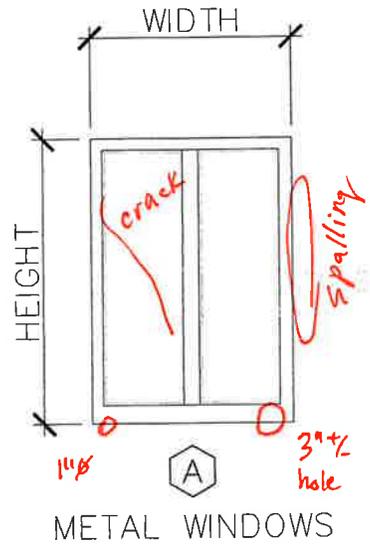

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																
WINDOW NO. 111	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	PERIMETER SEALANT							
A-111-N	FAIR	Good		<i>Left pane broken</i>	<i>BAD/Good</i>	<i>Good</i>	<i>N/A</i>	<i>BAD</i>	<i>BAD</i>	<i>FAIR</i>	<i>BAD</i>	<i>BAD</i>						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE A						
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE										Sheet ___ of ___						
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103																

XREFS:

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

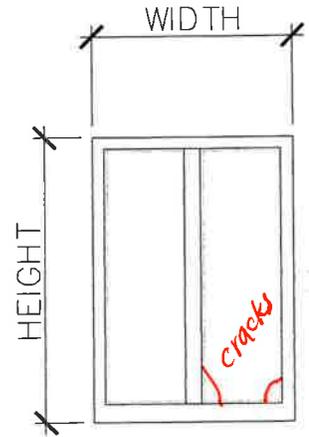

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 112	EXPOSURE	A																				
	TYPE																					
	FRAME MATERIAL																					
	GLAZING MATERIAL																					
	OVERALL CONDITION																					
	EXTERIOR FINISH																					
	INTERIOR FINISH																					
	GLASS																					
	FRAME																					
	SASHES																					
	HARDWARE																					
	GLAZING MATERIAL																					
	WEATHERSTRIPPING																					
	SUPPORT MATERIAL																					
	SILL																					
	PERIMETER SEALANT																					
A-112-N			METAL	S.G.	Good	Good	Good/Bad	Good	N/A	FAIR	FAIR	Good	Good	FAIR								
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE A								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

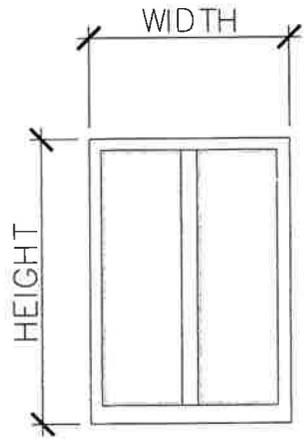

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 113	EXPOSURE	TYPE	A																				
A-113-N		METAL	S.G.	Good	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
				Good	Good	Good	Good	Good	N/A	-	FAIR	FAIR	Good	Good	FAIR								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE A																			
				Sheet ___ of ___																			

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

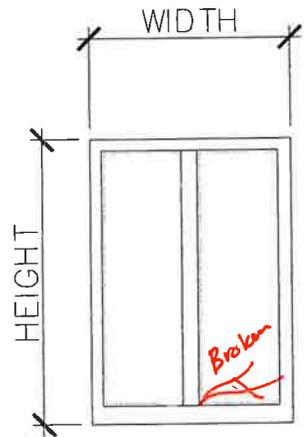

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																		
WINDOW NO. 114	EXPOSURE	TYPE A		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
A-114-N		METAL	S.G.	Good	Good	Good/Bad	Good	N/A		FAIR	FAIR	Good	Good	FAIR								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																		
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																		
				121 E. DALLAS STREET CANTON, TEXAS 75103																		
TYPE A																						
Sheet ___ of ___																						

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

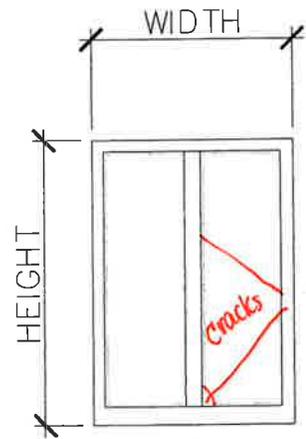

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 115	EXPOSURE	TYPE A	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
A-115-N				Good	Good	Good/Bad <i>Rt. Pane to be replaced</i>	Good	N/A		FAIR	FAIR	Good	Good	FAIR									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE A																			
				Sheet ___ of ___																			

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

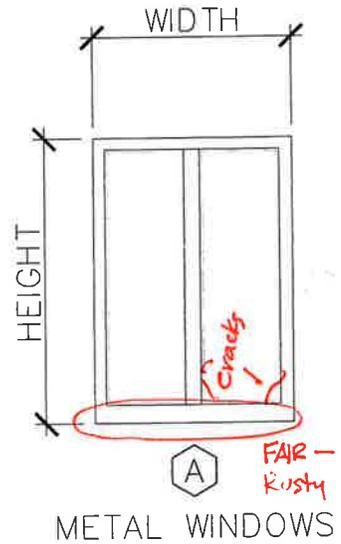

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																
WINDOW NO. 116	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
A-116-W		Good	Good	Rt. pane broken - Good/BAD	Good	N/A		FAIR	FAIR	Good	FAIR	FAIR						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																
		121 E. DALLAS STREET CANTON, TEXAS 75103																
		TYPE A																
		Sheet ___ of ___																

**METAL WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

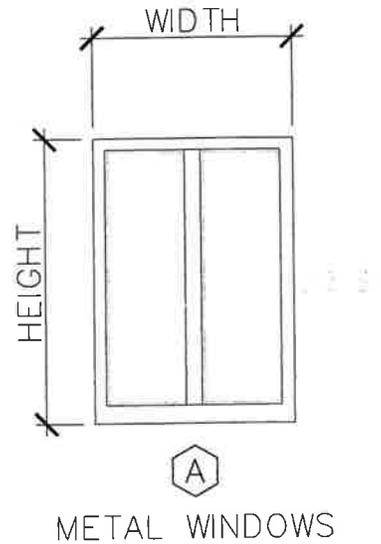

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 117	EXPOSURE	TYPE	A																				
FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
METAL	S.G.	<i>Good</i>		<i>Good</i>		<i>Good</i>	<i>Good</i>	<i>N/A</i>		<i>FAIR</i>	<i>FAIR</i>	<i>Good</i>	<i>Good</i>	<i>FAIR</i>									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE A																			
				Sheet ___ of ___																			

**METAL WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

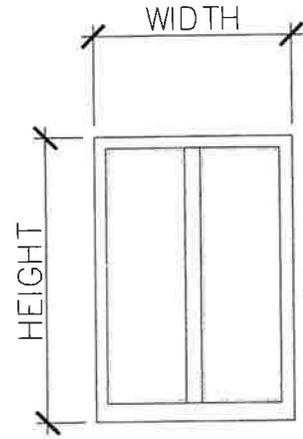

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 118	EXPOSURE	TYPE	A																				
FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
METAL	S.G.	<i>Good</i>		<i>Good</i>		<i>Good</i>	<i>Good</i>	<i>N/A</i>		<i>FAIR</i>	<i>FAIR</i>	<i>Good</i>	<i>Good</i>	<i>FAIR</i>									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE A									
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___									

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

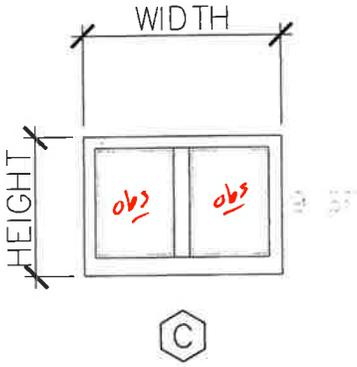

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO.	EXPOSURE	TYPE	C	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
C-119-W				Good		Obscured	Good	N/A		BAD	BAD	Good	Group	FAIR									
SCALE: 1/4" = 1'-0" DATE: _____ JOB NO.: 2023.113				WINDOW SURVEY/WINDOW TYPES VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103												TYPE C Sheet ___ of ___							

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

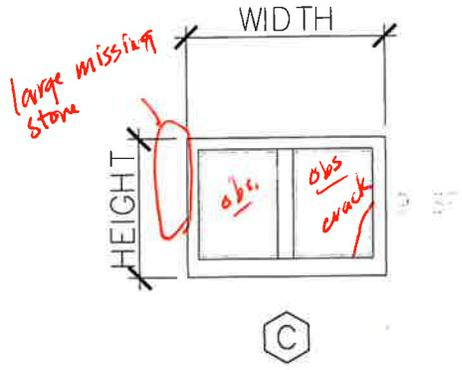

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																															
WINDOW NO.	120	EXPOSURE		TYPE	C	EXTERIOR FINISH		INTERIOR FINISH		GLASS		FRAME		SASHES		HARDWARE		GLAZING MATERIAL		WEATHERSTRIPPING		SUPPORT MATERIAL		SILL		PERIMETER SEALANT							
C-120-W						Good		Good		Good/BAD		Good		N/A				BAD		BAD		Good		Good		FAIR							
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE C																					
DATE:		JOB NO.:	2023.113			VAN ZANDT COUNTY COURTHOUSE																											
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___																					


Rt. Pane to be replaced obscured

support above panel in front is spalled

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

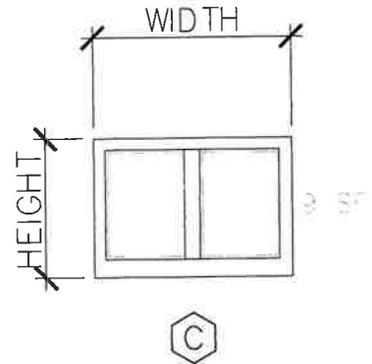

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																	
WINDOW NO. 121	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
C-121-W		C	METAL	S.G.	<i>Good</i>	<i>Good</i>		<i>Good</i>	<i>Good</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Good</i>	<i>FAIR</i>			
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE C					
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																	
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___					

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

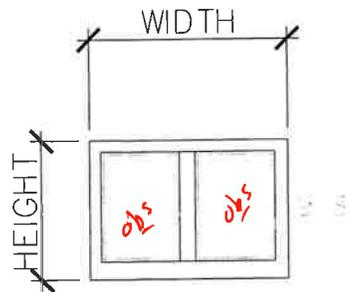

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO.	EXPOSURE	TYPE		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
C-122-S		C		Good		obscured	Good	N/A		BAD	BAD	Good	Good	FAIR							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																	
				121 E. DALLAS STREET CANTON, TEXAS 75103																	
TYPE C																					
Sheet ___ of ___																					

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

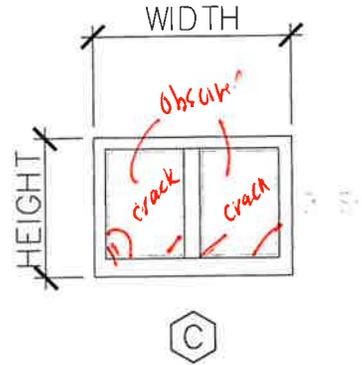

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES																	
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
C-123-S		C	METAL	S.G.	Good	Good		Replace Both panes	Good	N/A		BAD	BAD	Good	Good	FAIR							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:						JOB NO.: 2023.113						VAN ZANDT COUNTY COURTHOUSE						TYPE C					
						121 E. DALLAS STREET CANTON, TEXAS 75103						Sheet ___ of ___											

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

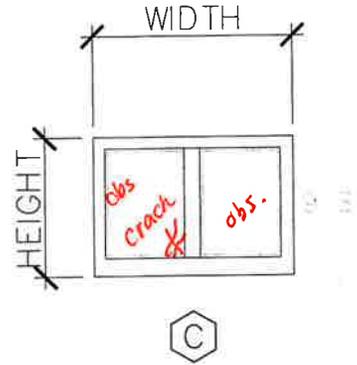

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																
WINDOW NO. 124	EXPOSURE	TYPE C		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
C-124-S			METAL	S.G.	Good	Good	Bad/Good	Good	N/A	Bad	Bad	Good	Good	FAIR						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE C						
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___						

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

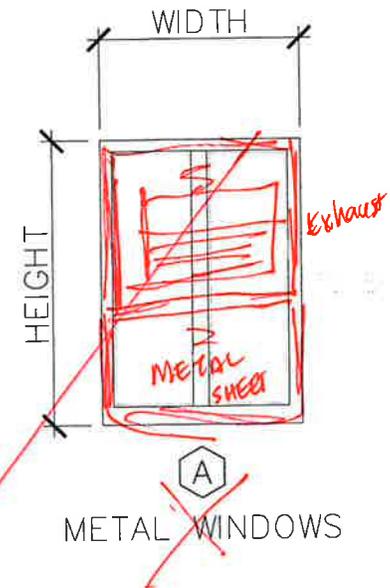

① CLEAN/REPAINT

Metal covers the whole outer face of the window/frame.

WINDOW					SPECIFIC CONDITION NOTES											
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT
A-126-S		A	METAL	S.G.	?											

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE A

Sheet ___ of ___




XREFS:

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

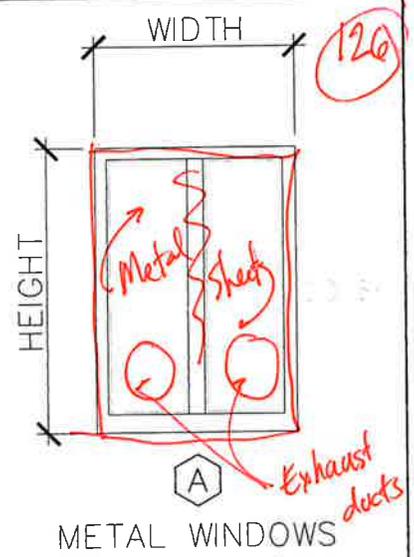

*1 CLEAN/REPAINT
Sheet metal covers the whole window opening allowing two (2) 8-10" Ø metal ducts to pass thru.*

WINDOW

SPECIFIC CONDITION NOTES

WINDOW NO.	127	EXPOSURE		TYPE	A	FRAME MATERIAL		GLAZING MATERIAL		OVERALL CONDITION		EXTERIOR FINISH		INTERIOR FINISH		GLASS		FRAME		SASHES		HARDWARE		GLAZING MATERIAL		WEATHERSTRIPPING		SUPPORT MATERIAL		SILL		PERIMETER SEALANT	
A-127-S				METAL		S.G.																											

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE A

Sheet ___ of ___




XREFS:

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

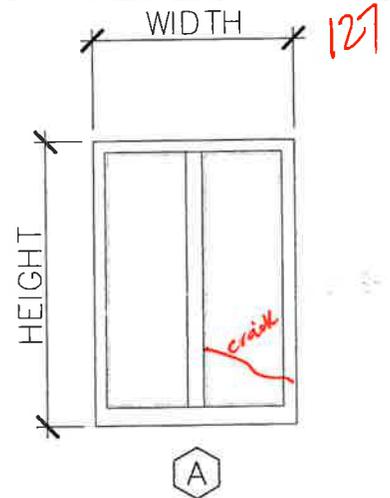

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 128	EXPOSURE	TYPE A		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
A-128-S		METAL	S.G.	Good	FAIR	Pl. Pane broken	Good/BAD	Good	N/A		FAIR	FAIR	Good	Good	FAIR			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
				121 E. DALLAS STREET CANTON, TEXAS 75103														
														TYPE A				
														Sheet ___ of ___				


128 &

WINDOW NO. 129

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

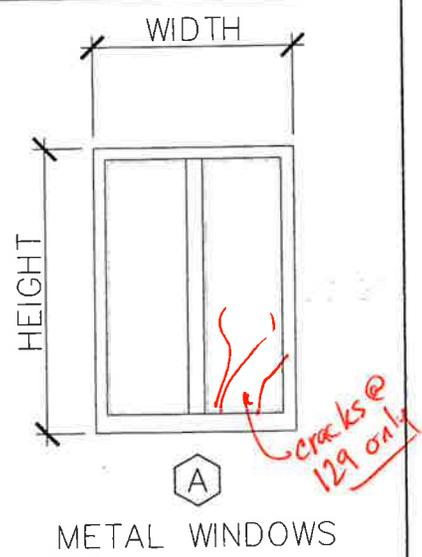

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 129	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
A-129-S		METAL		FAIR		Good/BAD @ 129 broken pane (Rt)	GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	FAIR			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:				JOB NO.: 2023.113														
				VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103														
				TYPE A Sheet ___ of ___														

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

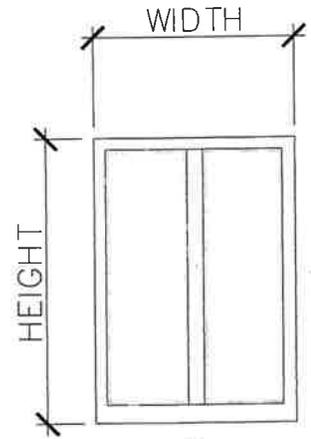

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 130																						
	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
A-130-S		A	METAL	S.G.	Good	FAIR		Good	Good FAIR	N/A		BAD	BAD	Good	Poor	FAIR						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE A								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

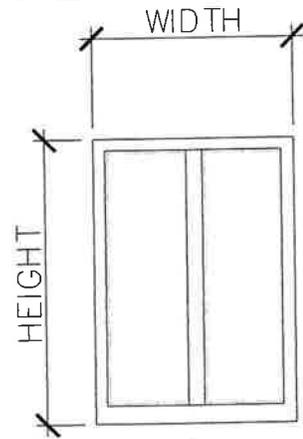

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 131	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
A-131-S		METAL		FAIR	FAIR	Good	Good	N/A		BAD	BAD	Good	Good	FAIR									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE A																			
				Sheet ___ of ___																			

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

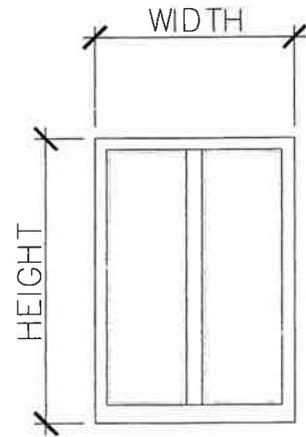

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES																	
WINDOW NO. 133	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
A-133-S		A	METAL	S.G.	FAIR	FAIR		Good	Good	N/A		BAD	BAD	Good	FAIR	FAIR							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
KOMATSU ARCHITECTURE						121 E. DALLAS STREET CANTON, TEXAS 75103						<h2 style="margin: 0;">TYPE A</h2> Sheet ___ of ___											

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

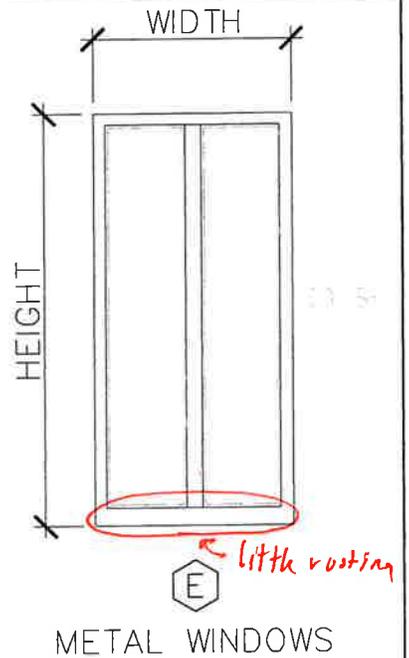

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 201	EXPOSURE	TYPE E																					
E-201-E		METAL	S.G.	<i>Good</i>	<i>Good</i>	<i>Good</i>	<i>Good</i>	<i>N/A</i>		<i>Bad</i>	<i>Bad</i>	<i>Good</i>	<i>FAIR</i>	<i>Bad</i>									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE E																			
				Sheet ___ of ___																			

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

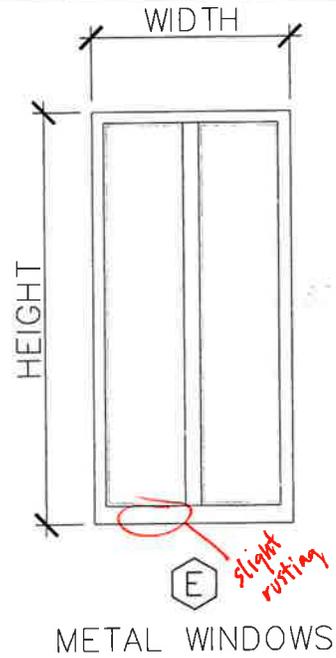

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO.	EXPOSURE	TYPE		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
E-202-E		E		Good	Good	Good	Good	N/A		BAD	BAD	Good	FAIR	BAD							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE E							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																	
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___							

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

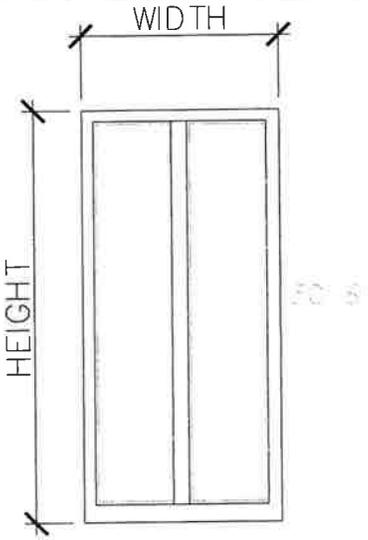

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																				
WINDOW NO. 203	EXPOSURE	TYPE	E																					
E-203-E				METAL	S.G.	Good		Good	Good	Good	N/A		BAD	BAD	Good	Good	BAD							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																				
				TYPE E																				
				Sheet ___ of ___																				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

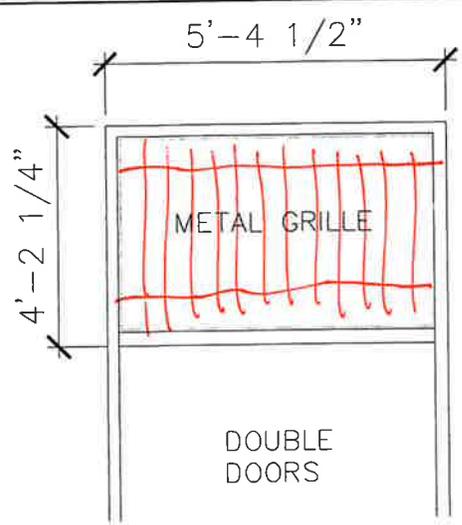

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO. 204	EXPOSURE	TYPE G	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
G-204-E			METAL	S.G.	Good	Good	Good	Good	Good	N/A		Good	Good	Good	Good	Good				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE															
KOMATSU ARCHITECTURE					121 E. DALLAS STREET CANTON, TEXAS 75103															
															TYPE G					
															Sheet__of__					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

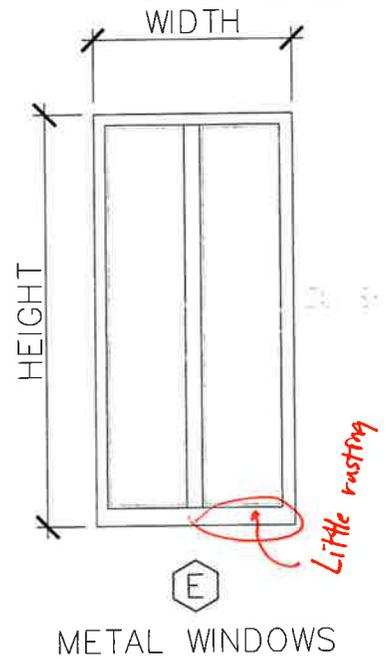

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 205	EXPOSURE	TYPE E	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
E-205-E		METAL	S.G.	GOOD	GOOD	GOOD	GOOD	N/A	BAD	BAD	GOOD	GOOD	BAD				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES															
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE															
		121 E. DALLAS STREET CANTON, TEXAS 75103															
		TYPE E															
		Sheet ___ of ___															

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

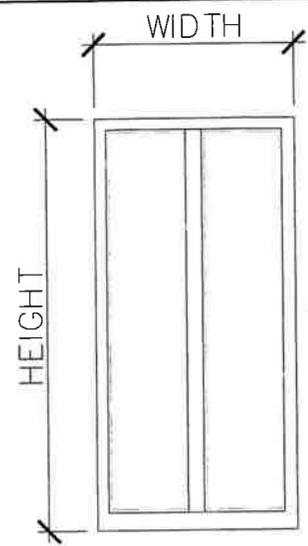

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 207	EXPOSURE	TYPE	E																			
E-207-E		METAL	S.G.	Good	Good	Good	Good	N/A	BAD	BAD	Good	Good	BAD									
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103																				
		TYPE E																				
		Sheet ___ of ___																				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

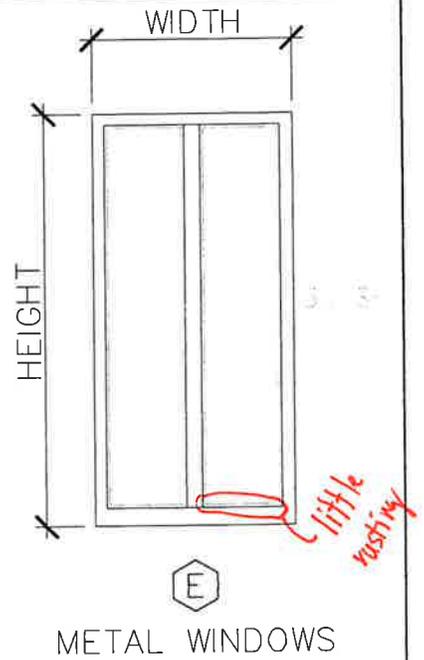

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 208	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
E-208-N			METAL	S.G.	Good	Good		Good	Good	N/A		BAD	BAD	Good	Good	BAD				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE E								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

XREFS:

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

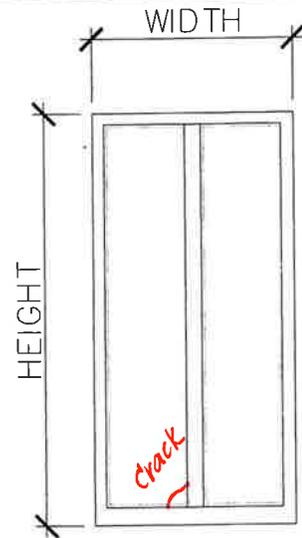

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO. 209	EXPOSURE	TYPE	E	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
E-209-N		METAL		S.G.	Good	Good	Good/BAD <i>left pane needs replaced - cracked</i>	Good	N/A	BAD	BAD	Good	Good	BAD							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE E							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																	
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

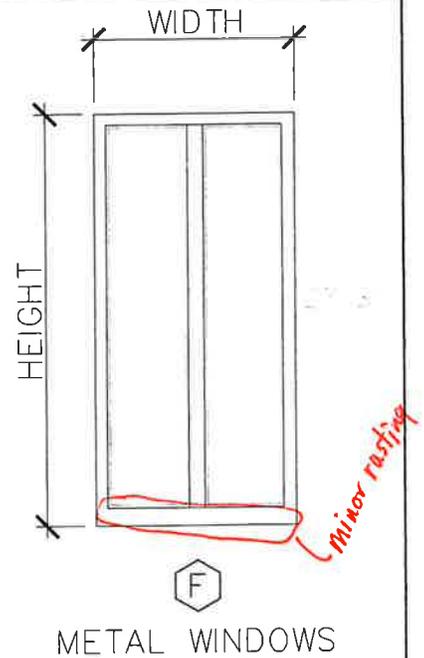


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 211	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
F-211-N		F	METAL	S.G.	Good	Good	Good	Good	Good	N/A		BAD	BAD	Good	FAIR	BAD						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE F								
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												Sheet ___ of ___						
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103																				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

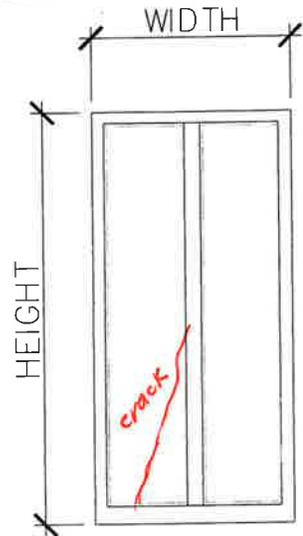

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW			SPECIFIC CONDITION NOTES																		
WINDOW NO. 212	EXPOSURE	TYPE																			
F-212-N		F	METAL	S.G.	<i>Good</i>	<i>Good</i>	<i>Bad/Good</i>	<i>Good</i>	<i>N/A</i>	<i>Bad</i>	<i>Bad</i>	<i>Good</i>	<i>Good</i>	<i>Bad</i>							
			FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
								<i>Left pane to be replaced</i>													
SCALE: 1/4" = 1'-0"			WINDOW SURVEY/WINDOW TYPES										TYPE F								
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										Sheet__of__							
				121 E. DALLAS STREET CANTON, TEXAS 75103																	
KOMATSU ARCHITECTURE																					

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

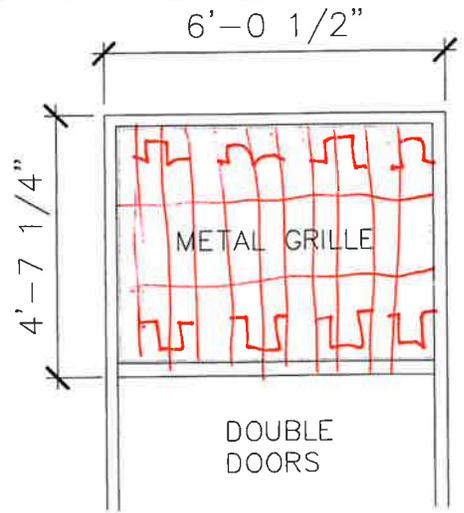

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																	
WINDOW NO. 213	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
H-213-N		H	METAL	S.G.	Good	Good		Good	Good	N/A		FAIR	FAIR	Good	Good	FAIR			
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												<p>TYPE H</p> <p>Sheet__of__</p>					
DATE:	JOB NO.: 2023.113	<p>VAN ZANDT COUNTY COURTHOUSE</p> <p>121 E. DALLAS STREET CANTON, TEXAS 75103</p>																	

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

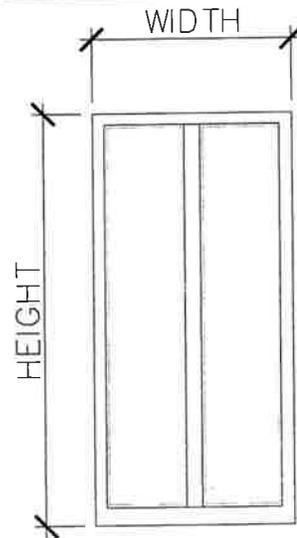

F
METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
F-214-N		F	METAL	S.G.	Good	Good		Good	Good	N/A		BAD	BAD	Good	Good	BAD							
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES																		
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																		
					121 E. DALLAS STREET CANTON, TEXAS 75103																		
TYPE F																							
Sheet ___ of ___																							

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

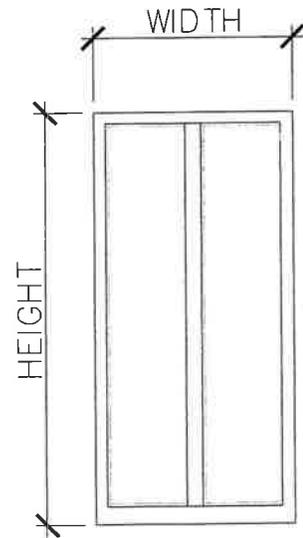

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW				SPECIFIC CONDITION NOTES												
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT
F-215-N		F	METAL	S.G.	Good	Good		Good	Good	N/A		BAD	BAD	Good	Good	BAD
												Repl.	Repl.			Repl.

SCALE: 1/4" = 1'-0"

DATE:

JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE F

Sheet ___ of ___




KOMATSU
ARCHITECTURE

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

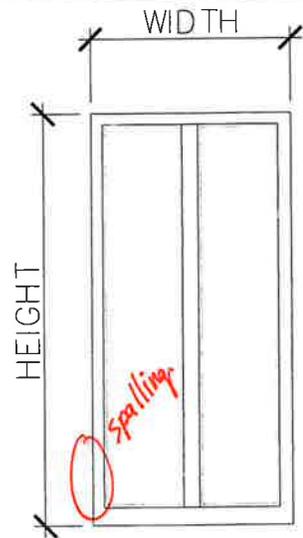

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 216	F	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	PERIMETER SEALANT						
F-216-N		Good	Good	Good	Good	N/A		BAD	BAD	Good/Fair <i>bottom left spalling</i>	Good	BAD					
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE F					
DATE:		JOB NO.: 2023.113										VAN ZANDT COUNTY COURTHOUSE					
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___					

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

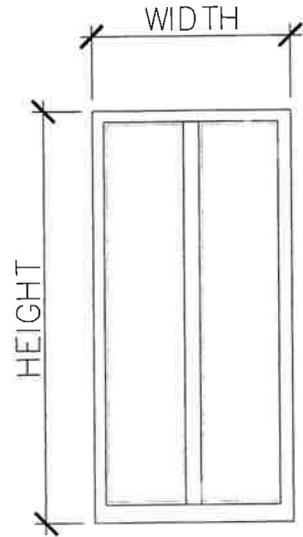

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
E-217-N		E	METAL	S.G.	Good	Good		Good	Good	N/A		BAD	BAD	Good	Good	BAD					
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE															
						121 E. DALLAS STREET CANTON, TEXAS 75103															
TYPE E																					
Sheet ___ of ___																					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

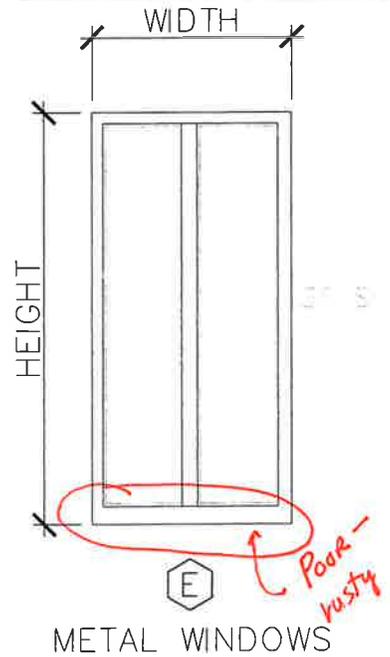

① CLEAN/REPAINT


WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO. 218	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
E-218-N			METAL	S.G.	Good	Good		Good	Good	N/A		BAD	BAD	Good	Poor	BAD				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE										TYPE E					
					121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___			

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

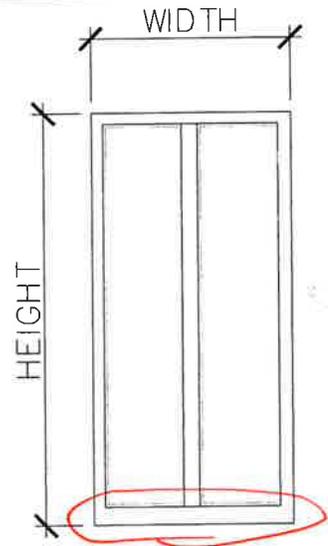

① **E Rusty**
METAL WINDOWS

① CLEAN/REPAINT


WINDOW						SPECIFIC CONDITION NOTES																		
WINDOW NO. 219	EXPOSURE	TYPE	E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
E-219-W				METAL	S.G.	Good	Good		Good	Good	N/A		BAD	BAD	Good	FAIR	BAD							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																		
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																		
KOMATSU ARCHITECTURE						121 E. DALLAS STREET CANTON, TEXAS 75103																		
TYPE E																								
Sheet ___ of ___																								

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

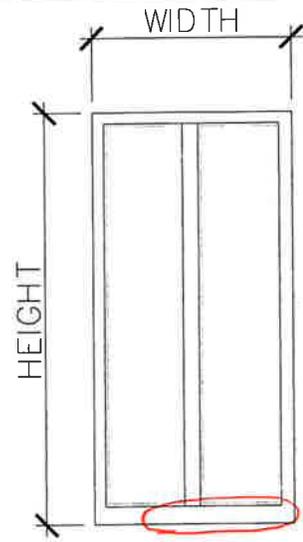

METAL WINDOWS

① CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES														
WINDOW NO.	220	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
E-220-W	E	Good	Good	Good	Good	N/A		BAD	BAD	Good	FAIR	BAD				
EXPOSURE		FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION												
METAL		S.G.														

SCALE: 1/4" = 1'-0"

DATE: JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE E

Sheet ___ of ___




XREFS:

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

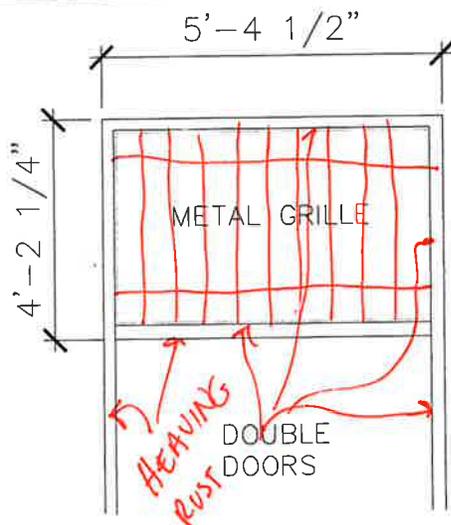

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO.	EXPOSURE	TYPE		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
G-222-W		G		Poor	Poor	Good	Poor	N/A		BAD	BAD	FAIR	Poor	BAD									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE G																			
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

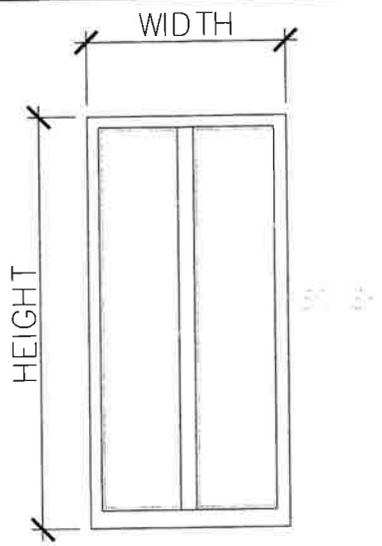

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW				SPECIFIC CONDITION NOTES													
WINDOW NO.	EXPOSURE	TYPE	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
E-223-W		E	Good	Good		Good	Good	N/A		BAD	BAD	Good	Good	BAD			

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE


121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE E

Sheet ___ of ___



WOOD WINDOW RESTORATION ASSESSMENT CODING

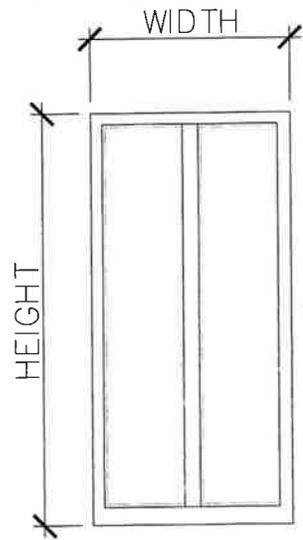

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

CONDITION DEFINITIONS:


- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

WINDOW						SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
E-224-W		E	METAL	S.G.	Good	Good		Good	Good	N/A		BAD	BAD	Good	Good	BAD					
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES										TYPE E Sheet ___ of ___					
DATE:			JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE															
						121 E. DALLAS STREET CANTON, TEXAS 75103															

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

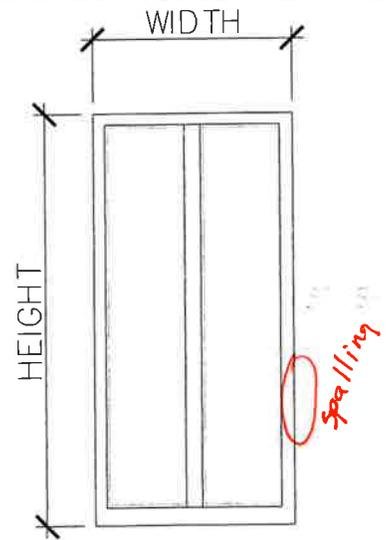

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 225	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL <i>Spalling @ lower right</i>	SILL	PERIMETER SEALANT				
E-225-W			METAL	S.G.	<i>Good</i>	<i>Good</i>		<i>Good</i>	<i>Good</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good / Fair</i>	<i>Good</i>	<i>BAD</i>				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												<p>TYPE E</p> <p>Sheet ___ of ___</p>						
DATE:	JOB NO.: 2023.113	<p>VAN ZANDT COUNTY COURTHOUSE</p> <p>121 E. DALLAS STREET CANTON, TEXAS 75103</p>																		

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

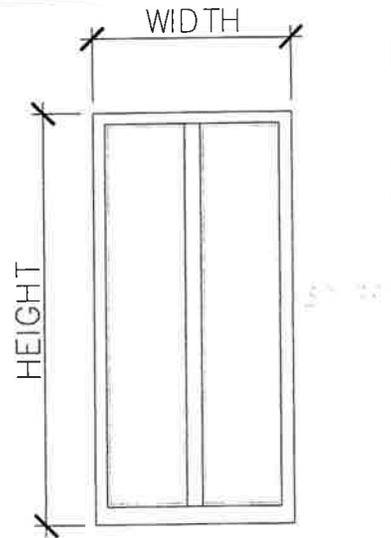

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																						
WINDOW NO. 227	EXPOSURE	TYPE	E	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT												
E-227-S				<i>Poor</i>	<i>Poor</i>	<i>Good</i>	<i>Poor</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Poor</i>	<i>BAD</i>												
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												TYPE E										
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																						
 KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___										

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

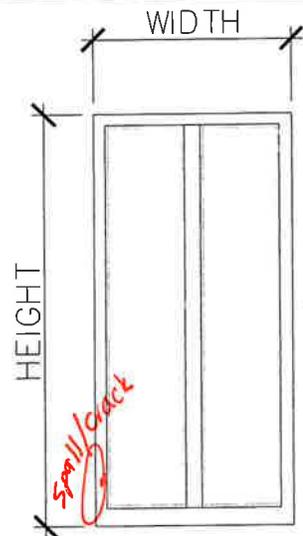

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 228	E																					
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
E-228-S		METAL	S.G.	<i>Good</i>	<i>Good</i>		<i>Good</i>	<i>Good</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good - small crack @ left bottom</i>	<i>Good</i>	<i>BAD</i>							
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

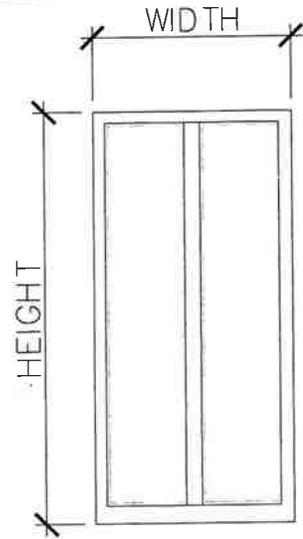

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 230	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
E-230-S		E	METAL	S.G.	Good	Good		Good	Good	N/A		BAD	BAD	Good	Good	BAD						
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES						<p>TYPE E</p> <p>Sheet__of__</p>										
DATE:		JOB NO.: 2023.113				<p>VAN ZANDT COUNTY COURTHOUSE</p> <p>121 E. DALLAS STREET CANTON, TEXAS 75103</p>																

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

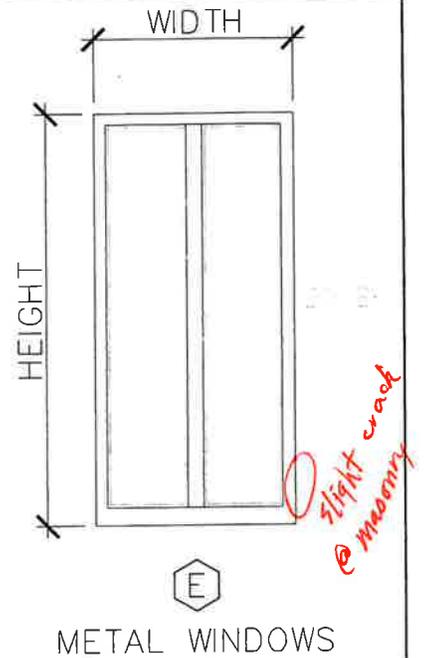

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 231	EXPOSURE	TYPE	E																	
E-231-S		METAL	S.G.	FAIR	FAIR	GOOD	FAIR	N/A	BAD	BAD	Good	FAIR	BAD							
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE E								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE										Sheet ___ of ___								
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103																		

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

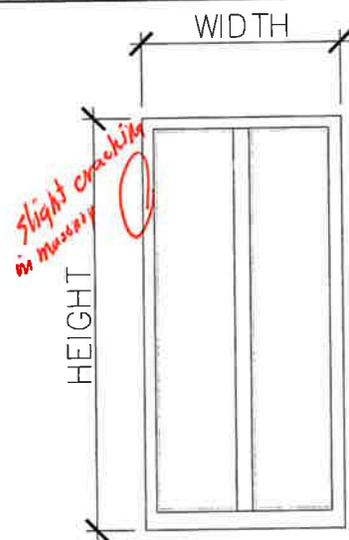

METAL WINDOWS

① CLEAN/REPAINT

XREFS:


WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 232	EXPOSURE	TYPE E		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
E-232-S			METAL	S.G.	FAIR	FAIR	GOOD	FAIR	N/A	BAD	BAD	Good	FAIR	BAD				
SCALE: 1/4" = 1'-0"			WINDOW SURVEY/WINDOW TYPES															
DATE:			JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE						TYPE E						
			121 E. DALLAS STREET CANTON, TEXAS 75103			Sheet ___ of ___												

Slight cracking in masonry top left

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

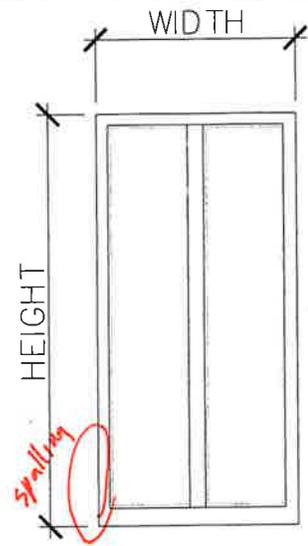


METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 233	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL <i>Spalling bottom left</i>	SILL	PERIMETER SEALANT						
E-233-S			METAL	S.G.	FAIR	FAIR		Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

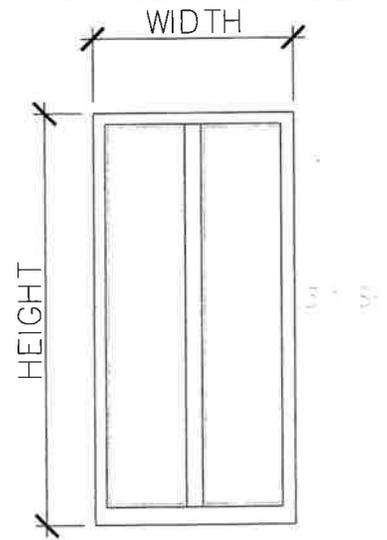

METAL WINDOWS

① CLEAN/REPAINT

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION


XREFS:

WINDOW			SPECIFIC CONDITION NOTES													
WINDOW NO. 234	EXPOSURE	TYPE E	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
E-234-S			POOR		GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD			
SCALE: 1/4" = 1'-0"			WINDOW SURVEY/WINDOW TYPES													
DATE:		JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE													
			121 E. DALLAS STREET CANTON, TEXAS 75103													
													TYPE E			
													Sheet ___ of ___			

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

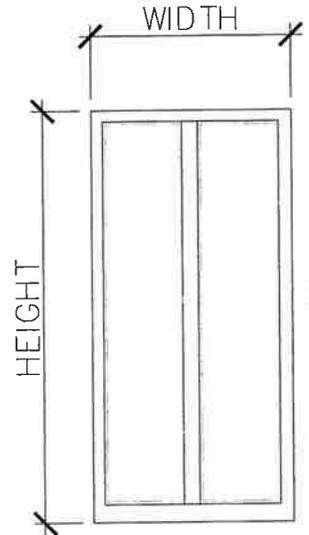

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																				
E-235-S	WINDOW NO. 235	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
				METAL	S.G.	FAIR	FAIR		Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
				121 E. DALLAS STREET CANTON, TEXAS 75103																				
																TYPE E								
																Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

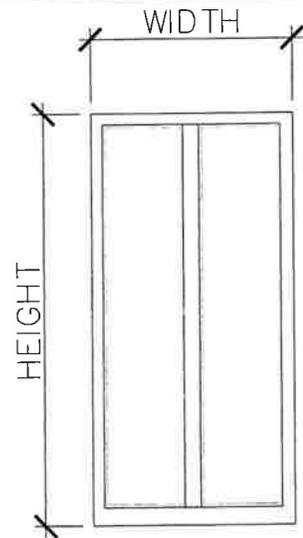

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
E-236-S		E	METAL	S.G.	FAIR	FAIR		Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD					
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES															
DATE:			JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE															
						121 E. DALLAS STREET CANTON, TEXAS 75103						TYPE E									
												Sheet ___ of ___									

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

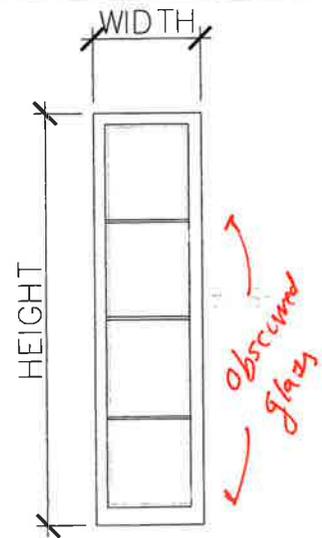

METAL WINDOWS

@ next room

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
J-237-S		J	METAL	S.G.	Good	Good		Obscured - All	Good	Good	N/A		Fair	Fair	Good	Good	Fair				
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES															
DATE:			JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE															
						121 E. DALLAS STREET CANTON, TEXAS 75103															
																	TYPE J				
																	Sheet ___ of ___				

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

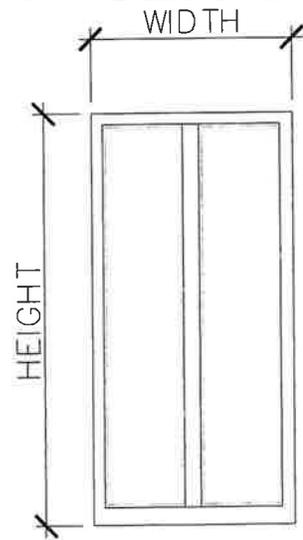


METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW					SPECIFIC CONDITION NOTES														
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
E-238-S		E	METAL	S.G.	FAIR	FAIR		GOOD	GOOD	N/A		BAD	BAD	GOOD	FAIR	BAD			
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE												TYPE E		
					121 E. DALLAS STREET CANTON, TEXAS 75103														
																	Sheet ___ of ___		

WOOD WINDOW RESTORATION ASSESSMENT CODING

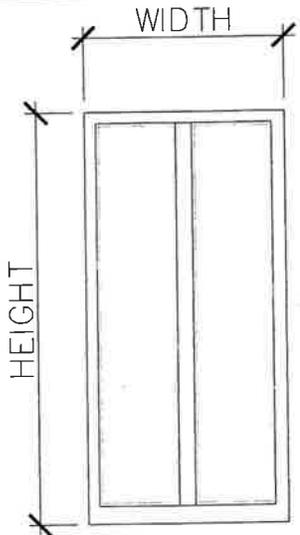

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

CONDITION DEFINITIONS:


- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

WINDOW		SPECIFIC CONDITION NOTES																					
WINDOW NO. 239																							
EXPOSURE	E																						
TYPE	E																						
FRAME MATERIAL		METAL																					
GLAZING MATERIAL		S.G.																					
OVERALL CONDITION		FAIR																					
EXTERIOR FINISH		Good																					
INTERIOR FINISH																							
GLASS		Good																					
FRAME		Good																					
SASHES		N/A																					
HARDWARE																							
GLAZING MATERIAL		BAD																					
WEATHERSTRIPPING		BAD																					
SUPPORT MATERIAL		Good																					
SILL		FAIR																					
PERIMETER SEALANT		BAD																					
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																					
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___									

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

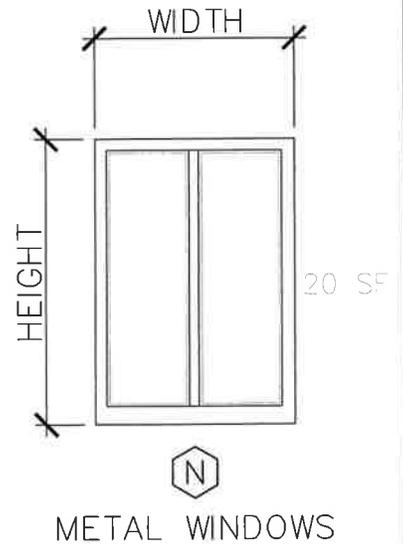


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																				
WINDOW NO. 301	EXPOSURE	TYPE	N																					
N-301-E				METAL	S.G.	FAIR		FAIR		GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																				
				TYPE N																				
				Sheet ___ of ___																				

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

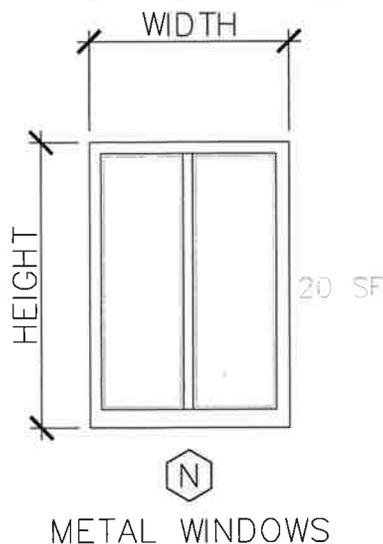

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
302		N																					
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
N-302-E			METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												TYPE N							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
																Sheet ___ of ___							

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

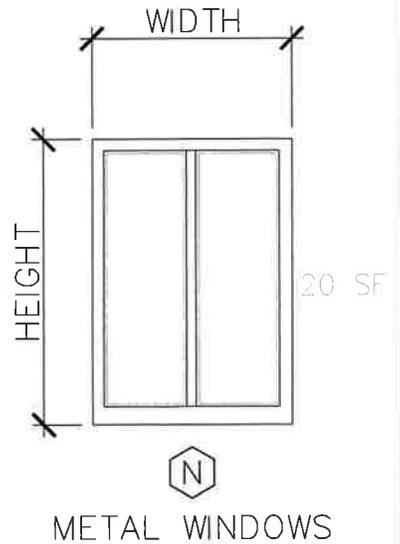


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 303	EXPOSURE	TYPE	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
N-303-E				FAIR	FAIR	GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE N									
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___									

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

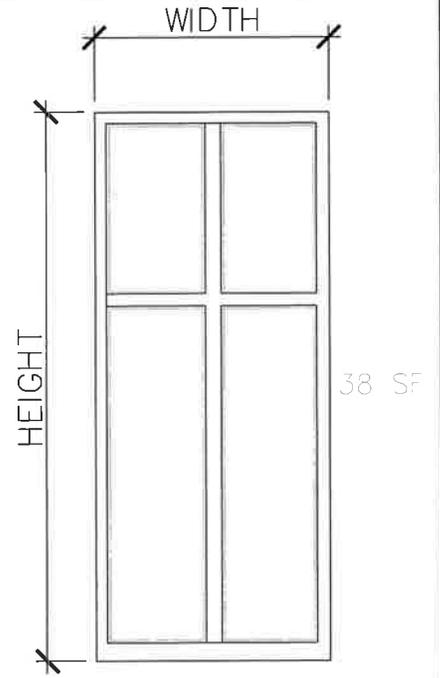

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES															
WINDOW NO. 304	EXPOSURE	TYPE	P	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
P-304-E				METAL	S.G.	FAIR	FAIR	GOOD	FAIR	N/A	BAD	BAD	GOOD	FAIR	BAD				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE															
				121 E. DALLAS STREET CANTON, TEXAS 75103															
				TYPE P Sheet__of__															

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

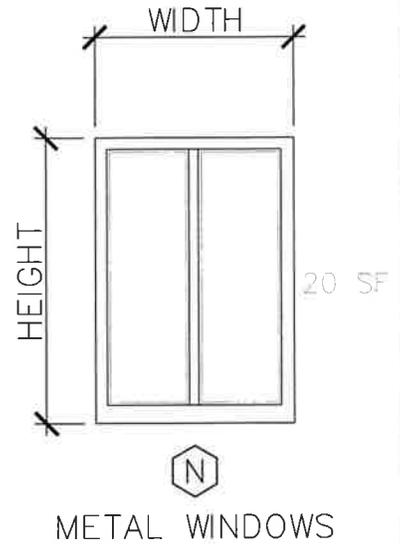

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 306	EXPOSURE	TYPE N		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-306-E			METAL	S.G.	FAIR	FAIR	GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103														
				TYPE N														
				Sheet ___ of ___														

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

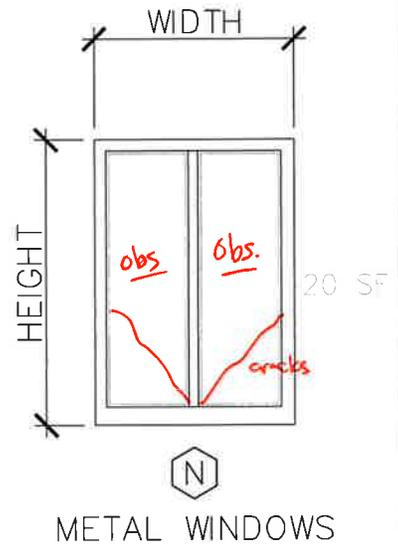

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-307-E		N	METAL	S.G.	FAIR	FAIR		Repl.	BAD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD			
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES										TYPE N				
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE														
						121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

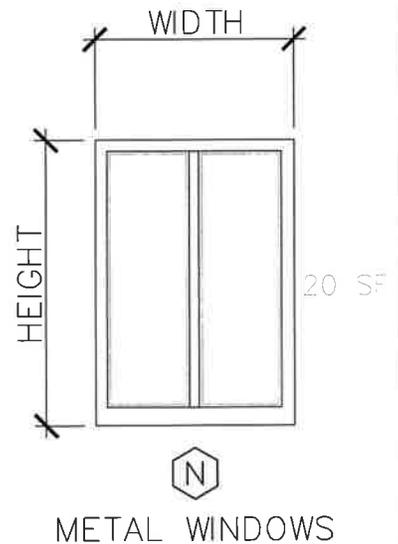

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES														
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
N-308-E		N	METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD			
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE														
					121 E. DALLAS STREET CANTON, TEXAS 75103														
TYPE N																			
Sheet ___ of ___																			

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

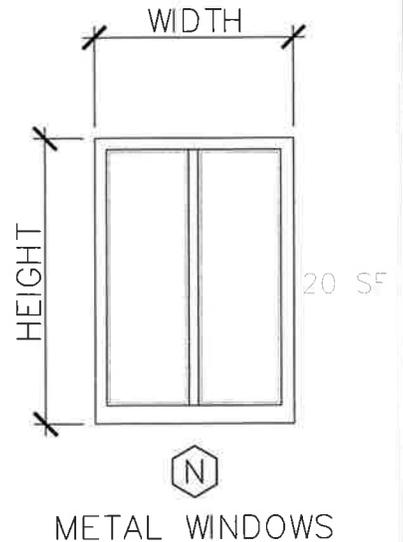


XREFS:

WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO. 309	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-309-N		N	METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE										TYPE N					
KOMATSU ARCHITECTURE					121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

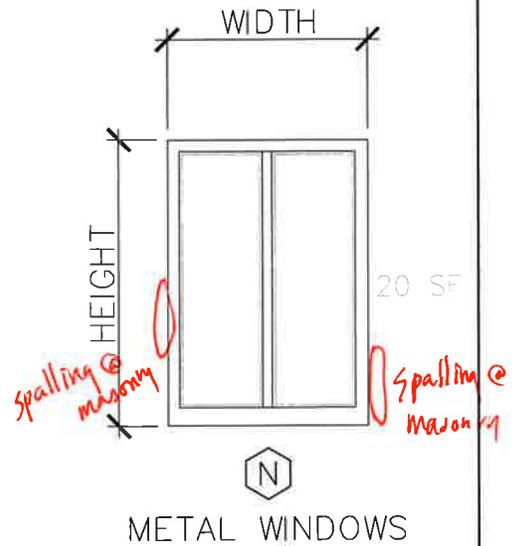


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 310	EXPOSURE	TYPE	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-310-N				FAIR		GOOD	FAIR	N/A		BAD	BAD	POOR	FAIR	BAD				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE N				
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

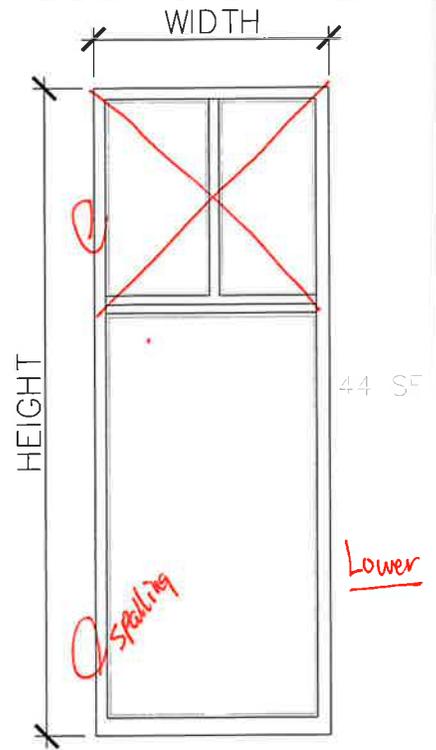

METAL WINDOWS

1) CLEAN/REPAINT

WINDOW						SPECIFIC CONDITION NOTES																	
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
Q-311-N		Q	METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	FAIR	FAIR	BAD							

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE Q


Sheet ___ of ___



WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

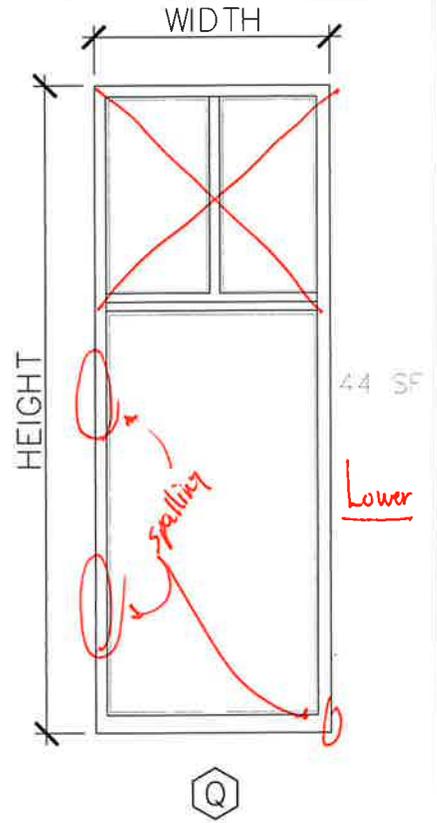

METAL WINDOWS

CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 312	EXPOSURE	TYPE	Q	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
Q-312-N				FAIR	FAIR	GOOD	FAIR	N/A		BAD	BAD	FAIR	FAIR	BAD									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
														TYPE Q									
														Sheet ___ of ___									

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

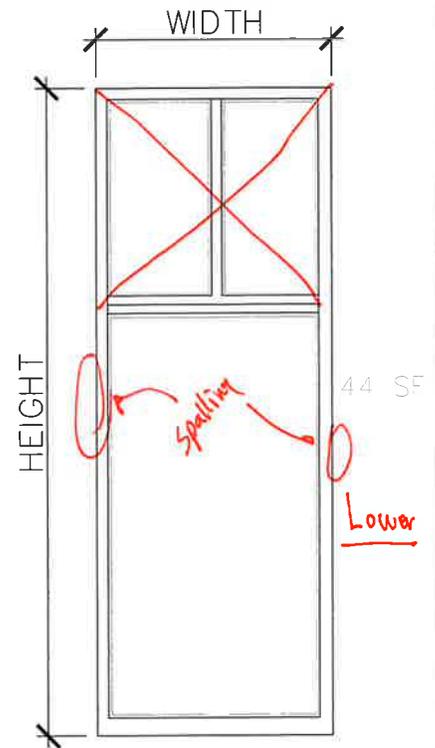

METAL WINDOWS

XREFS:

1) CLEAN/REPAINT

WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
Q-313-N			METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	FAIR	FAIR	BAD				

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE Q

Sheet ___ of ___




KOMATSU
ARCHITECTURE

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

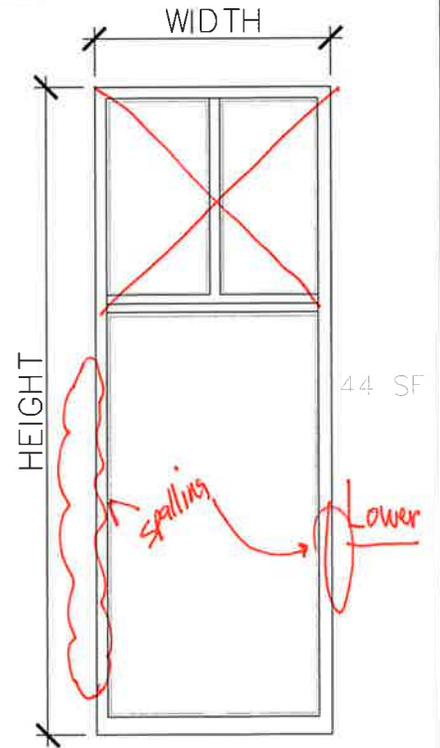

METAL WINDOWS

XREFS:


1) CLEAN/REPAINT

WINDOW						SPECIFIC CONDITION NOTES														
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
Q-314-N		Q	METAL	S.G.	<i>Poor</i>	<i>Poor</i>		<i>Good</i>	<i>Poor-Fair</i>	<i>N/A</i>		<i>BAD</i>	<i>PAD</i>	<i>FAIR</i>	<i>FAIR</i>	<i>BAD</i>				
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES										TYPE Q				
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE														
						121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

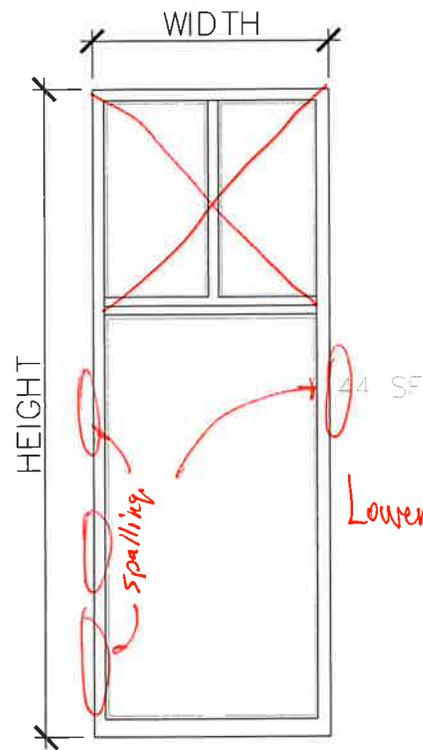

METAL WINDOWS

XREFS:


1) CLEAN/REPAINT

WINDOW						SPECIFIC CONDITION NOTES																	
315	EXPOSURE	TYPE	Q	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
Q-315-N				METAL	S.G.	Poor	Poor		Good	Poor	N/A		BAD	BAD	FAIR	FAIR/POOR	BAD						
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE												TYPE Q					
KOMATSU ARCHITECTURE						121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

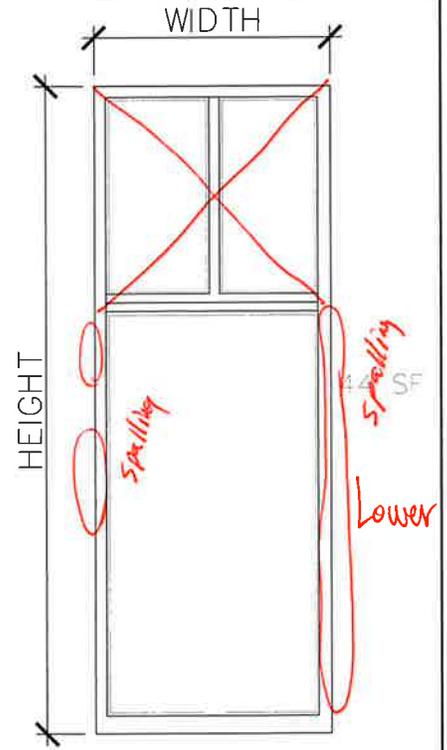

Q
METAL WINDOWS

1) CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES														
316	EXPOSURE	TYPE	Q	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
Q-316-N				Poor		Good	Poor	N/A		BAD	BAD	FAIR	Poor	BAD				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE Q				
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___						

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

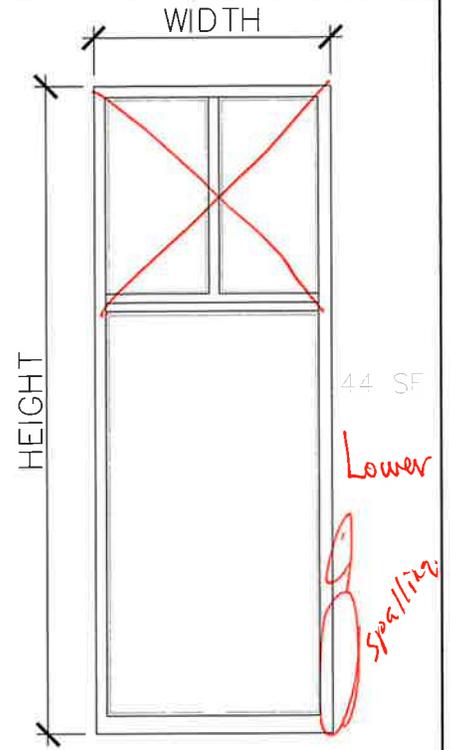

METAL WINDOWS

XREFS:


1) CLEAN/REPAINT

WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO. 317	EXPOSURE	TYPE Q	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
Q-317-N			METAL	S.G.	Poor	Poor		Good	Poor	N/A		Bad	Bad	FAIR	Poor	Bad							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES						<p>TYPE Q</p> <p>Sheet ___ of ___</p>											
DATE:			JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																	
						121 E. DALLAS STREET CANTON, TEXAS 75103																	

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

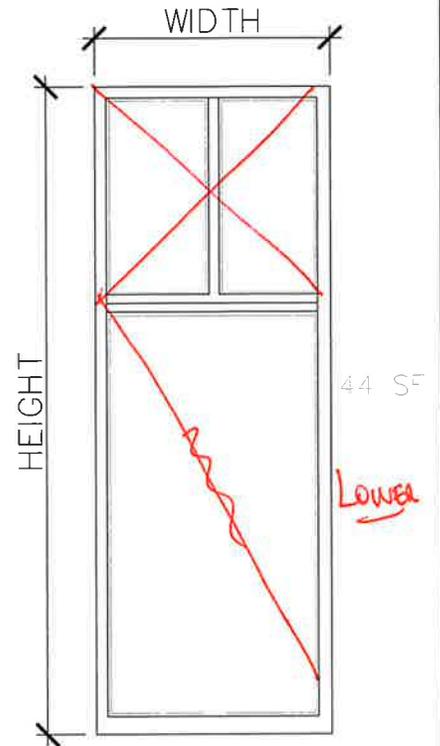

METAL WINDOWS

XREFS:

1) CLEAN/REPAINT


WINDOW					SPECIFIC CONDITION NOTES														
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
319		Q																	
Q-319-N			METAL	S.G.	Poor	Poor		Good	Poor	N/A		BAD	BAD	Good	Poor	BAD			

SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES		TYPE Q
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE		
		121 E. DALLAS STREET CANTON, TEXAS 75103		Sheet ___ of ___

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

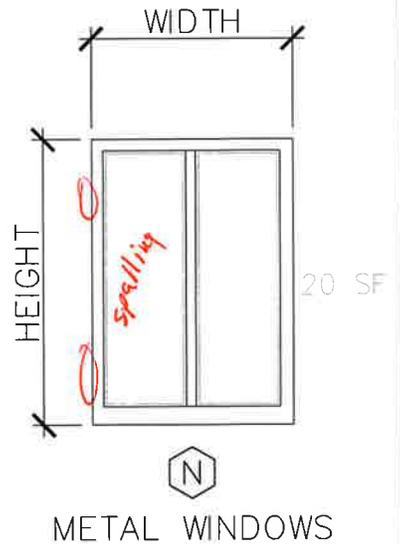

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																	
WINDOW NO. 320	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
N-320-N		N	METAL	S.G.	FAIR	FAIR		Good	FAIR	N/A		BAD	BAD	FAIR	FAIR	BAD						
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES						TYPE N Sheet__of__										
DATE:			JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																
						121 E. DALLAS STREET CANTON, TEXAS 75103																

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

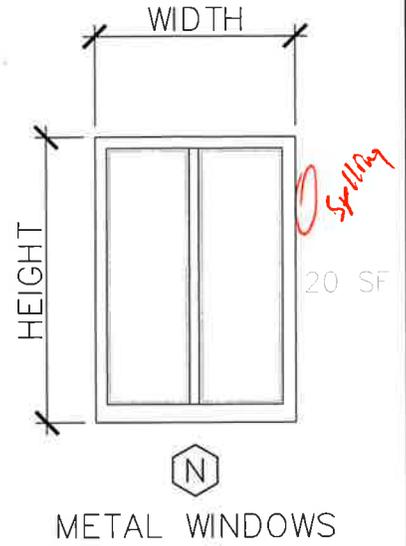

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																	
WINDOW NO. 321	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
N-321-N		N	METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	FAIR	FAIR	BAD						
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																	
		KOMATSU ARCHITECTURE			121 E. DALLAS STREET CANTON, TEXAS 75103																	
TYPE N																						
Sheet ___ of ___																						

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

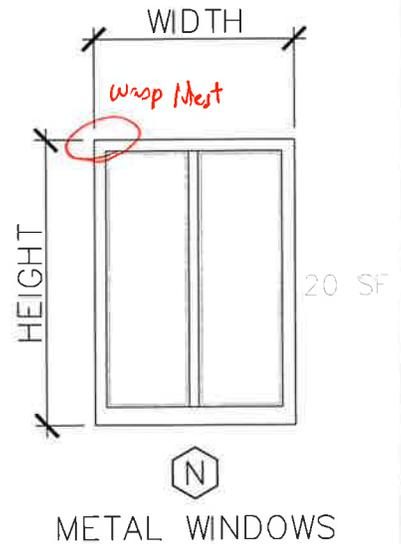

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 322	EXPOSURE	TYPE	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-322-W				FAIR		Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD				
FRAME MATERIAL				GLAZING MATERIAL				OVERALL CONDITION										
METAL				S.G.				FAIR										
TYPE				N														
EXPOSURE																		
GLAZING MATERIAL																		
OVERALL CONDITION																		
EXTERIOR FINISH																		
INTERIOR FINISH																		
GLASS																		
FRAME																		
SASHES																		
HARDWARE																		
GLAZING MATERIAL												Rpl.						
WEATHERSTRIPPING												Rpl.						
SUPPORT MATERIAL												Stone						
SILL												FAIR						
PERIMETER SEALANT												Rpl.						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES								TYPE N						
DATE:				JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE										
				121 E. DALLAS STREET CANTON, TEXAS 75103								Sheet ___ of ___						

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

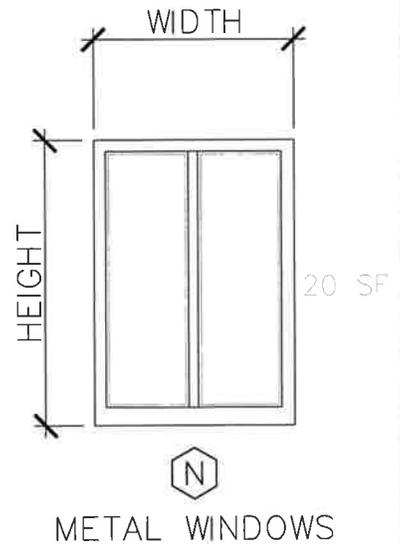

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 323	EXPOSURE	TYPE	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
N-323-W				FAIR		Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE N									
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet__of__									

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

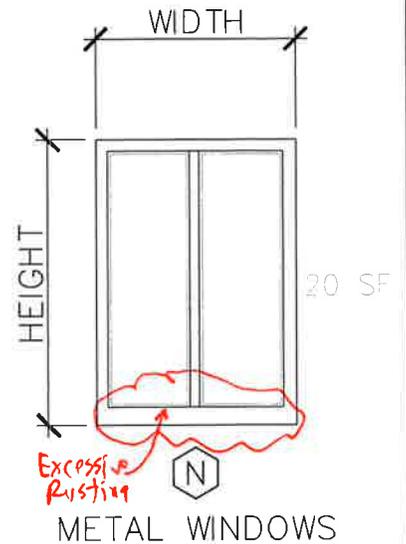

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																
WINDOW NO. 324	EXPOSURE	TYPE	N		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
N-324-W					FAIR			GOOD	FAIR/POOR	N/A		BAD	BAD	GOOD	FAIR	BAD					
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES																
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE										TYPE N						
KOMATSU ARCHITECTURE					121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

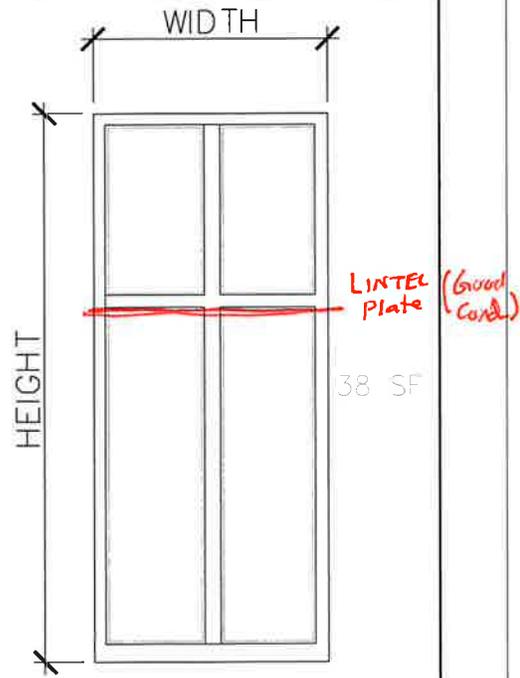

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
P-325-W	325		P																				
WINDOW NO.	EXPOSURE	TYPE		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
		METAL		FAIR	FAIR	Good	FAIR	N/A		Bad Rpl.	Bad Rpl.	Good <i>Window damages @ header</i>	FAIR	Bad Rpl.									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
DATE:		JOB NO.: 2023.113		TYPE P																			
DATE:		JOB NO.: 2023.113		Sheet ___ of ___																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

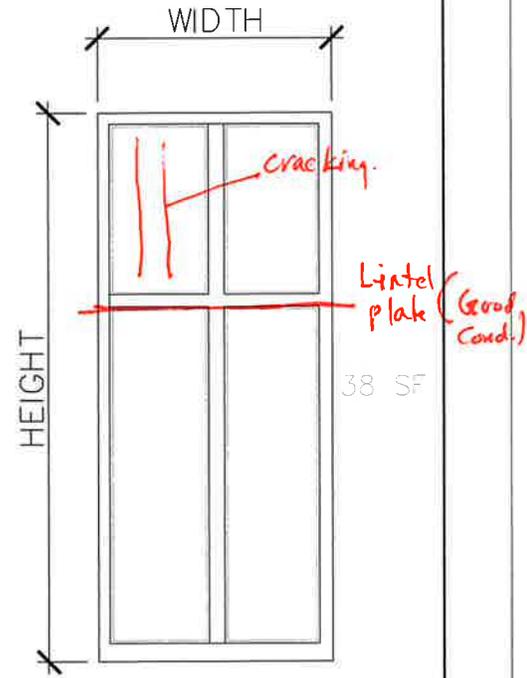

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
P-326-W	326	EXPOSURE	TYPE P	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
				METAL	S.G.	Poor	Poor		Some cracked	Poor	N/A		Rpl.	Rpl.	Water damage @ header.	Poor	BAD			
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE P								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

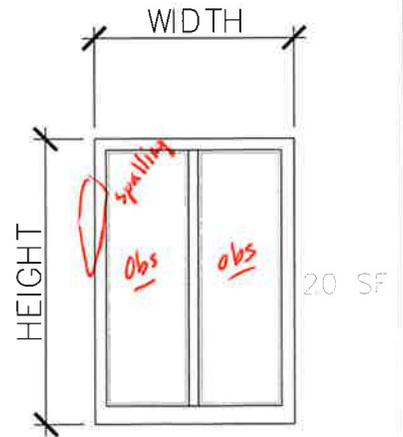

METAL WINDOWS

@ restroom

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																	
WINDOW NO. 327	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
N-327-W		N	METAL	S.G.	FAIR	FAIR		<i>Good (observed)</i>	FAIR	N/A		BAD	BAD	Good	FAIR	BAD			
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE N					
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																	
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

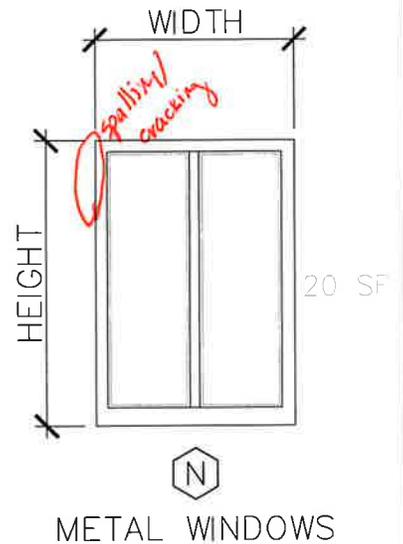

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 328	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-328-W		N	METAL	S.G.	FAIR	FAIR	FAIR	Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD				
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE														
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103																		
TYPE N																				
Sheet ___ of ___																				

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

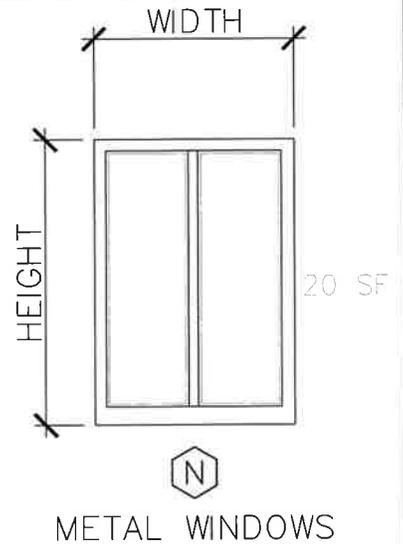


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 329	EXPOSURE	TYPE	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
N-329-W				FAIR	FAIR	Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
														TYPE N									
														Sheet ___ of ___									

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

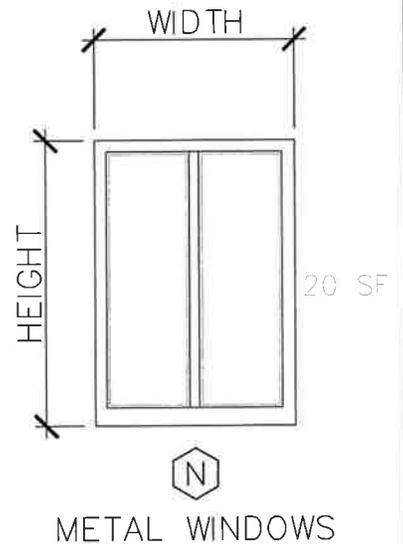

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 330	N	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
N-330-S			METAL	S.G.	FAIR	FAIR		<i>Good</i>	FAIR	<i>N/A</i>		BAD	BAD	<i>Good</i>	FAIR	BAD						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE												TYPE N								
		121 E. DALLAS STREET CANTON, TEXAS 75103														Sheet ___ of ___						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

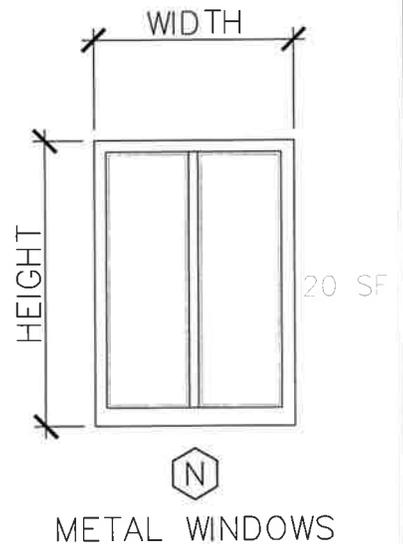

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO. 331	EXPOSURE	TYPE N	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-331-S			METAL	S.G.	FAIR		FAIR	Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE															
					121 E. DALLAS STREET CANTON, TEXAS 75103															
TYPE N																				
Sheet ___ of ___																				

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

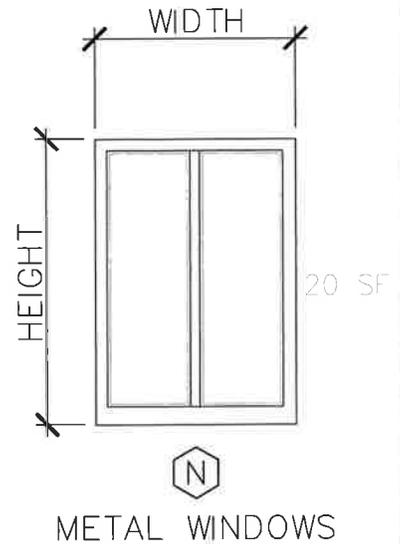

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																		
WINDOW NO. 332	EXPOSURE	TYPE	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
N-332-S				FAIR	-	FAIR	FAIR	N/A		BAD	BAD	Good	FAIR	BAD								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																		
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																		
				TYPE N																		
				Sheet__of__																		
				121 E. DALLAS STREET CANTON, TEXAS 75103																		

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

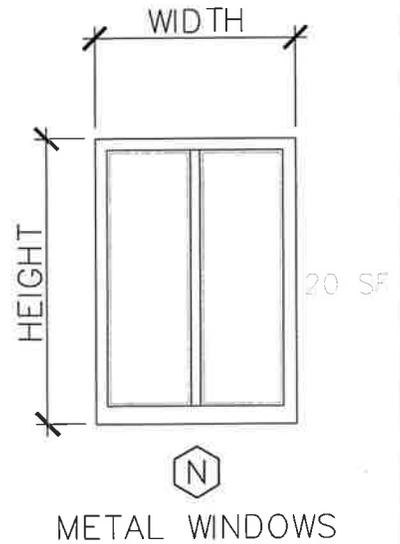


XREFS:

WINDOW						SPECIFIC CONDITION NOTES																
WINDOW NO. 333	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
N-333-S		N	METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD						
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES						<div style="font-size: 2em; font-weight: bold;">TYPE N</div> <div style="font-size: 1.2em;">Sheet ___ of ___</div>										
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																
		KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

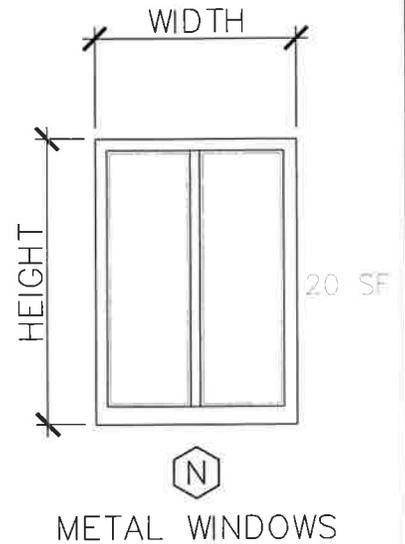

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES													
WINDOW NO. 334	EXPOSURE	TYPE	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
N-334-S		METAL		S.G.	FAIR	FAIR	GOOD	FAIR	N/A	BAD	BAD	GOOD	FAIR	BAD			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES													
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE N			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___			

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

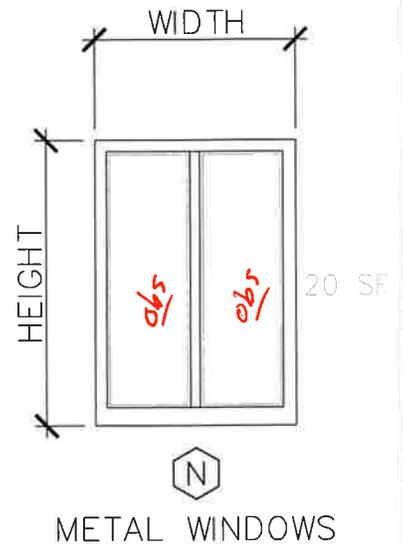

① CLEAN/REPAINT

XREFS:

WINDOW						SPECIFIC CONDITION NOTES														
WINDOW NO. 335	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-335-S		N	METAL	S.G.	FAIR	FAIR		Obscured	FAIR	FAIR	N/A	BAD	BAD	Good	FAIR	BAD				
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE														
						121 E. DALLAS STREET CANTON, TEXAS 75103														
						TYPE N														
						Sheet ___ of ___														




KOMATSU
ARCHITECTURE

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

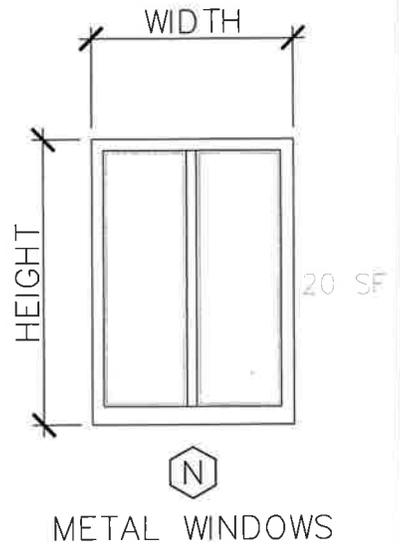

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES														
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
N-337-S		N	METAL	S.G.	FAIR	FAIR	-	GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD			
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES											TYPE N			
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE														
					121 E. DALLAS STREET CANTON, TEXAS 75103											Sheet ___ of ___			

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

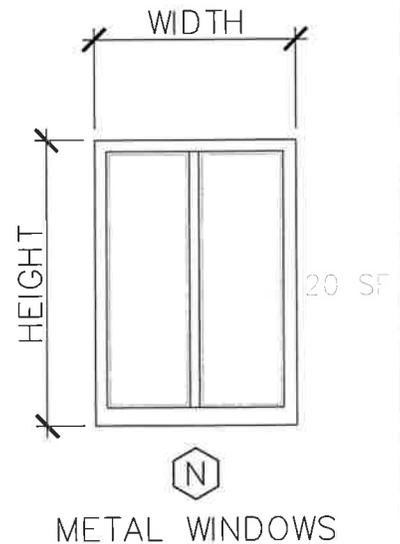

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES														
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
N-338-S		N	METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD			
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES										TYPE N				
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE														
					121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

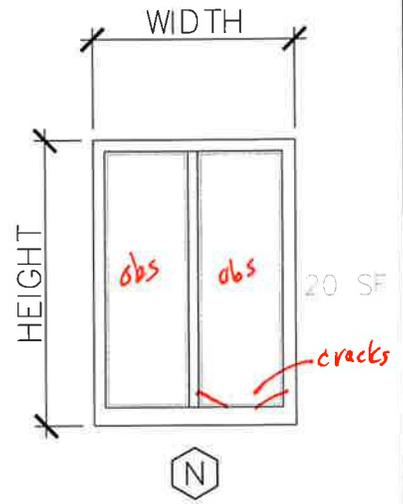

METAL WINDOWS

@ Restroom

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES																	
WINDOW NO. 339	EXPOSURE	TYPE	N																				
N-339-S		METAL	S.G.	FAIR		FAIR		FAIR/BAD	<i>replace east pane</i>	FAIR	N/A		BAD	BAD	Good	FAIR	BAD						
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES						<h2 style="font-size: 2em;">TYPE N</h2> <p>Sheet__of__</p>											
DATE:			JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																	
						121 E. DALLAS STREET CANTON, TEXAS 75103																	

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

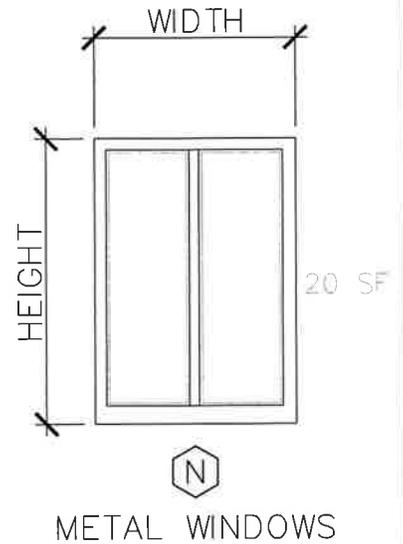

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
N-340-S		N	METAL	S.G.	FAIR	FAIR		Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD.					
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE															
						121 E. DALLAS STREET CANTON, TEXAS 75103															
																TYPE N					
																Sheet ___ of ___					

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

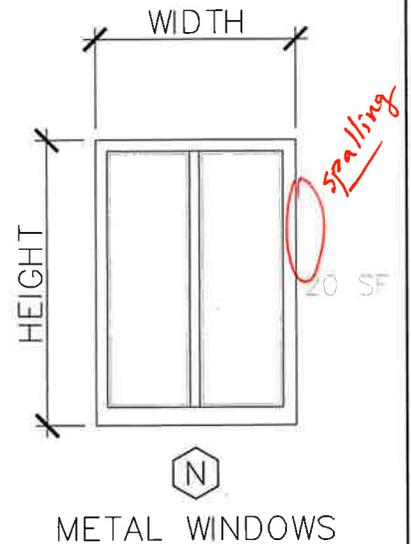

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES														
WINDOW NO. 342	EXPOSURE	TYPE	N		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-342-S		METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	Good/FAIR	FAIR	BAD				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE														
KOMATSU ARCHITECTURE					121 E. DALLAS STREET CANTON, TEXAS 75103														
															TYPE N				
															Sheet ___ of ___				

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

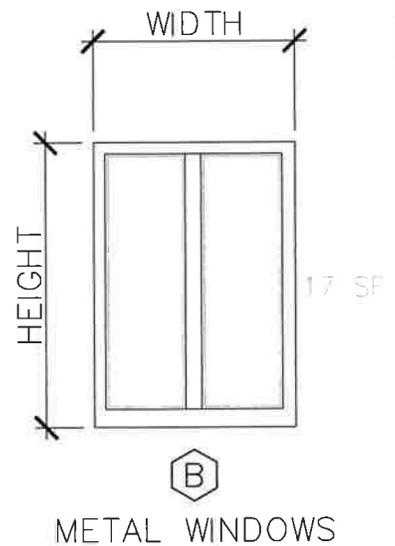

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO. 406	EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-406-E			METAL	S.G.	FAIR	FAIR		Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
						121 E. DALLAS STREET CANTON, TEXAS 75103																	
						TYPE B																	
						Sheet__of__																	

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

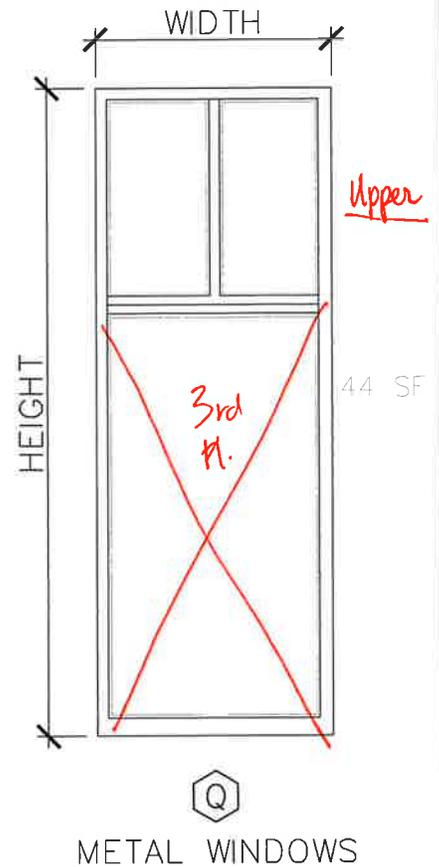

XREFS:


1) CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES																				
408	Q	WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
Q-408-N					METAL	S.G.	Poor	Poor		Good	Poor/FAIR	N/A		BAD	BAD	GOOD	Poor	BAD				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE Q								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

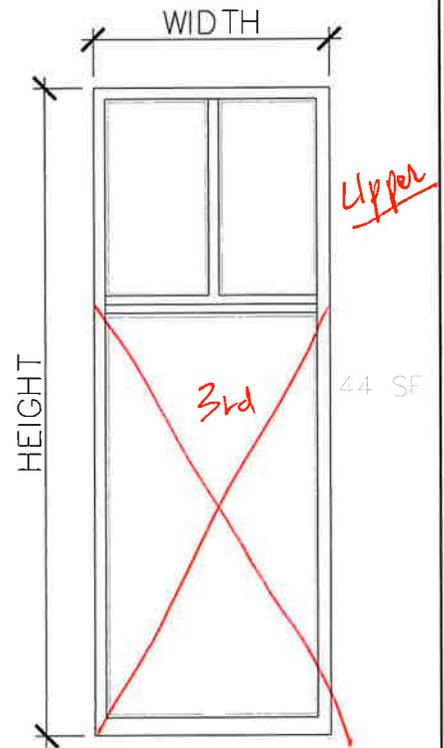

METAL WINDOWS

XREFS:


1) CLEAN/REPAINT

WINDOW					SPECIFIC CONDITION NOTES															
409		Q																		
(ABOVE 312) WINDOW NO.	EXPOSURE	TYPE	Q																	
		FRAME MATERIAL			EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
Q-409-N		METAL		S.G.	Poor	Poor	Good	Poor/FAIR	N/A		BAD	BAD	Good	Poor	BAD					
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES										TYPE Q					
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE															
					121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

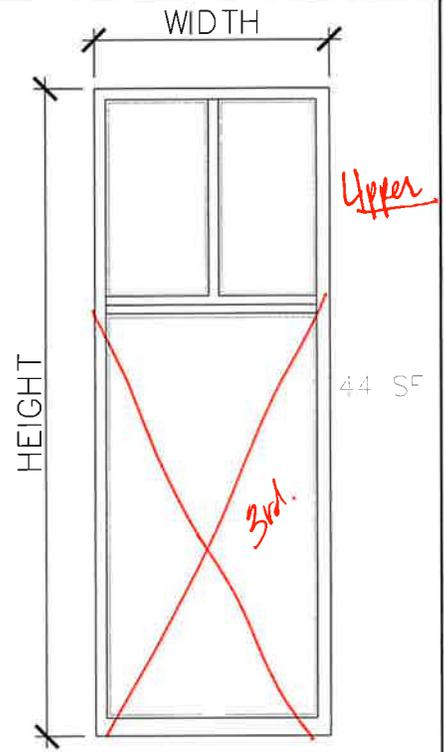

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																			
410	(ABOVE 313)	WINDOW NO.	TYPE Q	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
Q-410-N					METAL	S.G.	Poor	Poor		Good	Poor/FAIR	N/A		BAD	BAD	Good	Poor	BAD					
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE Q Sheet ___ of ___																			

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

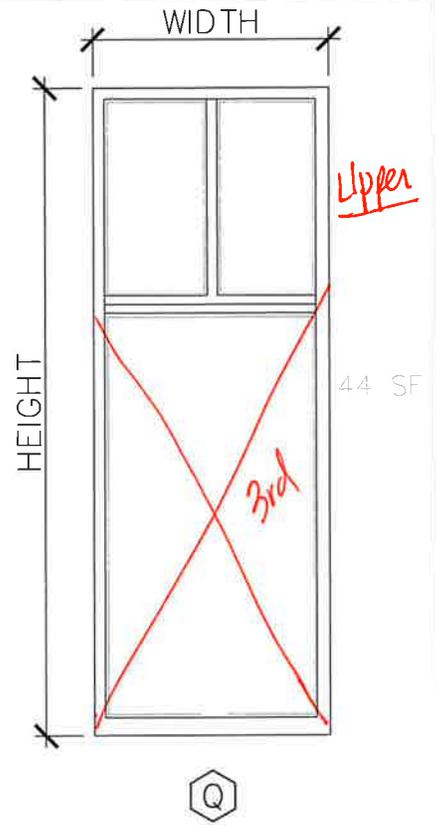

METAL WINDOWS


1) CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																				
Q-411-N	(ABOVE 314)	WINDOW NO. 411	Q	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
						METAL	S.G.	Poor	Poor		Good	Poor/FAIR	N/A		BAD	BAD	Good	Poor	BAD					
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
KOMATSU ARCHITECTURE				21 E. DALLAS STREET CANTON, TEXAS 75103																				
				TYPE Q																				
				Sheet ___ of ___																				

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

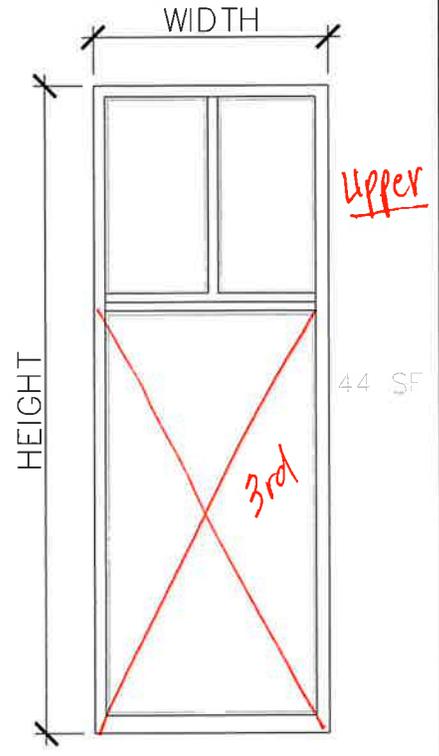

METAL WINDOWS

XREFS:


1) CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																				
Q-412-N	(ABOVE 315)	WINDOW NO. 412	Q	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
						METAL	S.G.	<i>Poor</i>	<i>Poor</i>		<i>Good</i>	<i>Poor/Fair</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Poor</i>	<i>BAD</i>					
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												TYPE Q								
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												Sheet ___ of ___								
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																				

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

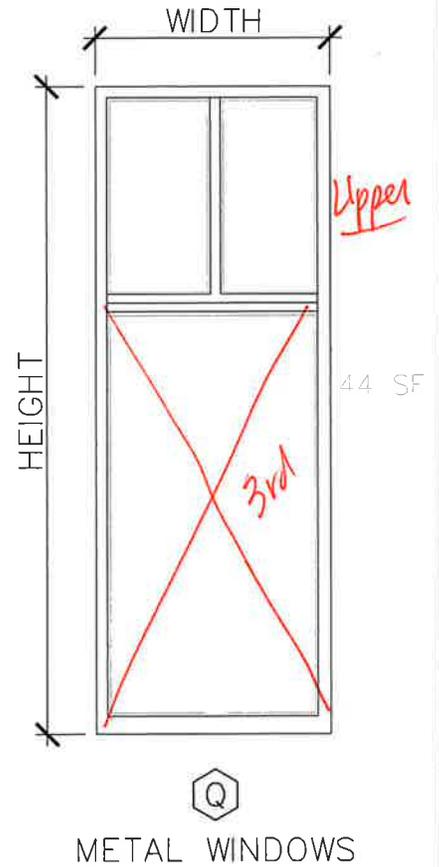

XREFS:


1) CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																				
Q-414-N	(ABOVE 317)	WINDOW NO. 414	Q	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
						METAL	S.G.	Poor	Poor		Good	Poor/Fair	N/A		BAD	BAD	Good	Poor	BAD					
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												TYPE Q								
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
				121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

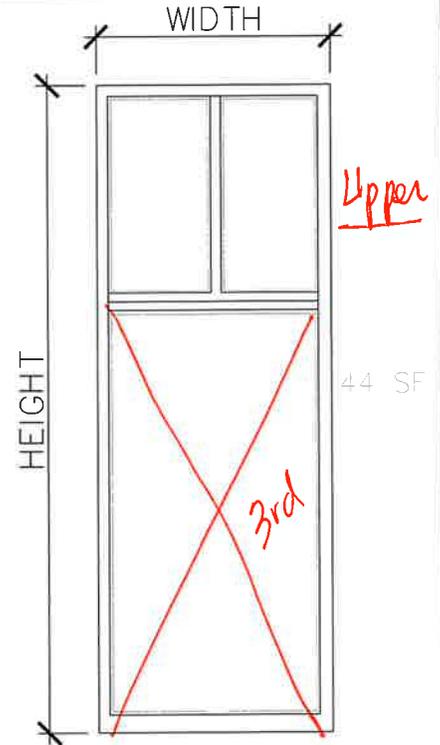

METAL WINDOWS

CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																			
415	Q	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
Q-415-N				METAL	S.G.	<i>Poor</i>	<i>Poor</i>		<i>GOOD</i>	<i>Poor/FAIR</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>GOOD</i>	<i>Poor</i>	<i>BAD</i>				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE Q									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___									

XREFS:

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

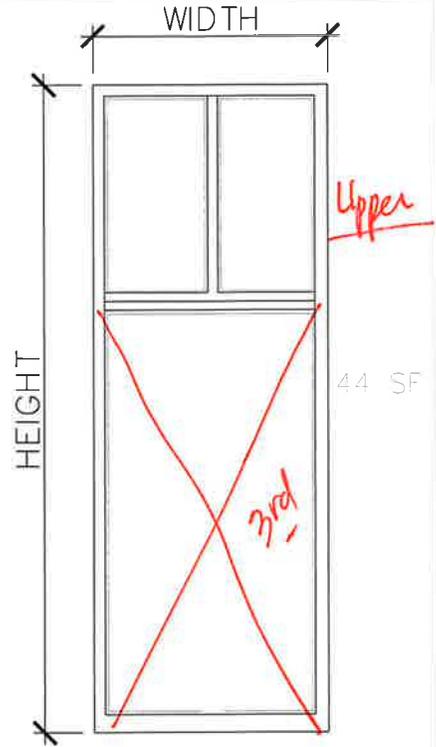

METAL WINDOWS

XREFS:


1) CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																			
416	WINDOW NO.	EXPOSURE	TYPE																				
Q-416-N			Q	METAL	S.G.	<i>Poor</i>	<i>Poor</i>	<i>Good</i>	<i>Poor/Fair</i>	<i>N/A</i>	<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Poor</i>	<i>BAD.</i>								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE Q																			
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

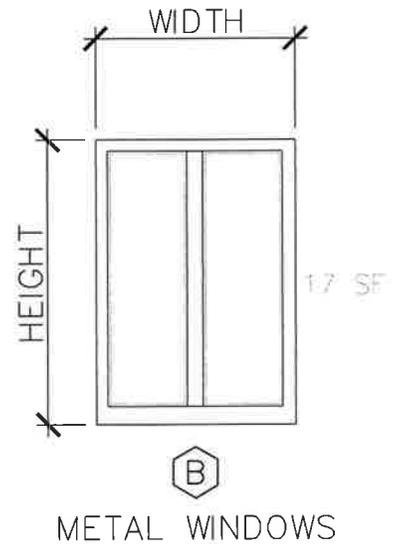

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 418	B																					
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-418-W		METAL	S.G.	FAIR	FAIR		Good	FAIR	N/A		BAD	BAD	Good	FAIR	FAIR							
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103																				
		TYPE B																				
		Sheet__of__																				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

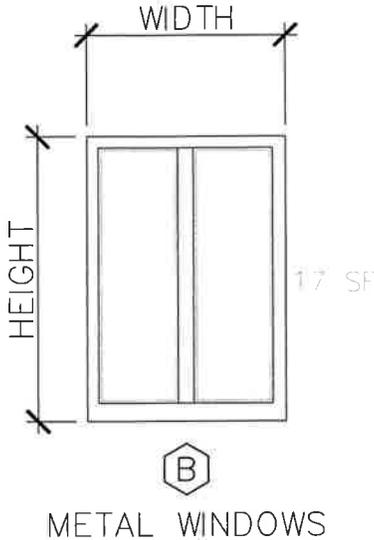

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 419																						
EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-419-S		METAL	S.G.	Poor	Poor		Good	FAIR	N/A		BAD	BAD	Good	Poor	BAD							
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE B								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet__of__								

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

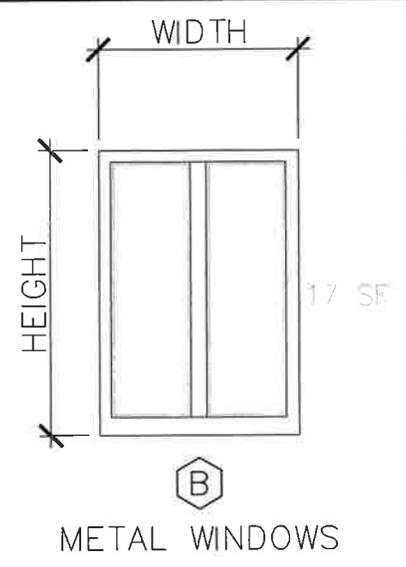


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 421	EXPOSURE	TYPE	B																				
FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
METAL	S.G.	<i>Poor</i>		<i>Poor</i>		<i>Good</i>	<i>Poor</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Poor</i>	<i>BAD</i>									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE B																			
				Sheet__of__																			

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

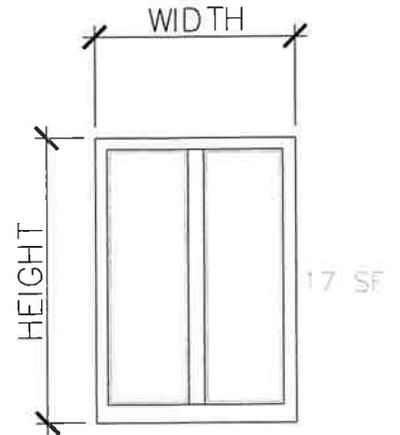

ⓑ METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 426	B																			
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-426-S		METAL	S.G.	Poor	Poor		Good	Poor	N/A		BAD	BAD	Good	Poor	BAD					
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																		
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103																		
		TYPE B																		
		Sheet__of__																		

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

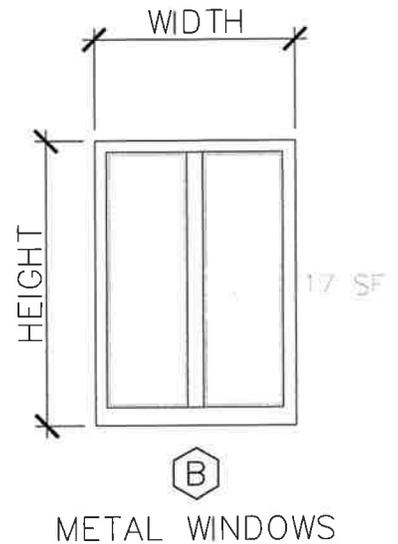

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 427	EXPOSURE	TYPE B																					
B-427-S	METAL	S.G.	Poor	Poor	Good	Poor	N/A	Bad	Bad	Good	Poor	Bad											
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE B																			
				Sheet__of__																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

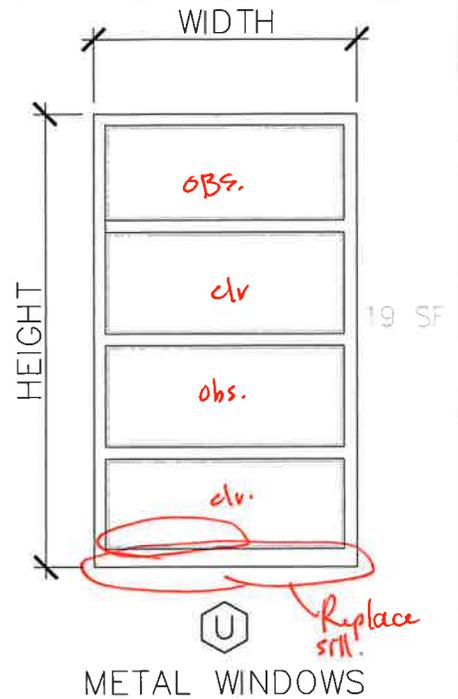

METAL WINDOWS

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																
WINDOW NO. 501	EXPOSURE	TYPE U																		
				FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
U-501-E				METAL	S.G.	Poor	Poor		Poor	Poor	N/A		Poor	Poor	Good	Poor	Poor			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE U						
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___						

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

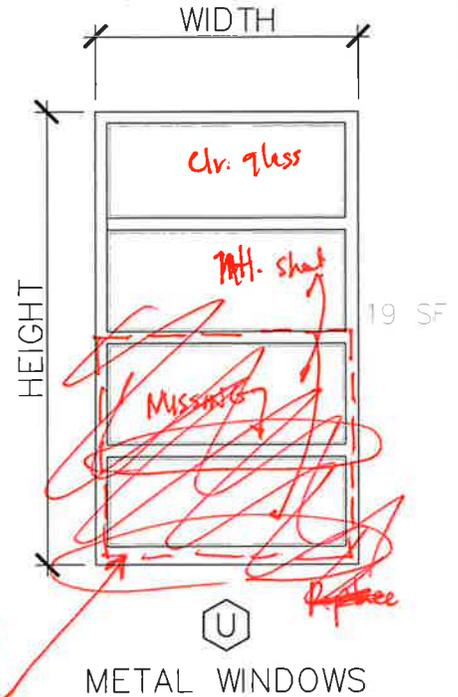

Frame w/ glass fastened to hist. frame on the interior face.

① CLEAN/REPAINT

WINDOW

SPECIFIC CONDITION NOTES

WINDOW NO. 502	EXPOSURE	TYPE U																		
			FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-502-E			METAL	S.G.	<i>Poor</i> Bad <i>Repl. lower mullion</i>	<i>Poor</i>		<i>Bad</i>	<i>Poor</i>	<i>N/A</i>		<i>Bad</i>	<i>Bad</i>	<i>Good</i>	<i>Bad</i>	<i>Bad</i>				

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE U

Sheet ___ of ___





XREFS:

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

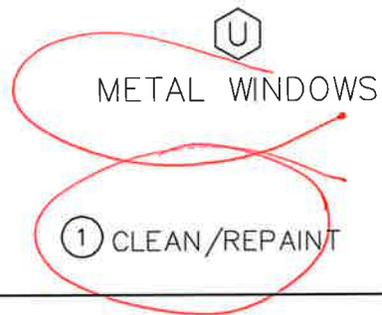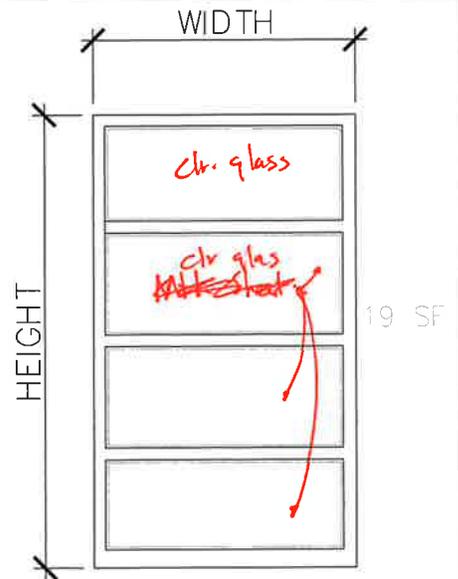


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
U-503-E	503	U																					
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
			METAL	S.G.	Poor	Poor		Rep.	Rep.	N/A		Rep.	Rep.	Stone	Rusty	Rep.							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE U																			
				Sheet__of__																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

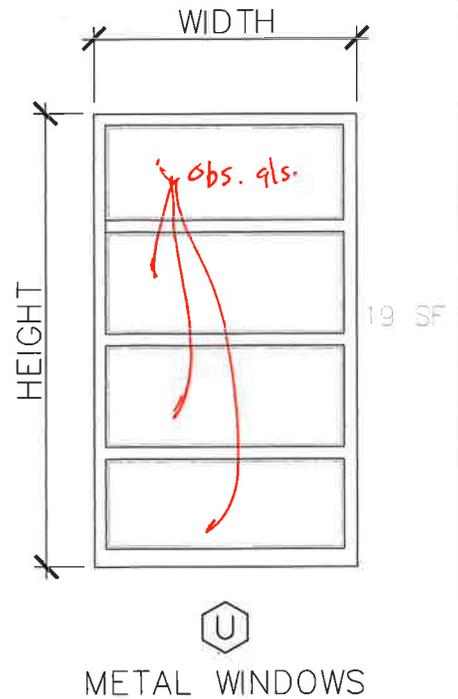

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO.	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
504																					
U-504-E																					
	METAL	S.G.	Poor	Poor		BAD	Poor			BAD	BAD	Good	Poor	BAD							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE U							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																	
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___							

XREFS:

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

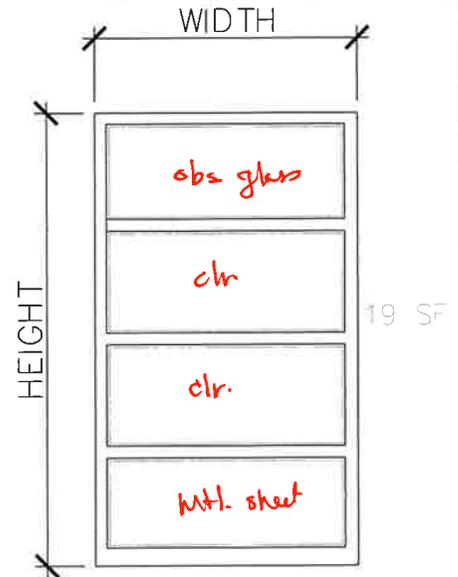

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 505			U																				
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
U-505-E		METAL	S.G.	Poor	Poor		Rpl.	Poor			Rpl.	Rpl.	stain	Poor	Rpl.								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				TYPE U																			
				Sheet__of__																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

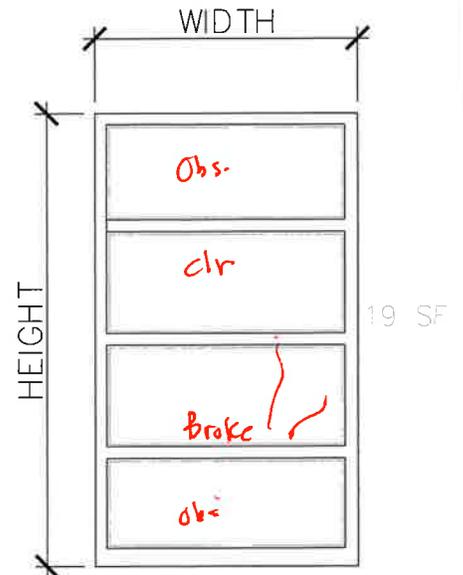

METAL WINDOWS

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 506	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-506-E		METAL		Poor		Bad	Poor	N/A		Bad	Bad	Good	Poor	Bad				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE U				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

XREFS:

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

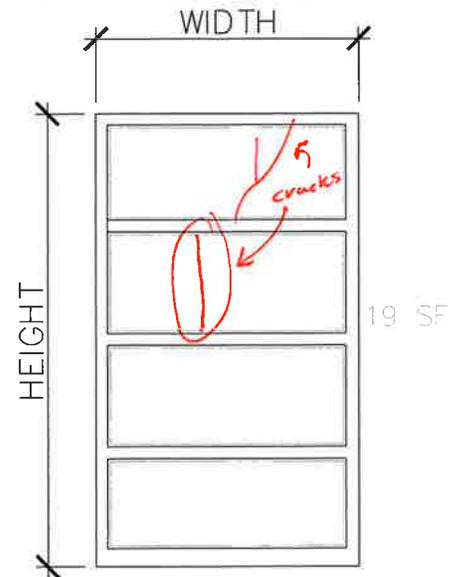

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 507	U	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-507-E			METAL	S.G.	<i>POOR</i>	<i>POOR</i>		<i>BAD</i>	<i>POOR</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>GOOD</i>	<i>FAIR</i>	<i>BAD</i>				
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES						TYPE U								
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE						Sheet ___ of ___										
		121 E. DALLAS STREET CANTON, TEXAS 75103																		

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

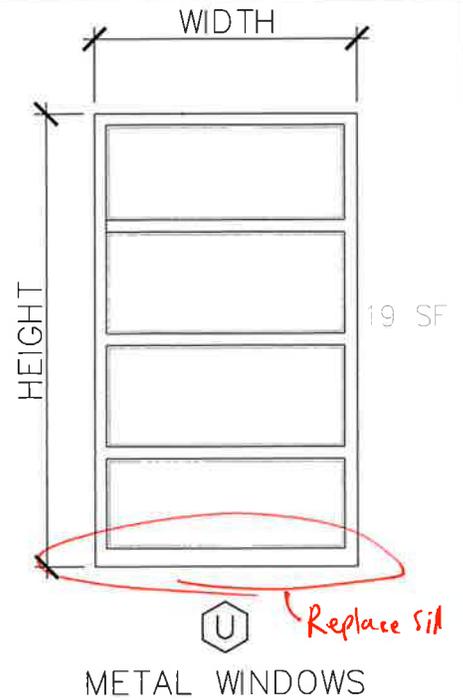

① CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 508	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-508-E				POOR		BAD	POOR	N/A		BAD	BAD	GOOD	BAD	BAD				

SCALE: 1/4" = 1'-0"

DATE:

JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE U

Sheet ___ of ___




KOMATSU
ARCHITECTURE

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

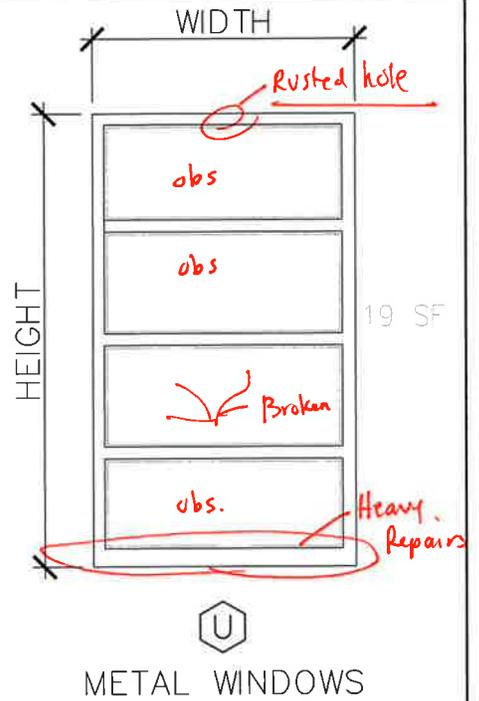

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES													
WINDOW NO. 509	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
U-509-N		METAL	S.G.	Poor	Poor	Bad Rpl	Poor	N/A	Bad Rpl.	Bad Rpl.	Good stone	Poor Extensive repairs needed	Bad		
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE U			
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE													
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___			

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

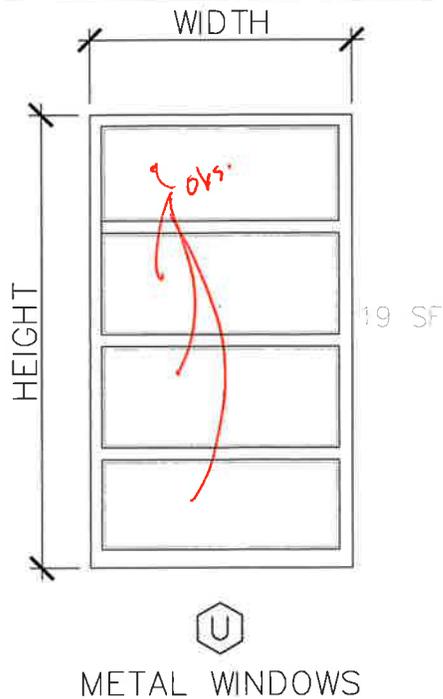

① CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 510	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-510-N				FAIR		BAD	FAIR	N/A		BAD	BAD	Good	Poor	BAD				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:				JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE				TYPE U						
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103				Sheet__of__										

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION



① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 511	EXPOSURE	TYPE U		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-511-N			METAL	S.G.	Poor													
						Repl					Repl	Repl	stone	Repl.	Repl			
						Bad	Poor	N/A			Bad	Bad	Good	Bad	Bad			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103														
				TYPE U														
				Sheet ___ of ___														

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

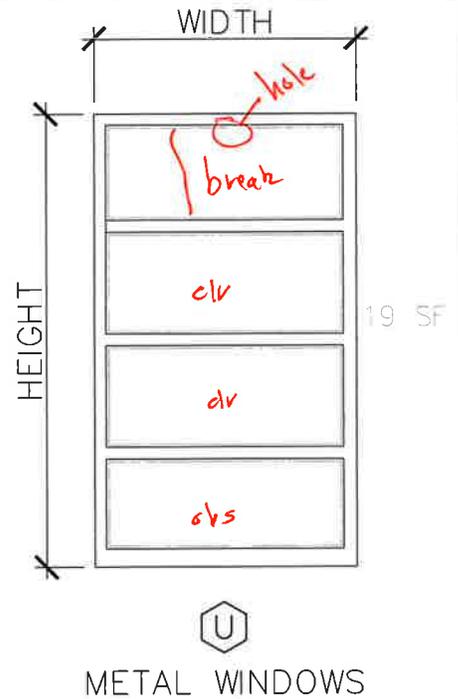

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 512	EXPOSURE	TYPE U		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-512-N			METAL	S.G.	Poor	Poor	BAD	Poor	N/A	BAD	BAD	Good	Poor	BAD				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE U				
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

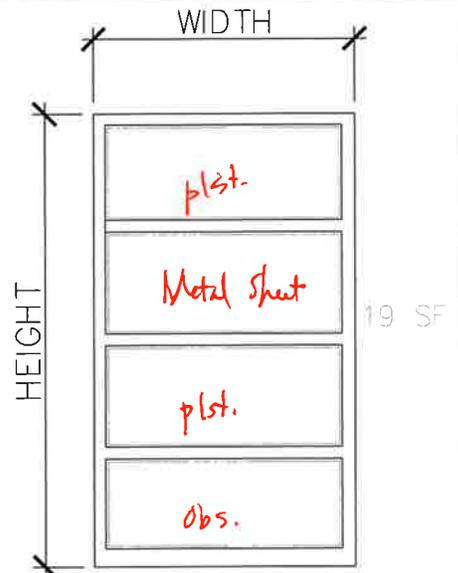

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																			
513	U	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-513-N				METAL	S.G.	<i>Poor</i>	<i>Poor</i>		<i>BAD</i>	<i>Poor</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Poor</i>	<i>BAD</i>				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE U							
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet__of__							

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

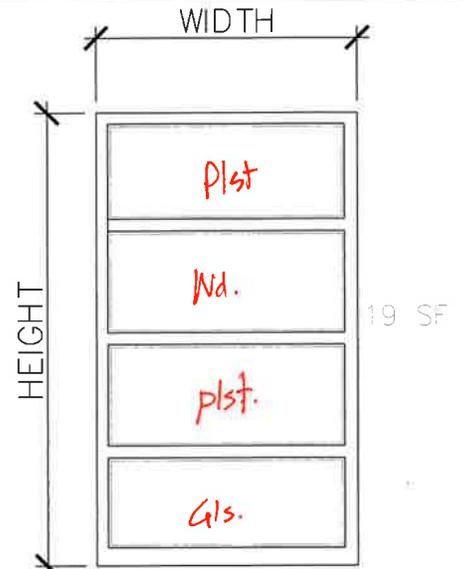

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 514	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-514-N				POOR/FAIR		BAD	POOR	N/A		BAD	BAD	GOOD	POOR	BAD				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:				JOB NO.: 2023.113														
				VAN ZANDT COUNTY COURTHOUSE														
				121 E. DALLAS STREET CANTON, TEXAS 75103														
				TYPE U														
				Sheet__of__														

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

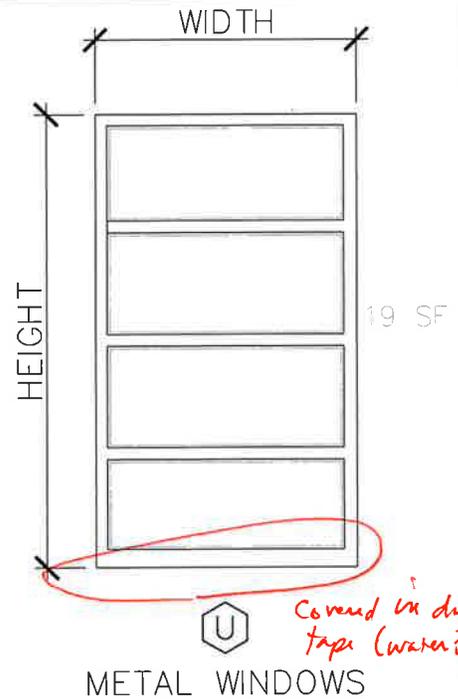

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES													
WINDOW NO. 515	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
U-515-N				FAIR Poor		BAD	Poor	N/A		BAD	BAD	Good frame	Poor → BAD	BAD			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES													
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE													
				121 E. DALLAS STREET CANTON, TEXAS 75103													
														TYPE U			
														Sheet ___ of ___			

XREFS:

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

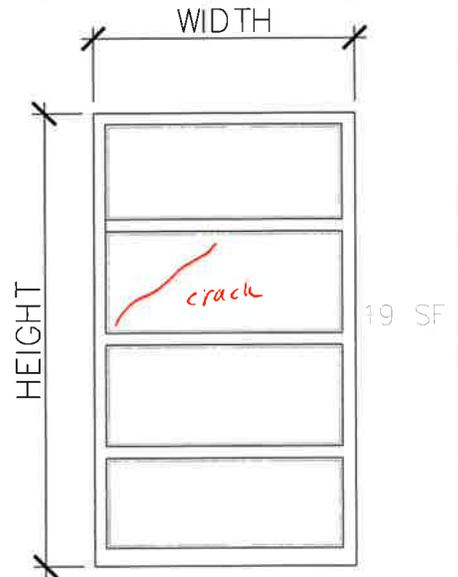

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 516	EXPOSURE	TYPE U		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-516-N			METAL	S.G.	Poor	Poor	BAO	Poor	N/A	BAO	BAO	Good	Poor	BAO				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
				121 E. DALLAS STREET CANTON, TEXAS 75103														
				<p style="text-align: right; font-size: 2em; margin: 0;">TYPE U</p> <p style="text-align: right; margin: 0;">Sheet ___ of ___</p>														

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

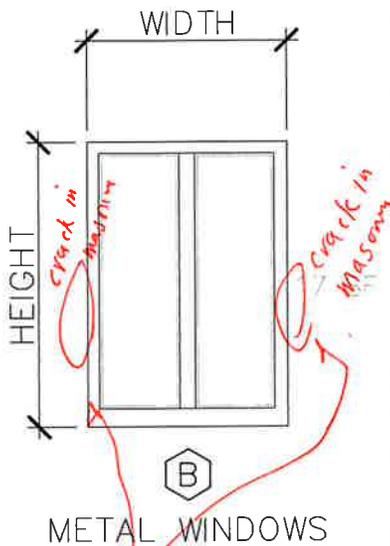

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																					
WINDOW NO. 517	EXPOSURE	TYPE	B																				
				FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-517-N				METAL	S.G.	<i>Poor</i>		<i>Poor</i>		<i>Good</i>	<i>Poor</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>FAIR</i>	<i>Poor</i>	<i>BAD</i>					

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES
VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103




TYPE B

Sheet ___ of ___

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

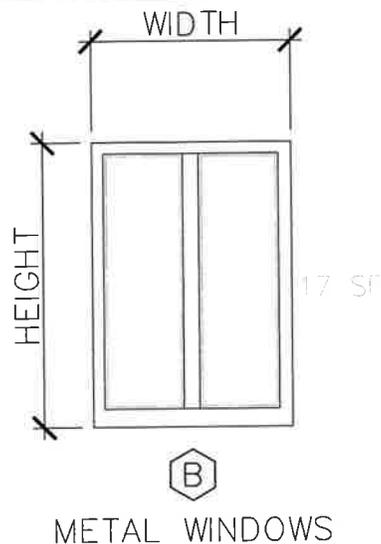


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 518	EXPOSURE	TYPE	B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
B-518-N				METAL	S.G.	POOR FAIR	FAIR		<i>Good</i>	FAIR	N/A		BAD	BAD	<i>Good</i>	FAIR	BAD						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
TYPE B																							
Sheet ___ of ___																							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

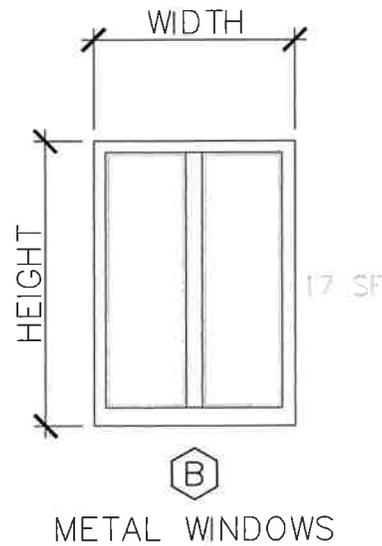


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 520	EXPOSURE	TYPE	B	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
B-520-W				Poor		Good	FAIR	N/A		BAD	BAD	Good Stone	FAIR	BAD									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
														TYPE B									
														Sheet__of__									

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

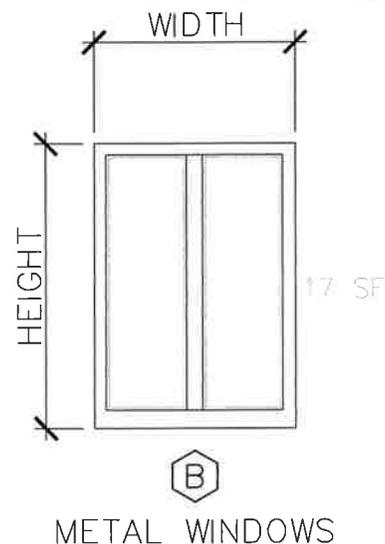


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 521	EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-521-W			METAL	S.G.	FAIR	Poor		Good	FAIR	N/A		BAD	BAD	Good	FAIR	BAD							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES						TYPE B											
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103						Sheet__of__															

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

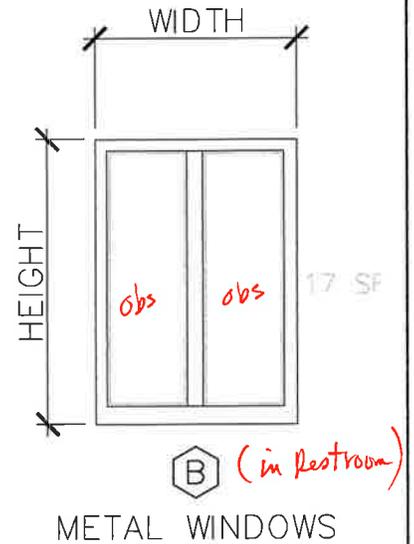

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 522	B																					
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-522-W		METAL	S.G.	FAIR	FAIR		FAIR Obscured for R/R use	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD							
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103																				
		TYPE B																				
		Sheet ___ of ___																				

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

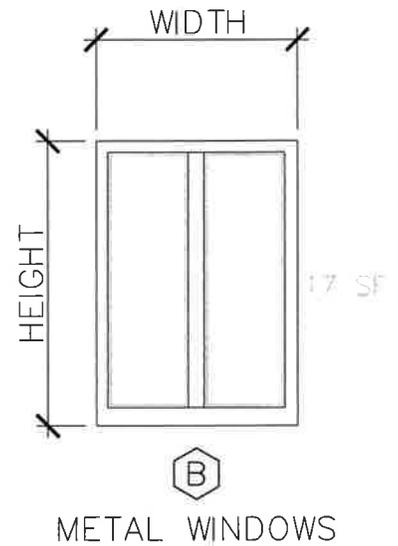

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO. 523	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
B-523-W		B	METAL	S.G.	FAIR	FAIR		GOOD	FAIR	N/A		BAD	BAD	GOOD	FAIR	BAD				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES															
DATE:					JOB NO.: 2023.113															
					VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103										TYPE B Sheet__of__					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

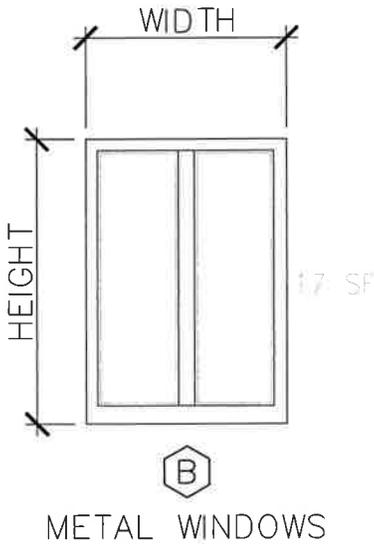

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 524	EXPOSURE	TYPE B		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
B-524-W		METAL	S.G.	Poor		Good	Poor	N/A		Replace	Replace	Stone		Replace				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE B				
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet__of__				

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

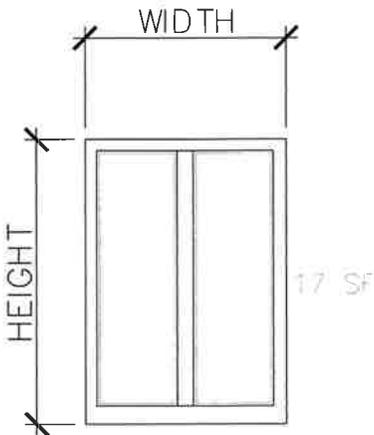

B

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 525	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
B-525-W		B	METAL	✓ S.G.	Poor	Poor	Rusty	Good	Poor	N/A		Rep.	Rep.	Stone	Rust.	Rep.						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE B								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

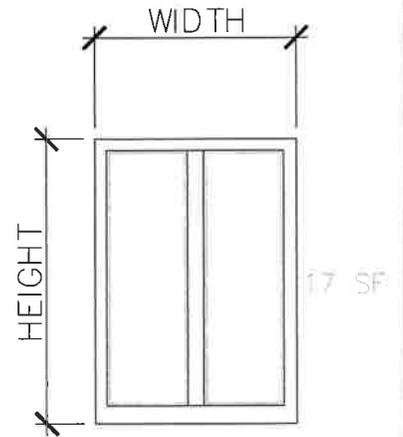

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
WINDOW NO. 526	TYPE B	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-526-W			METAL	S.G.	Poor	Poor		Good	FAIR	N/A		Replace	Replace	Good	Poor	BAD					

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103


TYPE B

Sheet ___ of ___

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

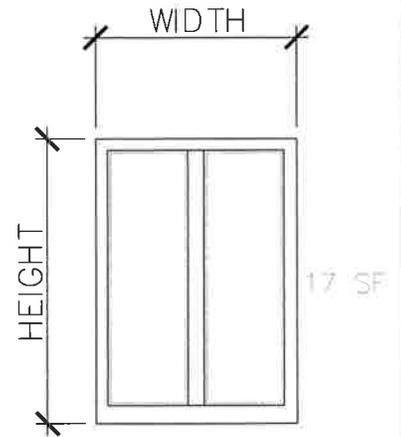

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO. 527	EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-527-S			METAL	S.G.	Poor	Poor	Rusty	Good	Poor	N/A		Replace	Replace	(Stone)	Poor	Replace							
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES																		
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																		
					121 E. DALLAS STREET CANTON, TEXAS 75103																		
TYPE B																							
Sheet ___ of ___																							

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

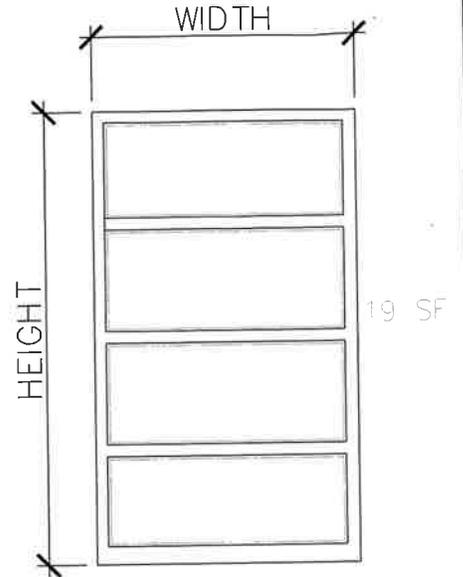

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO. 528	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
U-528-S		METAL		Poor		FAIR	POOR	N/A		BAD	BAD	GOOD	Poor	BAD							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																	
DATE:				JOB NO.: 2023.113																	
				VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103																	
				TYPE U Sheet ___ of ___																	

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

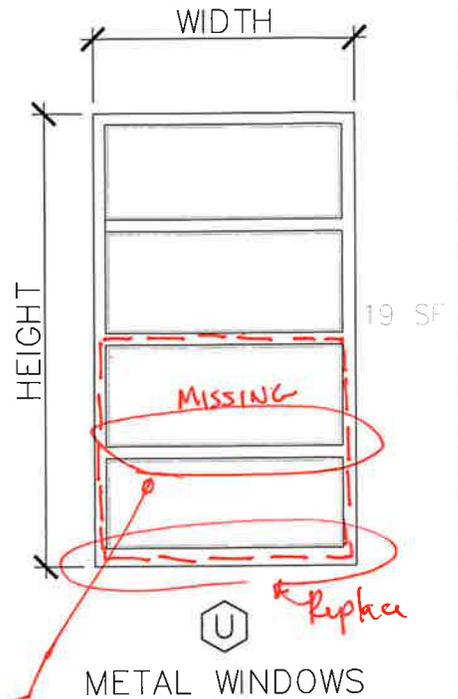

Frame w/ glass fastened to historic frame on the interior face.

① CLEAN/REPAINT

WINDOW

SPECIFIC CONDITION NOTES

529		U																	
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
U-529-S			METAL	S.G.	<i>Poor Rust Replace lower mullion</i>														

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE U

Sheet ___ of ___




XREFS:

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

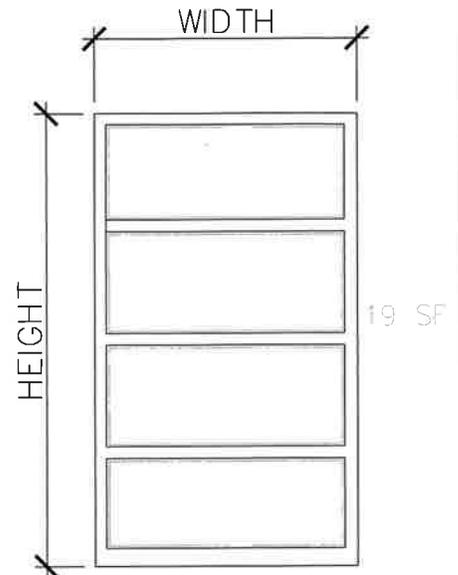

METAL WINDOWS

① CLEAN/REPAINT

WINDOW

SPECIFIC CONDITION NOTES

WINDOW NO. 530	EXPOSURE	TYPE U																	
	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
U-530-S	METAL	S.G.	<i>Poor</i>	<i>Poor</i>		<i>Poor</i>	<i>Poor</i>	<i>N/A</i>		<i>BAD</i>	<i>BAD</i>	<i>Good</i>	<i>Poor</i>	<i>BAD</i>					

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE U

Sheet ___ of ___




XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

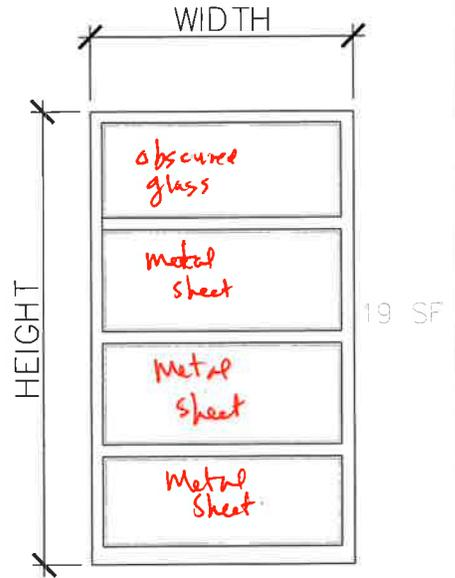

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES													
531	WINDOW NO. 530 532	EXPOSURE	TYPE U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
				Poor		Rpl.	Poor	N/A		Ppl.	Rpl.	Stone	Poor	Ppl.			
		METAL				BAD	Poor			BAD	BAD	Good	Poor	BAD			
		S.G.															
		OVERALL CONDITION															
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES													
DATE:				JOB NO.: 2023.113													
				VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103													
				TYPE U													
				Sheet ___ of ___													

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

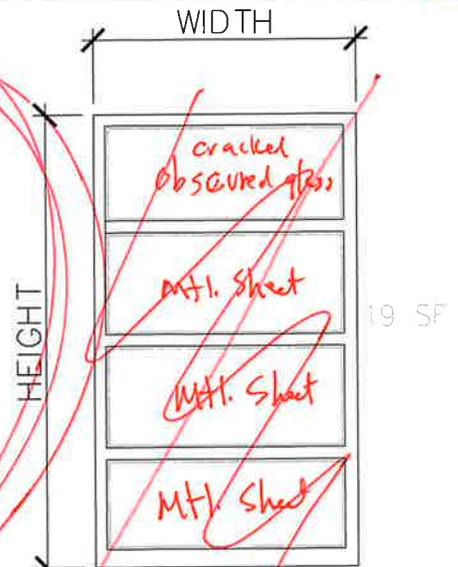

 METAL WINDOWS

① CLEAN/REPAINT

WINDOW

SPECIFIC CONDITION NOTES

WINDOW NO. 531	EXPOSURE	TYPE U	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT
U-5312			METAL	S.G.	poor	poor		Bad	poor	N/A		Bad	Bad	Good	poor	Bad

SCALE: 1/4" = 1'-0"

WINDOW SURVEY/WINDOW TYPES

DATE:

JOB NO.: 2023.113

VAN ZANDT COUNTY COURTHOUSE

TYPE U



KOMATSU
ARCHITECTURE


121 E. DALLAS STREET
CANTON, TEXAS 75103

Sheet ___ of ___

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

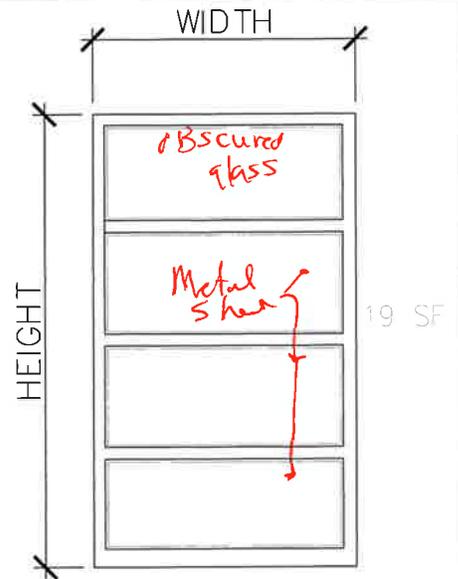

 METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																				
WINDOW NO.	EXPOSURE	TYPE	U	533																				
					</																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

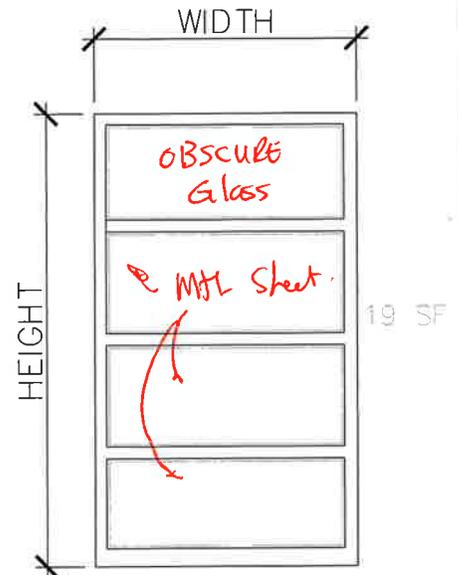

METAL WINDOWS

① CLEAN/REPAINT

WINDOW

SPECIFIC CONDITION NOTES

534		U																	
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
U-534-S			METAL	S.G.	Poor	Poor		Repl.	Poor	N/A		Repl.	Repl.	Stone	Poor	Repl.			

SCALE: 1/4" = 1'-0"

WINDOW SURVEY/WINDOW TYPES

DATE:

JOB NO.: 2023.113

VAN ZANDT COUNTY COURTHOUSE

TYPE U



KOMATSU ARCHITECTURE


121 E. DALLAS STREET
CANTON, TEXAS 75103

Sheet ___ of ___

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

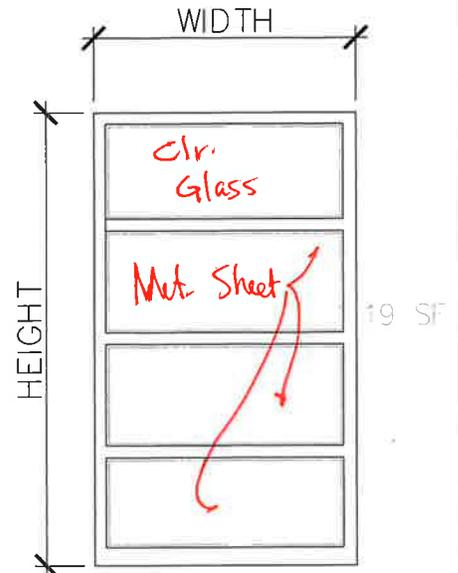

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO.	EXPOSURE	TYPE		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
535		U																
U-535-S			METAL	S.G.	Poor	Poor	BAD	Poor	N/A	BAD	BAD	Good	Poor	BAD				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										TYPE U				
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

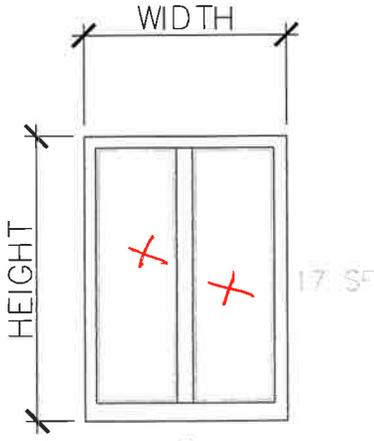

(B)

METAL WINDOWS

(1) CLEAN/REPAINT

XREFS:


WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 601																						
EAST	EXPOSURE																					
B	TYPE																					
B-601-E	FRAME MATERIAL																					
	GLAZING MATERIAL																					
	OVERALL CONDITION																					
	EXTERIOR FINISH																					
	INTERIOR FINISH																					
	GLASS																					
	FRAME																					
	SASHES																					
	HARDWARE																					
	GLAZING MATERIAL																					
	WEATHERSTRIPPING																					
	SUPPORT MATERIAL																					
	SILL																					
	PERIMETER SEALANT																					

SCALE: 1/4" = 1'-0"	WINDOW SURVEY/WINDOW TYPES	TYPE B
DATE:	VAN ZANDT COUNTY COURTHOUSE	
JOB NO.: 2023.113	121 E. DALLAS STREET CANTON, TEXAS 75103	Sheet ___ of ___
KOMATSU ARCHITECTURE		

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

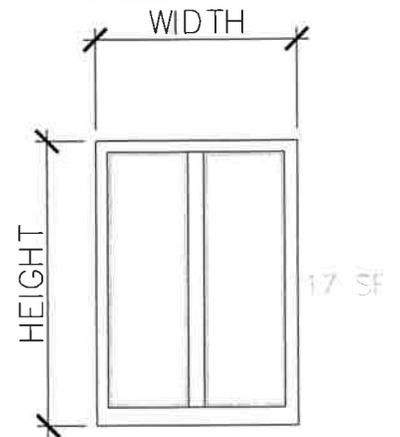

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 602	B	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-602-W		<i>West</i>		METAL	S.G.	<i>Poor</i>	<i>Poor</i>		<i>Good</i>	<i>Poor</i>	<i>N/A</i>		<i>Bad</i>	<i>Bad</i>	<i>Good</i>	<i>Poor</i>	<i>Bad</i>					
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE B								
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												Sheet ___ of ___						
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103																				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

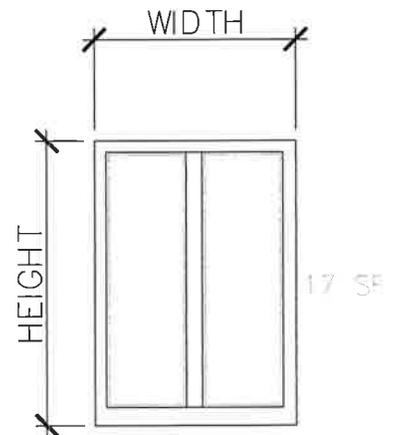

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 603	B	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-603-S		<i>South</i>		METAL	S.G.	<i>Poor</i>	<i>Poor</i>		<i>Good</i>	<i>FAIR</i>	<i>N/A</i>		<i>Replace</i>	<i>Replace</i>	<i>Good</i>	<i>Poor</i>	<i>Severe rusting</i>	<i>Poor</i>				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE B										
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___										