

MICHAEL D. BARRAM ARCHITECTS, INC.
 ARCHITECTS
 1211 W. WILSON ST.
 SUITE 100
 CANTON, TEXAS 75103
 TEL: 940.386.1400
 FAX: 940.386.1401
 WWW.MDBARRAM.COM



JEFFREY LEE BASEHORE
 ARCHITECT
 200 W. 20TH AVE. #100
 CANTON, TEXAS 75103
 TEL: 940.386.1400
 FAX: 940.386.1401
 WWW.JLBASEHORE.COM

VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 CANTON, TX 75103

DATE	06/04/2020
PROJECT NO.	1608818045
SHEET NO.	A2.001
1ST FLOOR EXISTING & DEMOLITION	

MARBLE NOTE:

ALL MARBLE REMOVED AND RE-INSTALLED FOR REUSE TO MATCH EXISTING

WALL LEGEND


- EXISTING WALLS TO REMAIN
- - - EXISTING WALLS TO BE REMOVED (EXCEPT WHERE NOTED)
- NEW WALL SEAL TO DECK
- EXISTING COLUMNS TO REMAIN (TYPICAL)

KEYNOTE LEGEND:

- # ROOM NUMBER
- # DOOR NUMBER
- # WINDOW NUMBER
- # GENERAL NOTE NUMBER
- # CASELINE NUMBER
- # SECTION MARKER
- ▲ ELEVATION MARKER

1 FIRST FLOOR PLAN - EXISTING/DEMOLITION
 1/4" = 1'-0"
 1,791 SF

VAN ZANDT

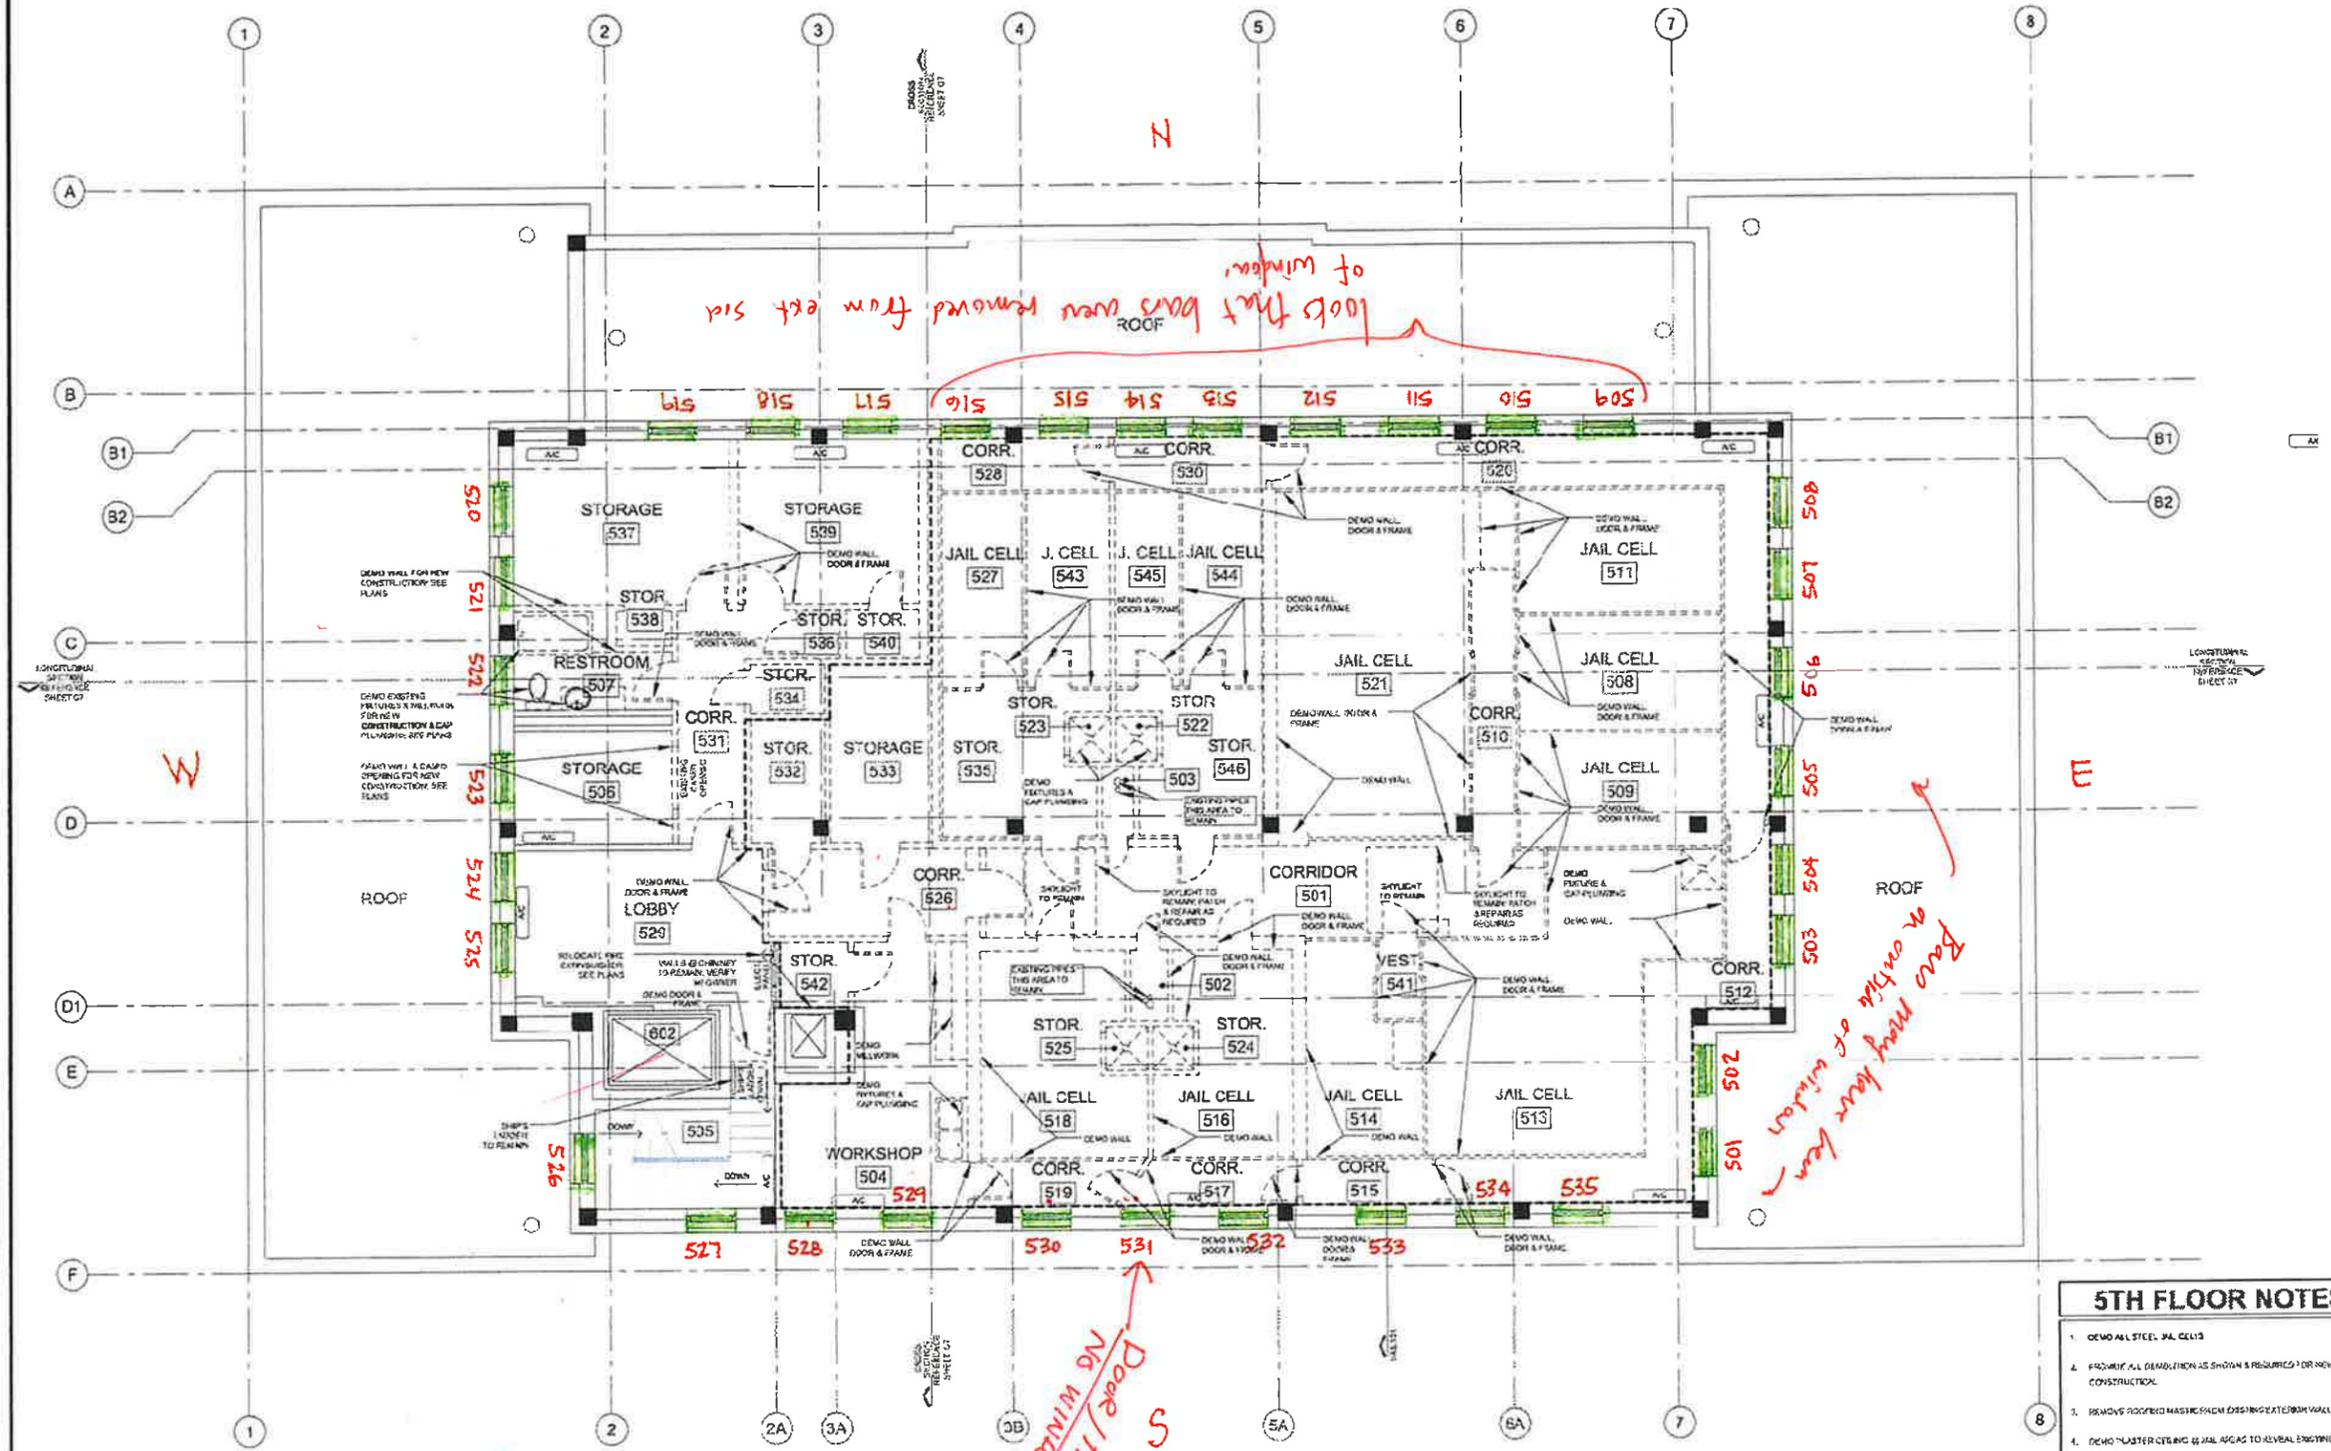

- 5TH FLOOR NOTES:**
1. DEMO ALL STEEL JAIL CELLS
 2. PROVIDE ALL DEMOLITION AS SHOWN & REQUIRED FOR NEW CONSTRUCTION
 3. REMOVES APPROVED MASTERSPEC EXISTING PLASTER WALLS
 4. DEMO MASTER CEILING & JAIL CELLS TO EXPOSE EXISTING CONCRETE STRUCTURE
 5. DEMO ALL BASED CONCRETE & ASBESTOS FLOORING (SHOWN WITH SHARED AREA)

MARBLE NOTE:
 ANY MARBLE REMOVED WILL BE RETAINED FOR REUSE TO PATCH EXISTING.

WALL LEGEND

- EXISTING WALLS TO REMAIN
- EXISTING WALLS TO BE REMOVED - EXCEPT WHERE NOTED
- NEW WALLS TO BE CONSTRUCTION
- EXISTING COLUMNS TO REMAIN TYPICAL

NOTE: ALL SYMBOLS MAY NOT BE REQUIRED ON THESE DRAWINGS

KEYNOTE LEGEND:

- # ROOM NUMBER
- # DOOR NUMBER
- # WINDOW NUMBER
- # GENERAL NOTE NUMBER
- # PROFILE NUMBER
- SECTION MARKER
- LEVEL MARKER

NOTE: ALL SYMBOLS MAY NOT BE REQUIRED ON THESE DRAWINGS

1 FIFTH FLOOR PLAN - EXISTING/DEMOLITION
 1/4" = 1'-0"
 4243 SF

MICHAEL D. BARNHAM ARCHITECTS, INC.
 ARCHITECTS
 801 UTZER AVENUE
 FLORENCE, TEXAS 75744
 (817) 231-1110

JEFFREY LEE BASEHORE ARCHITECT
 801 UTZER AVENUE
 FLORENCE, TEXAS 75744
 (817) 231-1110


VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 GANTON, TX 75103

DATE: 06/04/2020

PROJECT NO: 18000118048

SHEET NO: A2.005


5TH FLOOR PLAN - EXISTING & DEMOLITION

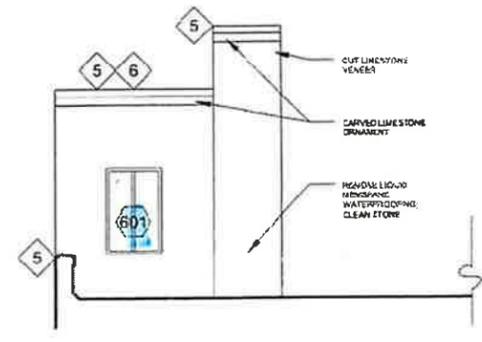

3 ELEVATION - EAST
1/4" = 1'-0"



2 ELEVATION - EAST
1/4" = 1'-0"

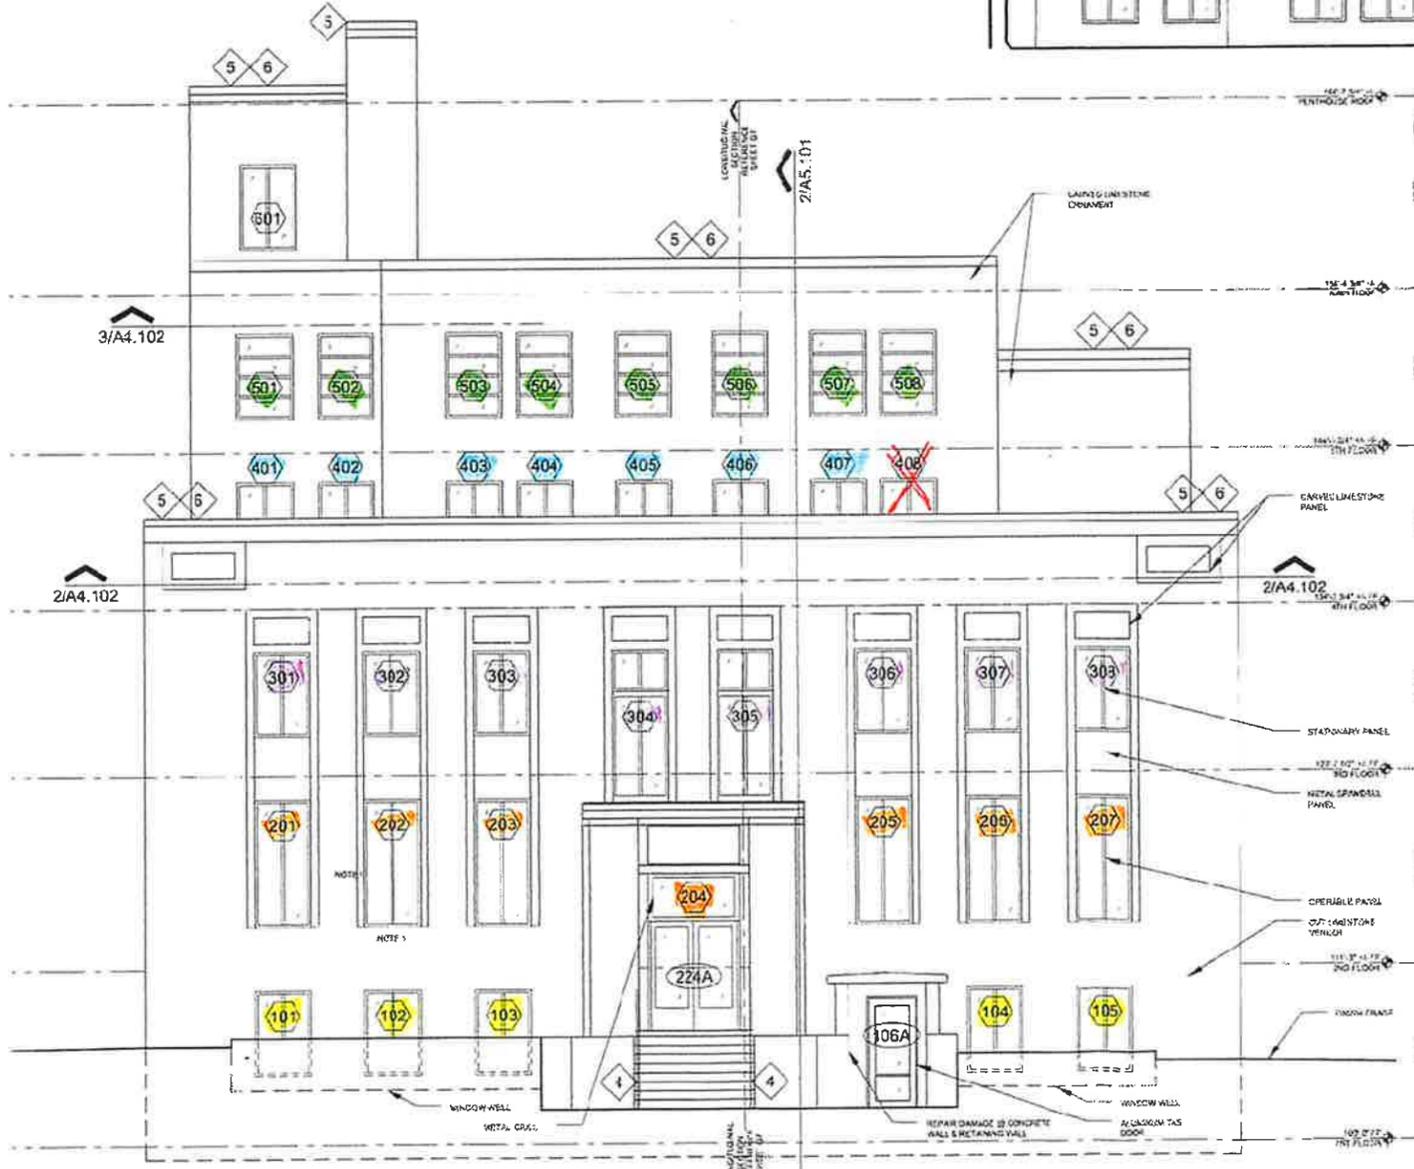

1 ELEVATION - EAST
1/4" = 1'-0"

PHYSICAL PROPERTIES: LIMESTONE AS DEFINED BY ASTM C-110
 STN 1
 LUCAS BUFF ASH L-32
 1. REGION 1 UNAS. NECESSARY LIMESTONE QUANTITY
 2. LIMITATIONS CONFORMING TO ASTM C-110 WITH THE FOLLOWING PROPERTIES:
 A. COMPRESSIVE STRENGTH: 3.0 COMPRESSIVE STRENGTH ASTM C-110
 B. PERMEABILITY: "DRIFT AVERAGE OF 5 CUBES 6" X 6" X 6"
 C. PARALLEL TO FIBER: AVERAGE OF 3 CUBES 6" X 6" X 6"
 3. ABSORPTION AND SPECIFIC GRAVITY OF DIMENSION STONE ASTM C-110
 A. ABSORPTION 0.30
 B. SPECIFIC GRAVITY 2.310
 C. UNIT WEIGHT 144.2
 4. FINISH
 A. BLUET MACHINE CUT WITH SMOOTH FINISH
 5. STANDING DIMENSIONS
 A. COURSE HEIGHT: SAWYER 1 FOOT 4 INCH COURSE HEIGHTS (VERIFY)
 B. COURSE LENGTH: TYPICAL PANELS 1 FOOT 1 INCH
 C. BED DEPTH: 6 INCHES
 D. COURSE RANGE: NATURAL LAYERS BUFF LAYERS MATCH AS2LCS2

LEGEND

[Symbol]	REMOVE & REPLACE ALL LIMESTONE VENEER THAT HAS BEEN PHYSICALLY DAMAGED WITH A DISCHARGE PATCH, ETC. NEW ANCHORS SHALL BE STAINLESS STEEL.
[Symbol]	REMOVE & REPLACE ALL DAMAGED LIMESTONE VENEER. NEW ANCHORS SHALL BE STAINLESS STEEL. REMOVE LIQUID MEMBRANE WATERPROOFING, CLEAN & REPAIR ALL MORTAR JOINTS.
[Symbol]	GENERAL NOTE TAG

GENERAL NOTES: "ALL WORK NOTED IS TO MATCH EXISTING HISTORIC MATERIALS"

- REMOVE ALL MORTAR JOINTS AT EXISTING LIMESTONE VENEER. USE SPEC. SECTION 04 214
- REPAIR/REPLACE WINDOW SILL AREA AS DESCRIBED BY ARCHITECT HANDBOOK A CHANSEL (R)
- REPAIR STONEWORK, SEE SPEC. SECTION 05 402
- EXISTING MORTAR 6 TO 8" DEEP
- INSTALL NEW LIMESTONE PARAPET CAPSTONES
- INSTALL 1" SHAPED STAINLESS STEEL CORNICES JOIN BRACKETS. CORNICES UNITS HAVE A CLIP AT EACH CORNER FOR ATTACHMENT AT CORNER MOUNT
- FOR COMPOSITION OF EXTERIOR WALLS TO REMAIN, SEE ORIGINAL DRAWINGS DATED JANUARY 7, 2016 INCLUDED IN THE CONTRACT DOCUMENTS AND AS SHEETS

MICHAEL D. BARRAN ARCHITECTS, INC.
 1811 VZCRR 4859
 EDOM, TEXAS 75764
 TEL: 817/521-1660
 FAX: 817/521-1660
 06/04/2020

JEFFREY LEE BASEHORE ARCHITECT
 121 E. DALLAS ST.
 CANTON, TX 75103

VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 CANTON, TX 75103


COMPONENT 200
 MICHAEL D. BARRAN ARCHITECTS, INC.

DATE: 06/04/2020

NO.	REVISIONS	DATE

PROJECT NO: 1800878048
 SHEET NO: A4.102
 EXTERIOR ELEVATIONS

PHYSICAL PROPERTIES LIMESTONE AS DEFINED BY ASTM D-119
 SPEC: 1
LEWORS BUFF ASSOCIATES
 1. REGION TEXAS, MEMBER LIMESTONE COUNCIL
 2. LIMESTONE SPECIFICATIONS TO ASTM D-119 WITH THE FOLLOWING PROPERTIES:
 A. COMPRESSIVE STRENGTH TO DIMENSIONS ASTM C 119-96
 B. PENETRATION TO AVERAGE OF 5 CUBIC INCHES
 C. UNABLE TO BEFT AVERAGE OF 40000.274 PSI
 3. ABSORPTION AND SPECIFIC GRAVITY OF DIMENSION STONE ASTM C 94
 A. ABSORPTION 0.94
 B. SPECIFIC GRAVITY 2.318
 C. UNIT WEIGHT 144.5
 4. FACE
 A. BUFF MACHINE CUT WITH SMOOTH FINISH
 5. STANDARD DIMENSIONS
 A. COURSE HEIGHT: 8 1/2" MIN. 1' FOOT 4" MAX. COURSE HEIGHTS: (VARY)
 B. COURSE WIDTH: 16" MIN. 18" MAX. (VARY)
 C. JOINT DEPTH: 1/8" MIN. 1/4" MAX.
 D. COLOR RANGE: NATURAL LEWORS BUFF LEDGEMATCH ASSOCIATES

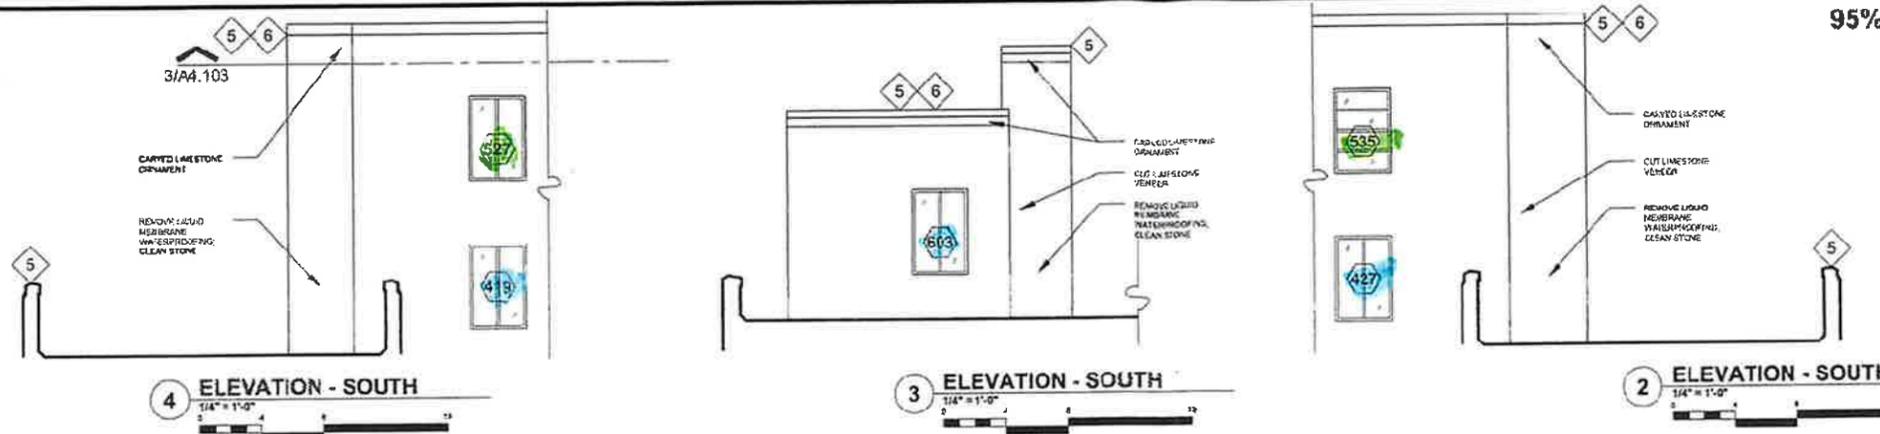

4 ELEVATION - SOUTH
 1/4" = 1'-0"

3 ELEVATION - SOUTH
 1/4" = 1'-0"

2 ELEVATION - SOUTH
 1/4" = 1'-0"



1 ELEVATION - SOUTH
 1/4" = 1'-0"

LEGEND

[Symbol]	REMOVE & REPLACE ALL LIMESTONE VENEER THAT HAS BEEN PREVIOUSLY REPAIRED WITH A BUTCH MARK PATCH. ETC. NEW ANCHORS SHALL BE STAINLESS STEEL
[Symbol]	REMOVE & REPLACE ALL DAMAGED LIMESTONE VENEER. NEW ANCHORS SHALL BE 3/16" X 8" SS STEEL
[Symbol]	REMOVE LIQUID MEMBRANE WATERPROOFING. CLEAN & REPAIR ALL MORTAR JOINTS
[Symbol]	GENERAL NOTE TAG

GENERAL NOTES:

1. REMOVE ALL MORTAR JOINTS AT EXTERIOR LIMESTONE VENEER. SEE SPEC SECTION 04 110
2. ALL EXTERIOR MORTAR JOINTS TO BE REPAIRED BY CONTRACTOR WITH 1/2" X 1/2" X 1/2" SAND
3. REPAIR STONEWORK WITH SPEC. SECTION 04 110
4. REPLACE WINDOW SIZES WITH 0004.103 AS SCHEDULED
5. INSTALL NEW LIMESTONE PARAPET CAPSTONES
6. INSTALL 1" SHAPED STAINLESS STEEL EXTERIOR LIGHT BRACKETS. DIMENSIONS JOINTS HAVE A CLIP AT EACH CORNER FOR ATTACHMENT AT TOP OF PARAPET
7. FOR COMPOSITE OF EXTERIOR WALLS REFER TO MARK SET. ORIGINAL DRAWINGS DATED JANUARY 2, 1994 INCLUDED IN THE CONTRACT DOCUMENTS AND ALL SHEETS

MICHAEL D. BARHAM ARCHITECTS, INC.
 901 VCCR 409
 5000 TEXAS 75714
 CANON, TX 75103
 TEL: 972.381.1850
 FAX: 972.381.1850



JEFFREY LEE BASEHORE ARCHITECT
 901 VCCR 409
 5000 TEXAS 75714
 CANON, TX 75103
 TEL: 972.381.1850
 FAX: 972.381.1850

VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS ST.
 CANTON, TX 75103

COPYRIGHT 2020
 MICHAEL D. BARHAM ARCHITECTS, INC.

DATE: 06/04/2020


NO.	DATE

PROJECT NO: 1800918046
 SHEET NO: A4.103
 ELEVATION

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

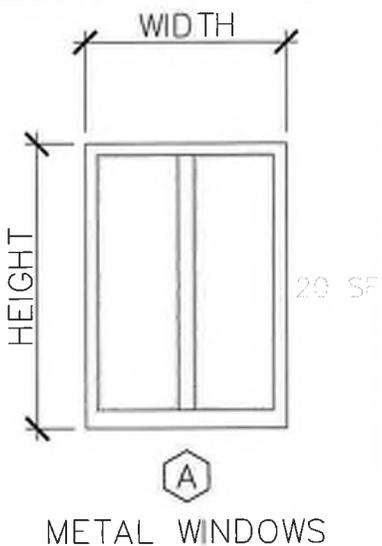

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																		
WINDOW NO. 101	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
A-101-E	<i>Fast</i>	METAL	S.G.	<i>FAIR</i>	<i>FAIR</i>	<i>Good</i>	<i>FAIR</i>	<i>FAIR</i>	<i>Poor</i>	<i>Bad</i>	<i>FAIR</i>	<i>Bad</i>	<i>FAIR</i>	<i>Bad</i>								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																		
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																		
				121 E. DALLAS STREET CANTON, TEXAS 75103																		
				TYPE A Sheet ___ of ___																		

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

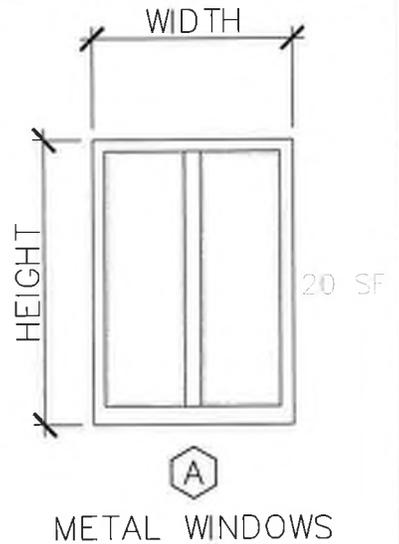

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																					
WINDOW NO. 102	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
A-102-E	<i>East</i>		METAL	S.G.	<i>FAIR</i>	<i>—</i>	<i>FAIR</i>	<i>Good</i>	<i>Good</i>	<i>—</i>	<i>Poor</i>	<i>—</i>	<i>Bad</i>	<i>Good</i>	<i>FAIR</i>	<i>Bad</i>									
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																			
DATE:			JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																			
						121 E. DALLAS STREET CANTON, TEXAS 75103																			
																TYPE A									
																Sheet ___ of ___									

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

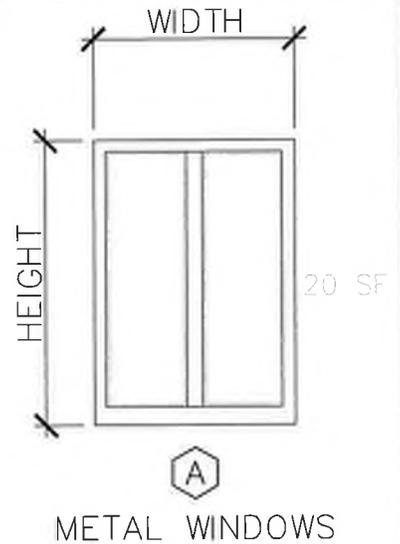

Air condition just below window - adding moisture to the area.

WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO. 103	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
A-103-E	<i>East</i>	A	METAL	S.G.	POOR	—	POOR	GOOD	FAIR	—	FAIR	—	Bad	FAIR	FAIR	Bad							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
KOMATSU ARCHITECTURE						121 E. DALLAS STREET CANTON, TEXAS 75103																	
TYPE A																							
Sheet__of__																							

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION



METAL WINDOWS

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 104			A																				
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds							
A-104-E	East	METAL	S.G.		—	Poor	Bad	Fair	—	Fair	—	Bad	Fair	Fair	Bad	Good							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE A																			
				Sheet__of__																			

XREFS:

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

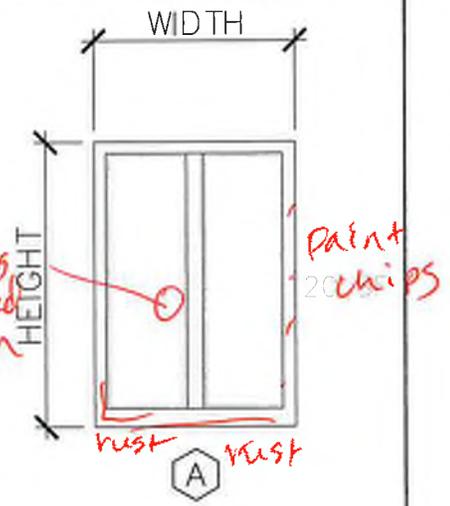

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 105	EXPOSURE	TYPE A																					
A-105-E	METAL	S.G.	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds								
				—	Poor	Good	Fair	—	Fair	—	Bad	Fair	Fair	Bad	Good								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
 KOMATSU ARCHITECTURE				TYPE A Sheet ___ of ___																			

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

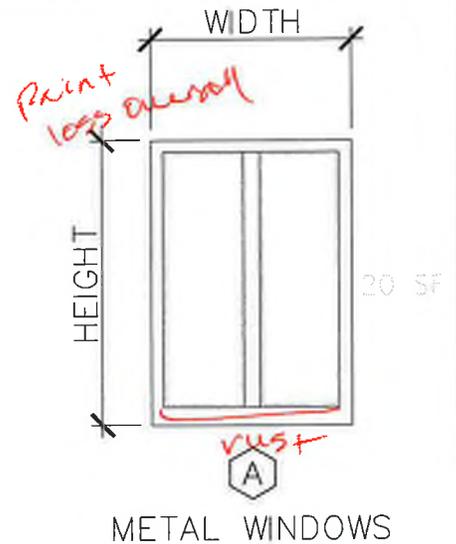

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 106	EXPOSURE	TYPE	A															
A-106-N	North	METAL	S.G.	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	metal Blinds		
					—	Poor	Good	Fair	—	Fair	—	Bad	Fair	Good	Bad	Good		
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
				TYPE A														
 KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103														
				Sheet ___ of ___														

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

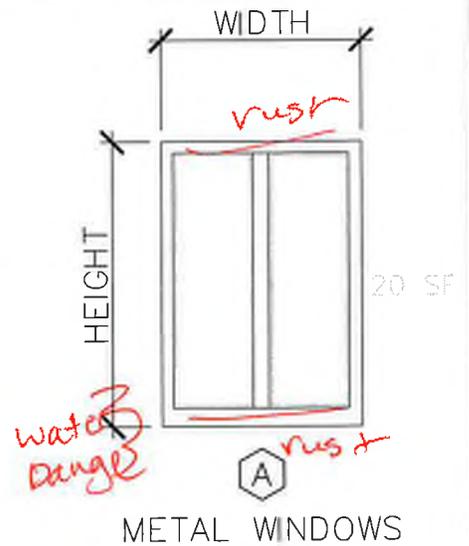

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES												
WINDOW NO. 107	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Bad Metal Blinds	
A-107-N	North	METAL	S.G.	—	Fair	Good	Fair	—	Fair	—	Bad	Fair	Fair	Bad	Fair	
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES											TYPE A	
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												
				121 E. DALLAS STREET CANTON, TEXAS 75103											Sheet ___ of ___	

XREFS:

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

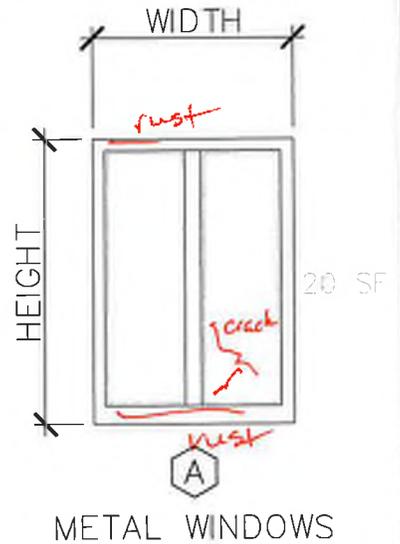

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES															
WINDOW NO. 108	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	metal Blinds				
A-108-N	North	METAL	S.G.	—	Fair	Poor-Bad	Fair	—	Fair	—	Bad	Good	Fair-Good metal	Bad	Fair				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE															
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103															
				TYPE A															
				Sheet__of__															

XREFS:

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

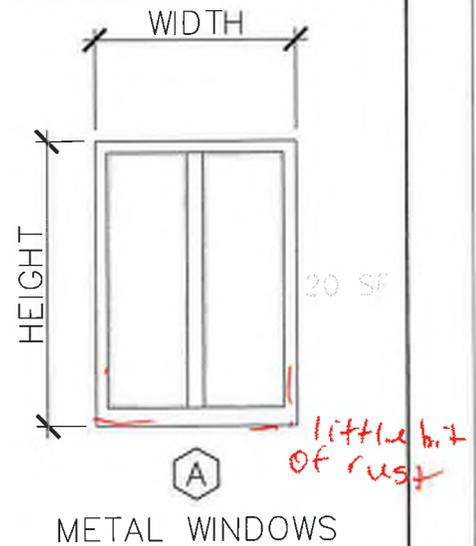

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																				
WINDOW NO. 109	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds									
A-109-N	North	METAL	S.G.	—	Fair	Good?	Fair	—	Fair	—	Bad	Good	Good	Bad	Fair									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																				
DATE:				VAN ZANDT COUNTY COURTHOUSE																				
JOB NO.: 2023.113				121 E. DALLAS STREET CANTON, TEXAS 75103																				
KOMATSU ARCHITECTURE				<h2 style="margin: 0;">TYPE A</h2> <p style="margin: 0;">Sheet ___ of ___</p>																				

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

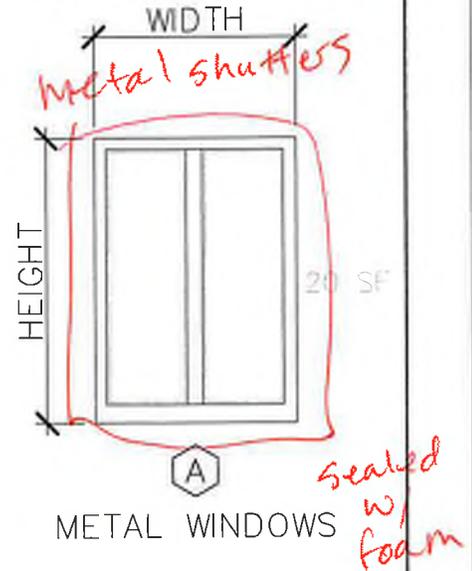

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
WINDOW NO. 110	A	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
A-110-N		<i>Noch</i>		METAL	S.G.		<i>—</i>				<i>—</i>		<i>—</i>	<i>Bad</i>	<i>linet</i>		<i>Bad</i>				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																			
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE												TYPE A							
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___							

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

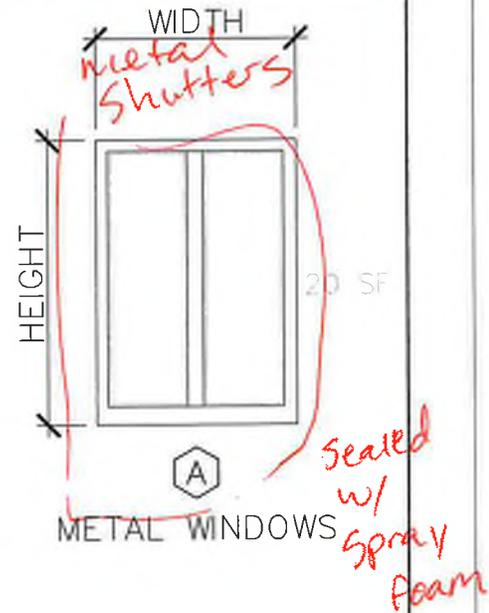

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO. 111	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
A-111-N			METAL	S.G.									Bad			Bad							
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES																		
DATE:					JOB NO.: 2023.113					VAN ZANDT COUNTY COURTHOUSE					TYPE A								
					121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet__of__								

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

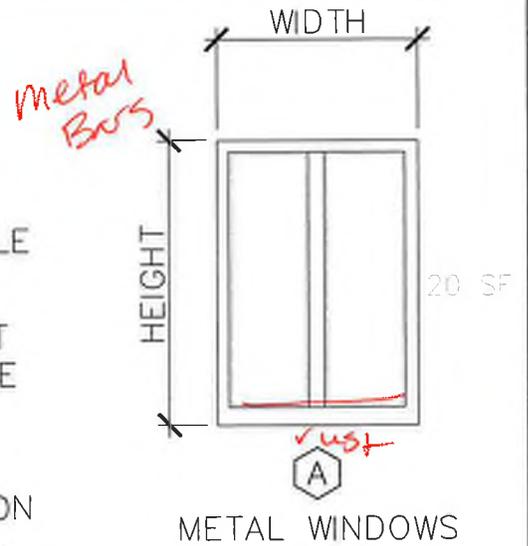

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES													
WINDOW NO. 113	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds	
A-113-N	<i>North</i>		METAL	S.G.		—	<i>Poor</i>	<i>Good</i>	<i>Fair</i>	—	<i>Fair</i>	—	<i>Bad</i>	<i>Good</i>	<i>Fair</i>	<i>Bad</i>	<i>Fair</i>	
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES													
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE													
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103																
TYPE A																		
Sheet ___ of ___																		

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

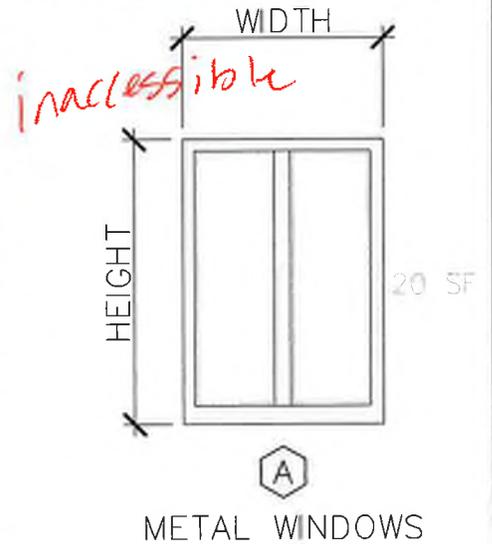

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 115	EXPOSURE	TYPE	A																				
A-115-N		METAL	S.G.	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL <i>lintel</i>	SILL	PERIMETER SEALANT								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE A																			
				Sheet ___ of ___																			

**METAL WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

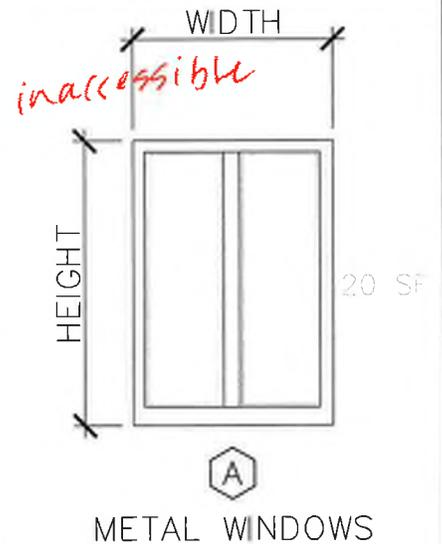

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO. 116	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
A-116-W			METAL	S.G.									<i>Bad</i>	<i>linney</i>		<i>Bad</i>				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE															
		KOMATSU ARCHITECTURE			121 E. DALLAS STREET CANTON, TEXAS 75103															
TYPE A																				
Sheet__of__																				

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

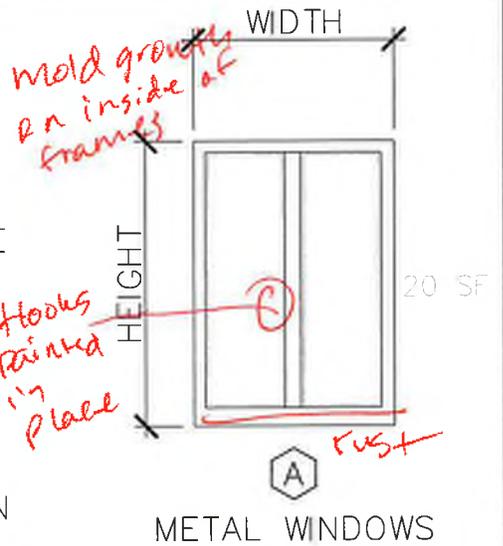

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 117		A																		
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds				
A-117-W		METAL	S.G.		—	Fair - Poor	Good	Fair	—	Fair	—	Bad	Good	Fair	Bad	Fair				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE A						
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___						

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

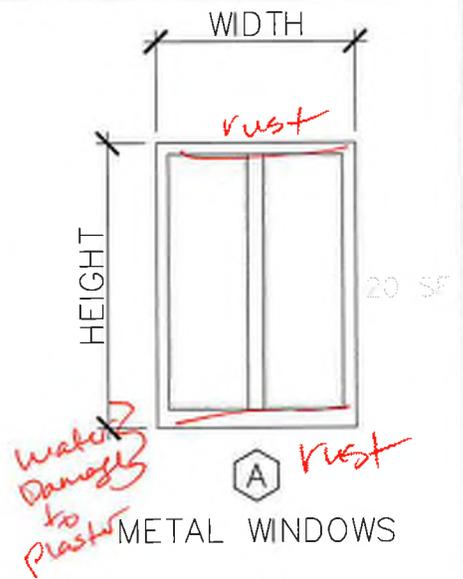

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
118		A																			
A-118-W	WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds			
				METAL	S.G.		—	Poor	Good	Fair	—	Fair	—	Bad	Fair	Fair	Bad	Good			
SCALE: 1/4" = 1'-0"							WINDOW SURVEY/WINDOW TYPES					TYPE A Sheet ___ of ___									
DATE:			JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103														

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

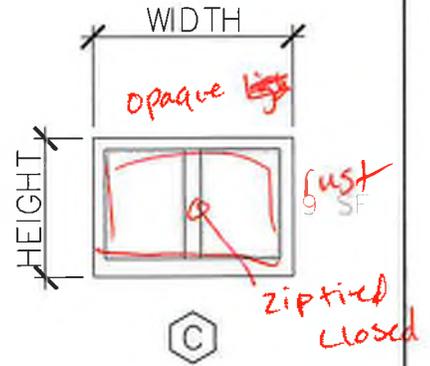

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 119	EXPOSURE	TYPE C	C	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
C-119-W			METAL	—	Poor	Good	Fair	—	Fair	—	Bad	Good	Fair	Bad				

SCALE: 1/4" = 1'-0"

DATE:

JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE C

Sheet__of__




KOMATSU
ARCHITECTURE

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

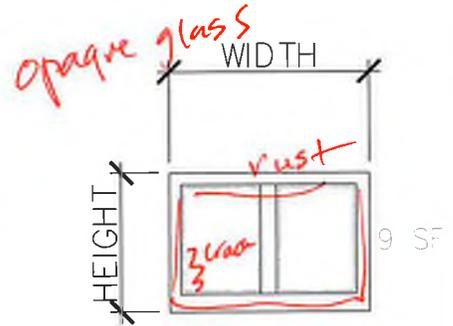

METAL WINDOWS

Window ziptied closed

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 120	EXPOSURE	TYPE C		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
C-120-W			METAL	S.G.																			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:				JOB NO.: 2023.113																			
				VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103																			
																TYPE C							
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

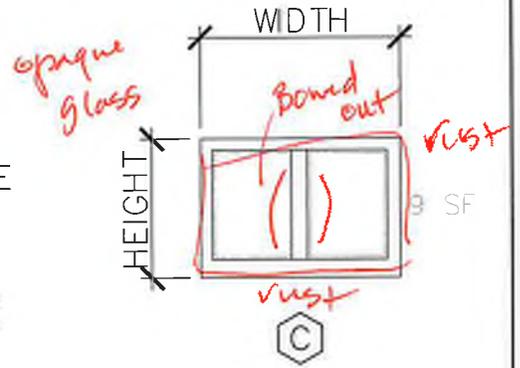

METAL WINDOWS

ziptied closed

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																						
C-121-W	121	WINDOW NO.	EXPOSURE	TYPE	C	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
						METAL	S.G.		—	Poor-Bad	Good	Fair-Poor	—	Fair	—	Bad	Good	Good	stone	Bad				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										VAN ZANDT COUNTY COURTHOUSE		TYPE C										
DATE:	JOB NO.: 2023.113																							
												121 E. DALLAS STREET CANTON, TEXAS 75103		Sheet__of__										

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

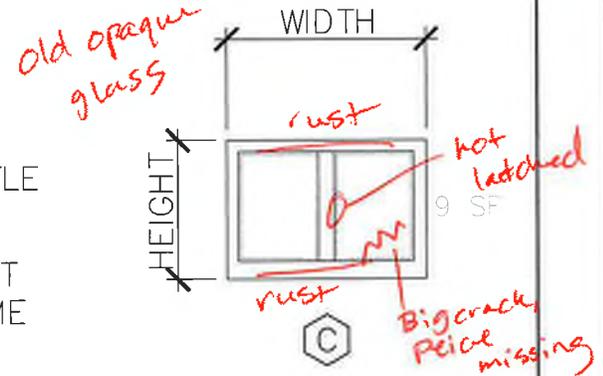

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																					
WINDOW NO. 123	EXPOSURE	TYPE	C																				
C-123-S	METAL	S.G.		—	Fair	Bad	Fair	—	Fair	—	Bad	Good	Good	Bad									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
 KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE C																			
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

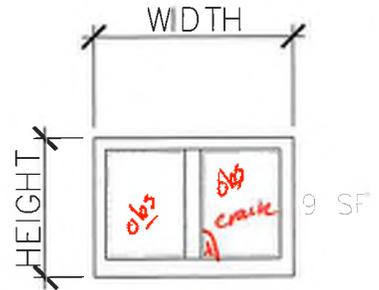

METAL WINDOWS

① CLEAN/REPAINT

* Large disconnect cabinets cover this window
Difficult full access.


WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 124	EXPOSURE	TYPE C		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
C-124-S			METAL	S.G.	Good	Good	Good/Bad obscured	Good	Good	FAIR	Bad	FAIR	Good	Bad				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:				JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE				TYPE C						
				121 E. DALLAS STREET CANTON, TEXAS 75103				Sheet ___ of ___										

XREFS:

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

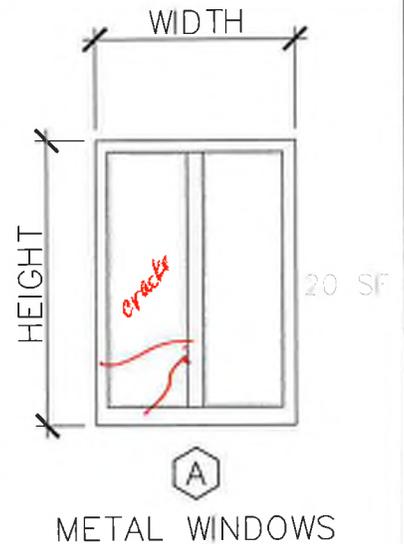

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 127	A	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
A-127-S			METAL	S.G.	FAIR	—	FAIR	B/GOOD	GOOD	—	FAIR	—	Bad	FAIR	FAIR	Bad						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE A								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

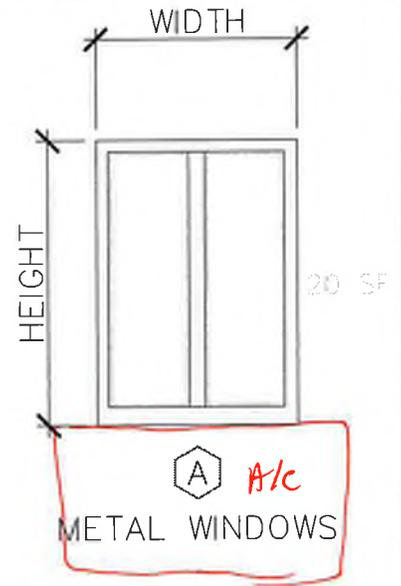

① CLEAN/REPAINT


A/c unit under this window.

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 128	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
A-128-S		METAL	S.G.	FAIR		FAIR	GOOD	GOOD		FAIR		Bad	FAIR	FAIR	Bad								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												TYPE A							
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet__of__							

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

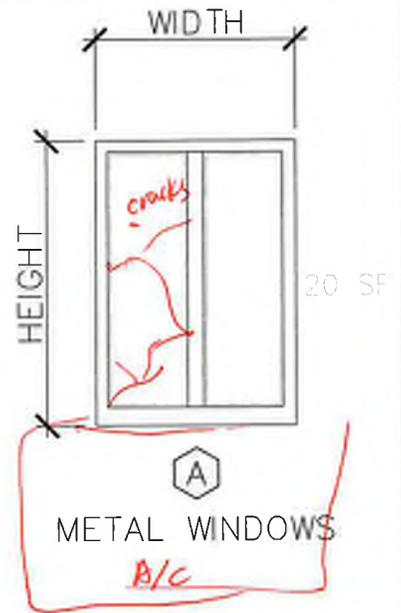

① CLEAN/REPAINT

A/C unit under this window


WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 129	EXPOSURE	TYPE	A	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
A-129-S	<i>South</i>	METAL	S.G.	FAIR		FAIR	B/Good	Good		Poor		Bad	FAIR	FAIR	Bad								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE: _____				JOB NO.: 2023.113																			
KOMATSU ARCHITECTURE				VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103																			
				<h2 style="margin: 0;">TYPE A</h2> <p style="margin: 0;">Sheet ___ of ___</p>																			

XREFS:

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

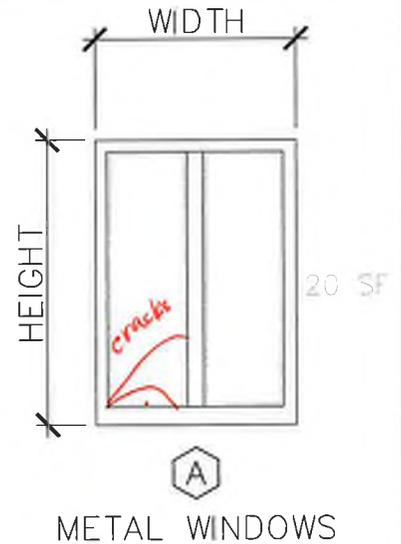

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 130																				
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
A-130-S	<i>South</i>	METAL	S.G.	FAIR	—	FAIR	<i>Broken 1st Pane - replace</i>	B/Good	Good	—	Poor	—	Bad	FAIR	FAIR	Bad				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE A								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet__of__								

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

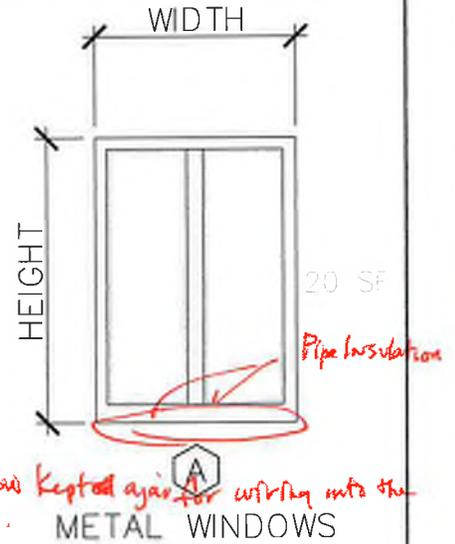

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
WINDOW NO. 131	A	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
A-131-S				METAL	S.G.	FAIR		FAIR	Good	FAIR		Poor		Bad	FAIR	FAIR	Bad				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE A									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___									

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

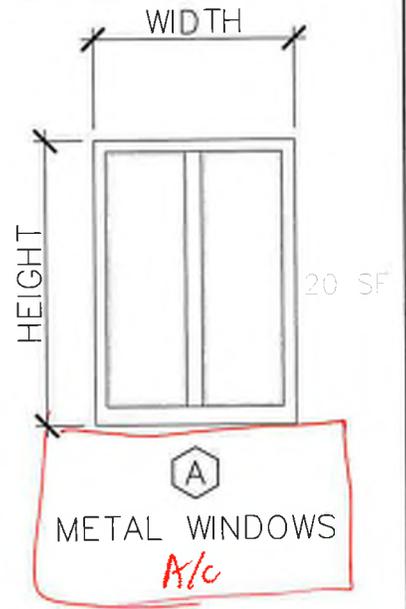

① CLEAN/REPAINT


A/c under this window.

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 132	EXPOSURE	TYPE A	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
A-132-S			METAL	S.G.	Poor	—	Poor/BAO	Good	Poor	—	Poor	—	Bad	FAIR	FAIR/BAO	Bad							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
KOMATSU ARCHITECTURE						121 E. DALLAS STREET CANTON, TEXAS 75103																	
TYPE A																							
Sheet ___ of ___																							

METAL WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

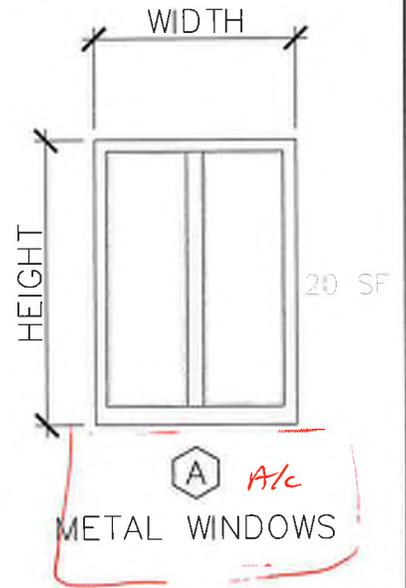

① CLEAN/REPAINT

air conditioner under this window


WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO. 133	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
A-133-S		A	METAL	S.G.	FAIR		Poor	Good	FAIR		Poor		Bad	FAIR	FAIR	Bad							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
KOMATSU ARCHITECTURE						121 E. DALLAS STREET CANTON, TEXAS 75103																	
TYPE A																							
Sheet ___ of ___																							

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

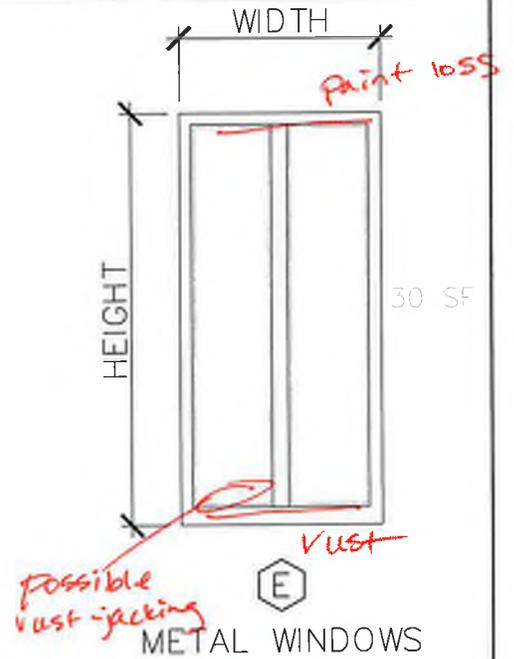

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																					
E-201-E	WINDOW NO. 201	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	inner SUPPORT MATERIAL	SILL metal	PERIMETER SEALANT	Metal Blinds					
				METAL	S.G.		—	Fair	Good	Fair	—		—	Bad	Good	Fair	Bad	Fair-	Good				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																					
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___									

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

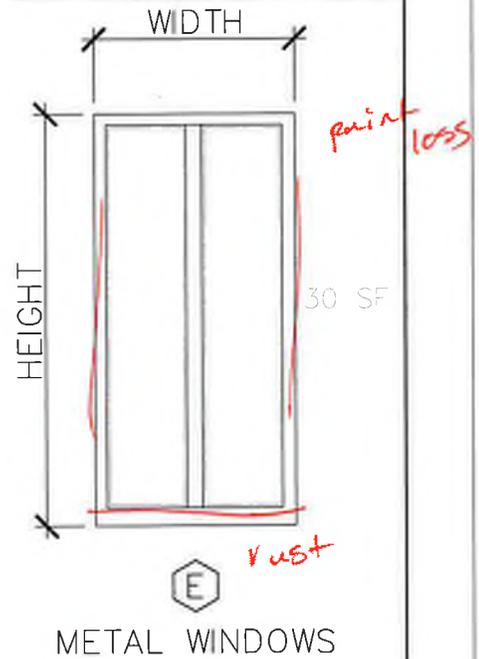

① CLEAN/REPAINT


WINDOW					SPECIFIC CONDITION NOTES														
WINDOW NO. 202	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds		
E-202-E			METAL	S.G.			Poor	Good	Fair		Fair		Bad	Good	Good	Bad	Fair		
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE														
		KOMATSU ARCHITECTURE			121 E. DALLAS STREET CANTON, TEXAS 75103														
TYPE E																			
Sheet__of__																			

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

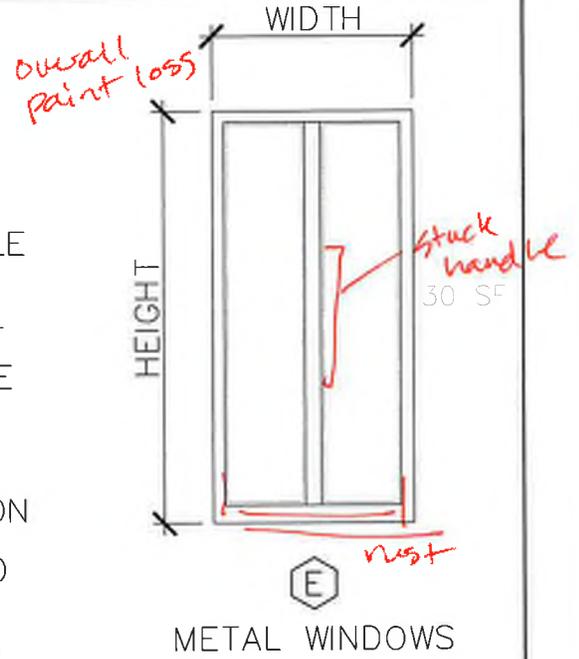

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																			
WINDOW NO. 203																					
	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
E-203-E		E	METAL	S.G.		—	Poor	Good	Fair	—	Fair	—	Bad	Good	Fair	Bad	Good				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE E									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___									

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

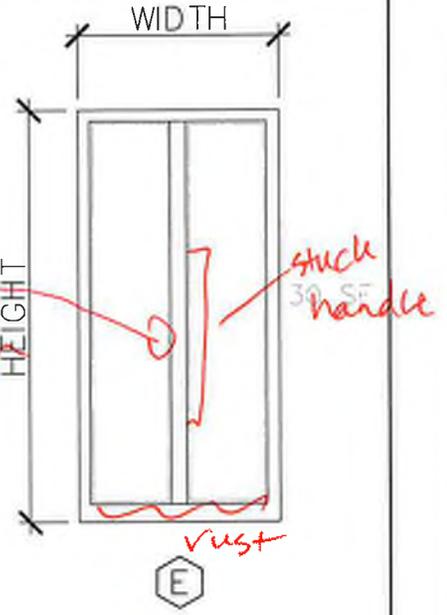

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
205	E	WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds		
E-205-E					METAL	S.G.		—	Fair-Poor	Good	Fair	—	Fair	—	Bad	Good	Fair	Bad	Good		
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E							
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

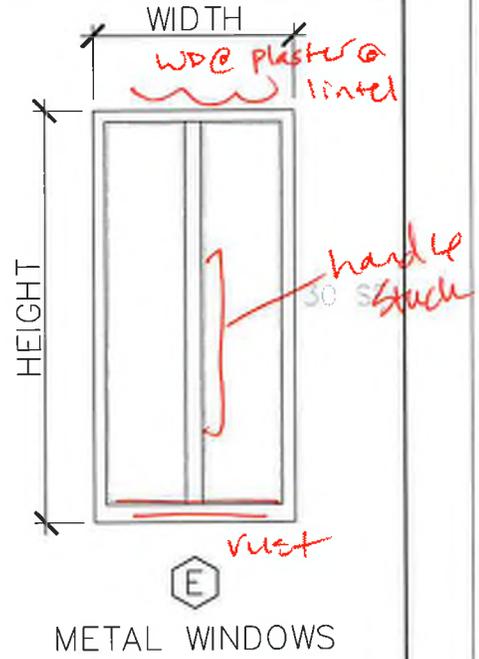

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 206	E	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds				
E-206-E	E	—	Poor	Good	Fair	—	Fair	—	Bad	Fair-Poor	Good	Bad	Good				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES															
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE															
		121 E. DALLAS STREET CANTON, TEXAS 75103															
		TYPE E															
		Sheet ___ of ___															

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

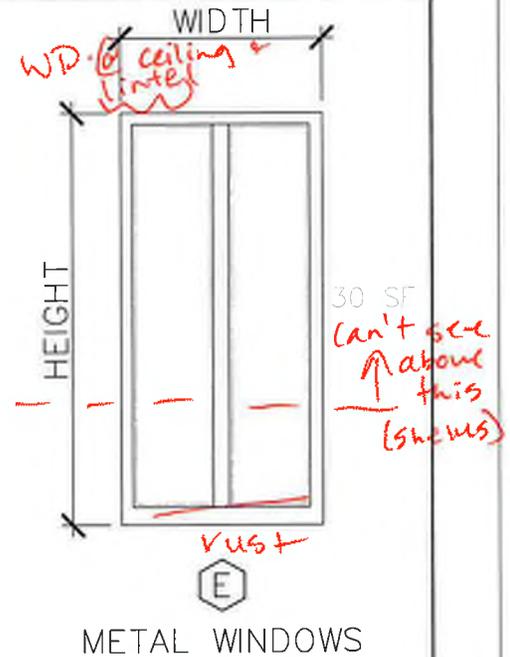

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
207	E	WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Brinds	
E-207-E					METAL	S.G.		—	Poor	Good	Fair	—	Fair	—	Bad	Fair	Fair	Bad	Fair	
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES													TYPE E					
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103													Sheet__of__					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

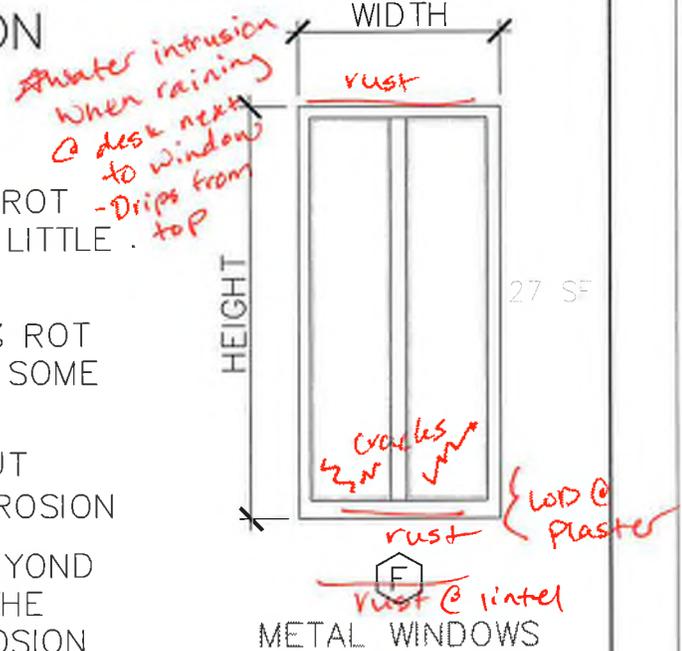

① CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES																		
210	F	WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds	
F-210-N					METAL	S.G.		—	Fail	Bad	Fair - Poor	—	Fail	—	Bad	Fail	Fail	Bad	Good	
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE F								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								


XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

green paint

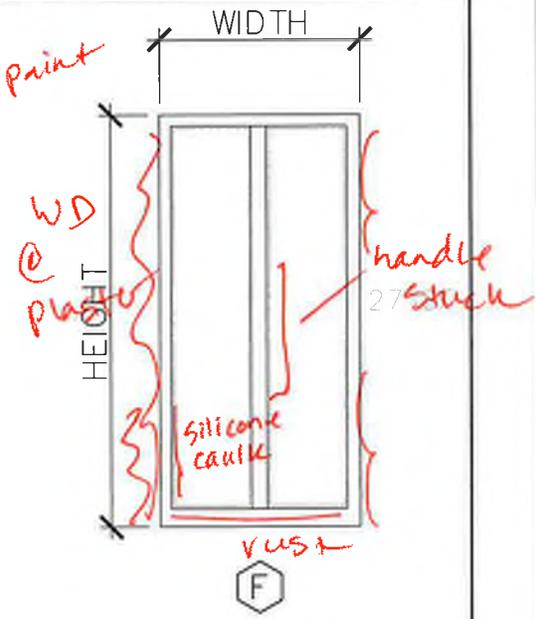

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																
211	F	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds
F-211-N				METAL	S.G.		—	Fair-Poor	Good	Fair	—	Fair	—	Bad	Fair	Fair	Bad	Good
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE F						
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

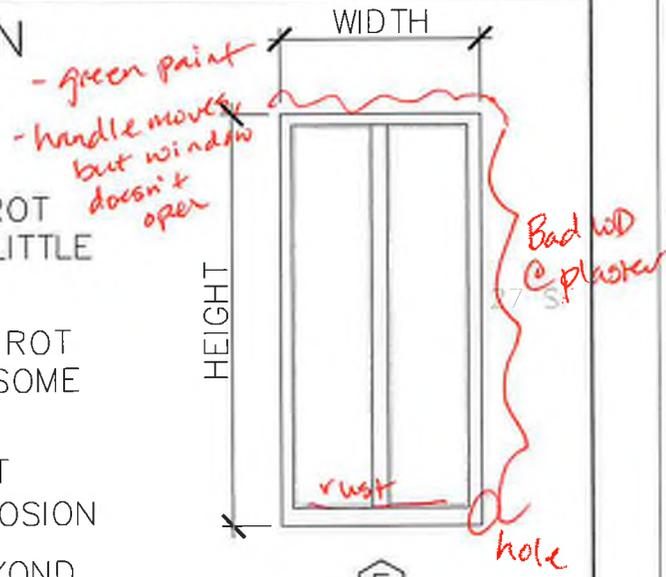

METAL WINDOWS

① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES															
212	F	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	evidence of metal Blinds				
F-212-N		—	Fair	Good	Fair	—	Fair	—	Bad	Poor	Fair	Bad					
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION												
			METAL	S.G.													

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113




WINDOW SURVEY/WINDOW TYPES
VAN ZANDT COUNTY COURTHOUSE
 121 E. DALLAS STREET
 CANTON, TEXAS 75103

TYPE F
 Sheet ___ of ___

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

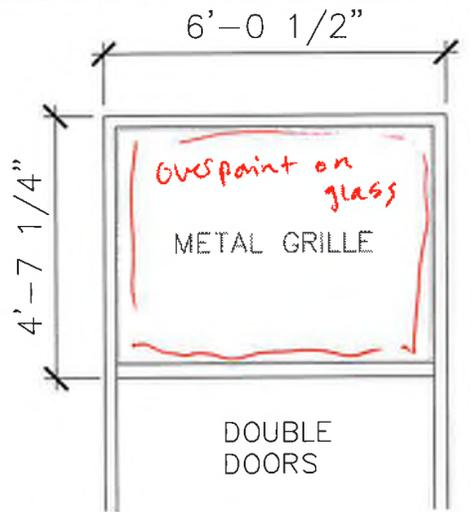

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO. 213	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
H-213-N		H	METAL	S.G.		—	Good	Good	Good	—	N/A	—	Bad	Good	N/A	Bad							
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES																		
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																		
		KOMATSU ARCHITECTURE			121 E. DALLAS STREET CANTON, TEXAS 75103																		
																	TYPE H						
																	Sheet__of__						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

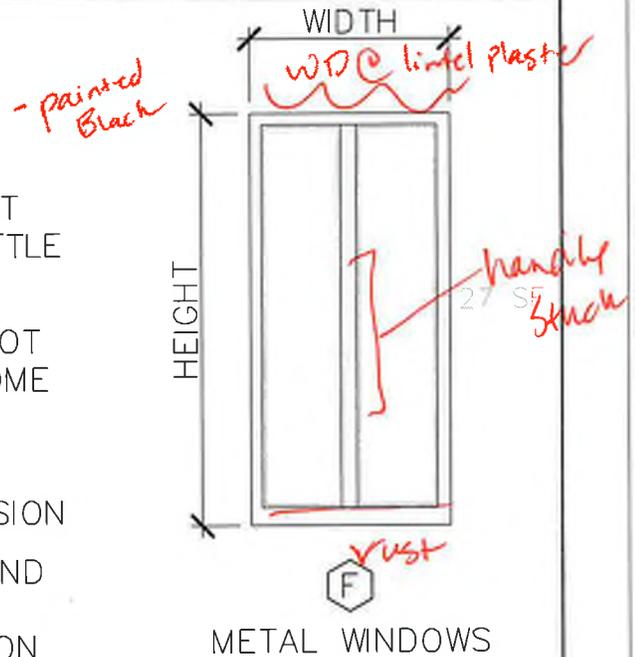

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES												
WINDOW NO. 214	EXPOSURE	TYPE	F	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds	- Do not open
F-214-N				—	Fair	Good	Fair	—	Fair	—	Bad	Poor	Fair	Bad	Poor	
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												
DATE:		JOB NO.: 2023.113		TYPE F												
DATE:		JOB NO.: 2023.113		Sheet ___ of ___												
				121 E. DALLAS STREET CANTON, TEXAS 75103												

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

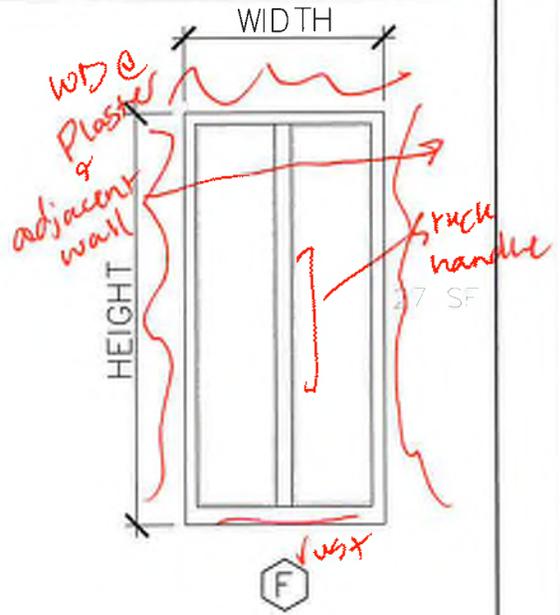

METAL WINDOWS

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES															
215	F	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds
F-215-N			METAL	S.G.		—	Fair	Good	Fair	—	Fair	—	Bad	Poor	Fair	Bad	Fair
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES															
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE															
		121 E. DALLAS STREET CANTON, TEXAS 75103															
TYPE F																	
Sheet ___ of ___																	

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

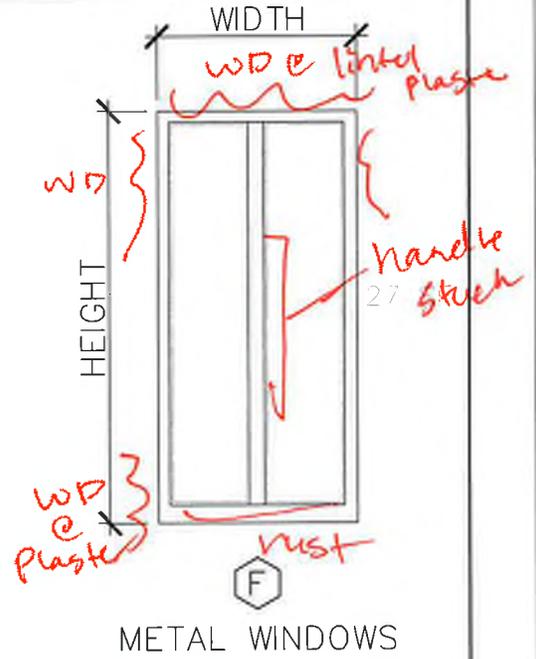

METAL WINDOWS


① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
F-216-N	216	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds		
			F	METAL	S.G.		—	Fair	Good	Fair	—	Fair	—	Bad	Poor	Fair - Poor	Bad	Fair		
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE F								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

**Painted
Black
Recently*

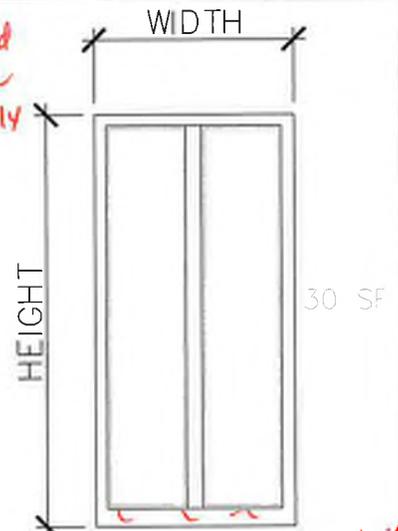

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION



METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																	
217	E	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blindels	stay up
E-217-N				METAL	S.G.		—	Good	Good	Fair	—	Fair	—	Bad	Good	Good	Bad	F	—
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E					
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												Sheet ___ of ___			
				121 E. DALLAS STREET CANTON, TEXAS 75103															
KOMATSU ARCHITECTURE																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

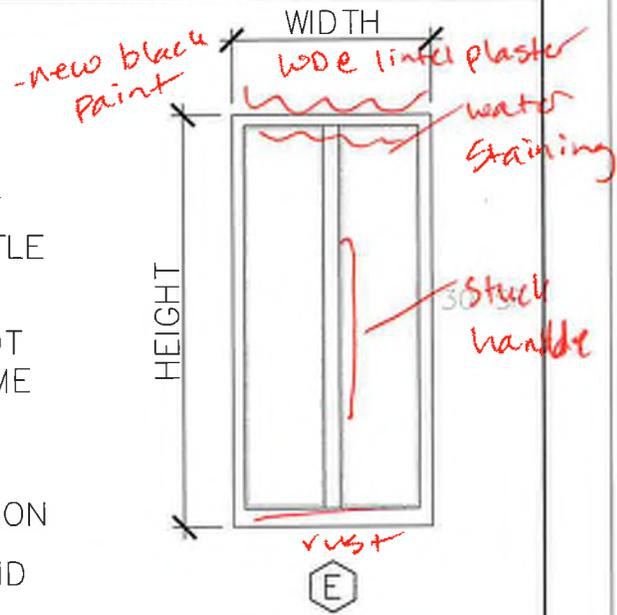

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
218		E																					
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds						
E-218-N			METAL	S.G.		—	Fair	Good	Fair	—	Fair	—	Bad	Poor-Bad lintel	Fair metal	Bad	Fair						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												TYPE E							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
 KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___									

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

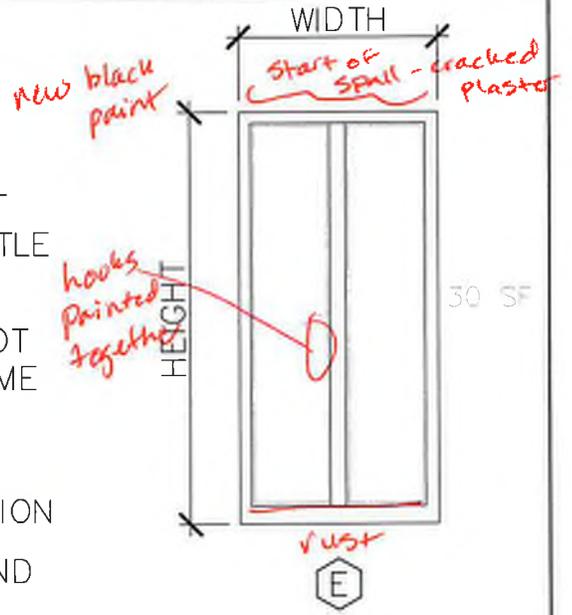

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																		
E-219-W	219	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
			E	METAL	S.G.		—	Fair	Good	Fair	—	Fair	—	Bad	Fair-poor	metal	Bad	Fair		
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE E								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

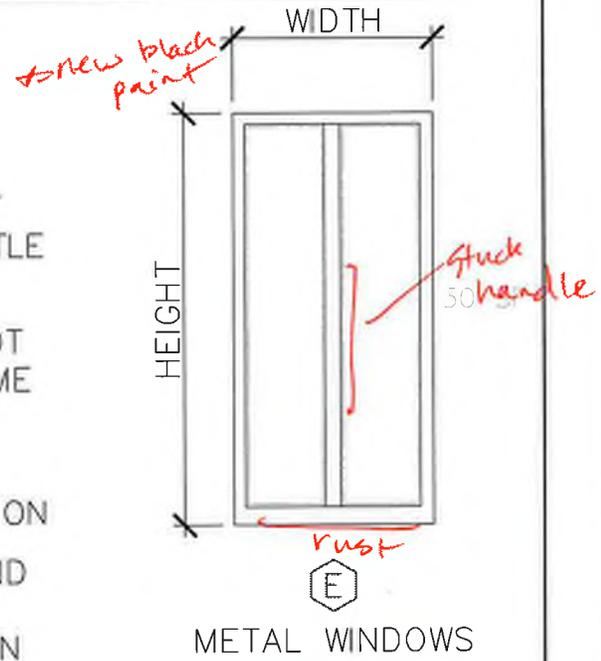

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																
WINDOW NO. 220	E	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds
E-220-W				METAL	S.G.		—	Fair	Good	Fair	—	Fair	—	Bad	Fair	Fair-Good	Bad	Good
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																
		121 E. DALLAS STREET CANTON, TEXAS 75103																
		TYPE E																
		Sheet ___ of ___																

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

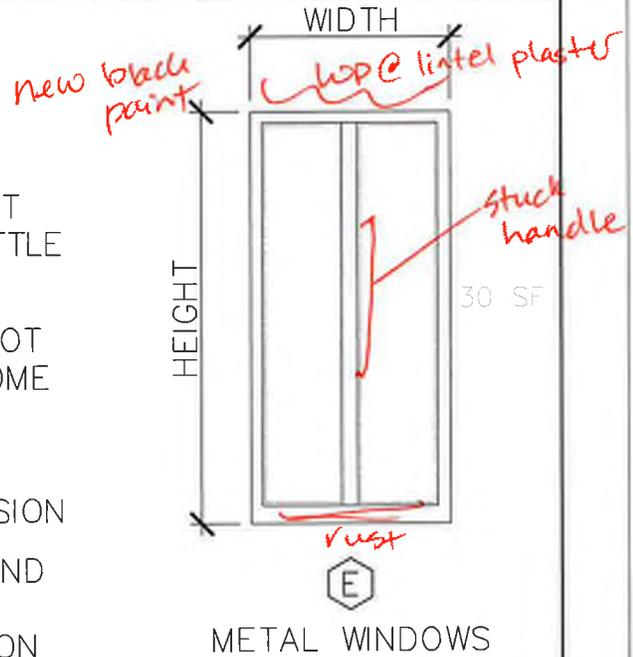

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																																			
WINDOW NO. 221																																					
EXPOSURE		TYPE	E	FRAME MATERIAL		GLAZING MATERIAL		OVERALL CONDITION		EXTERIOR FINISH		INTERIOR FINISH		GLASS		FRAME		SASHES		HARDWARE		GLAZING MATERIAL		WEATHERSTRIPPING		SUPPORT MATERIAL		SILL		PERIMETER SEALANT		Blinds					
E-221-W				METAL		S.G.				—		Good		Good		Fair		—		Fair		—		Bad		Fair-Roof (inner)		Fair		Bad		Good					
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES											TYPE E																								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																																			
		121 E. DALLAS STREET CANTON, TEXAS 75103											Sheet ___ of ___																								

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

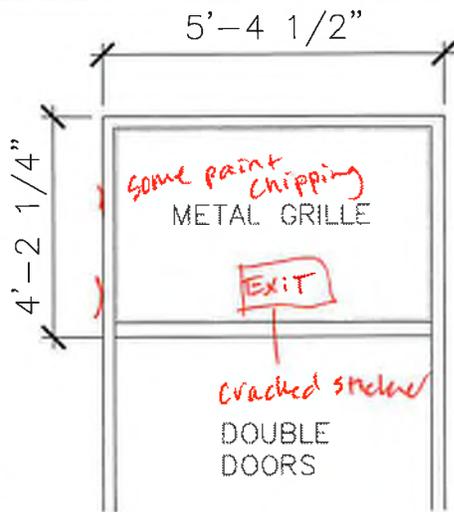

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
WINDOW NO. 222	G	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
G-222-W				METAL	S.G.		—	Fair	Good	Good	—	N/A	—	Bad	Good	N/A	Bad				
SCALE: 1/4" = 1'-0"							WINDOW SURVEY/WINDOW TYPES														
DATE:			JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE						TYPE G								
							121 E. DALLAS STREET CANTON, TEXAS 75103						Sheet__of__								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

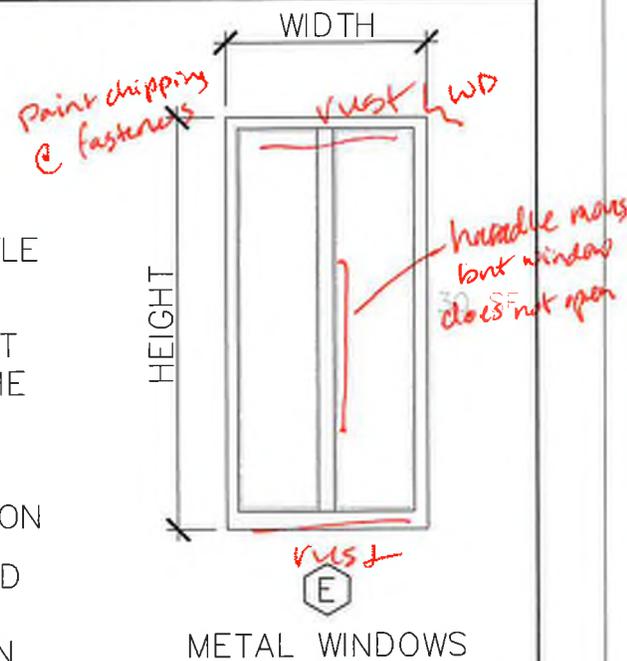

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
224	E	WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds	- Do not stay up	
E-224-W					METAL	S.G.		—	Poor	Good	Fair - Poor	—	Fair	—	Bad	Fair - Poor lintel	Fair	Bad	Poor		
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E							
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE												Sheet ___ of ___							
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

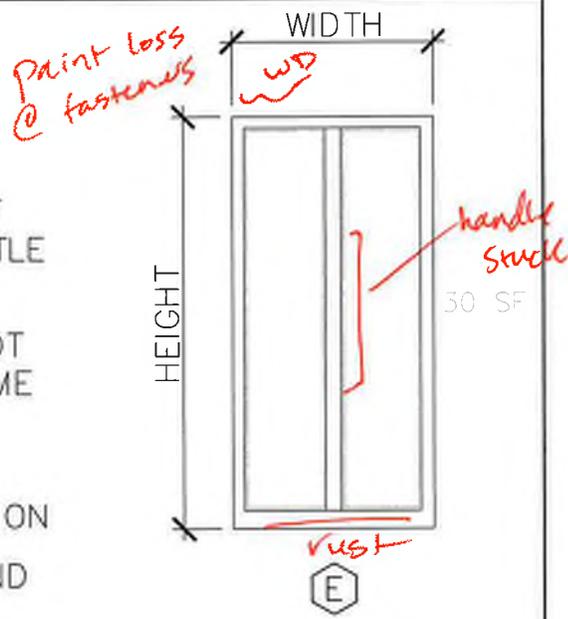

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																					
225	E	WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
E-225-W					METAL	S.G.		—	Poor	Good	Fair - Poor	—	Fair	—	Bad	Fair	Fair	Bad	Fair				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																					
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___									

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

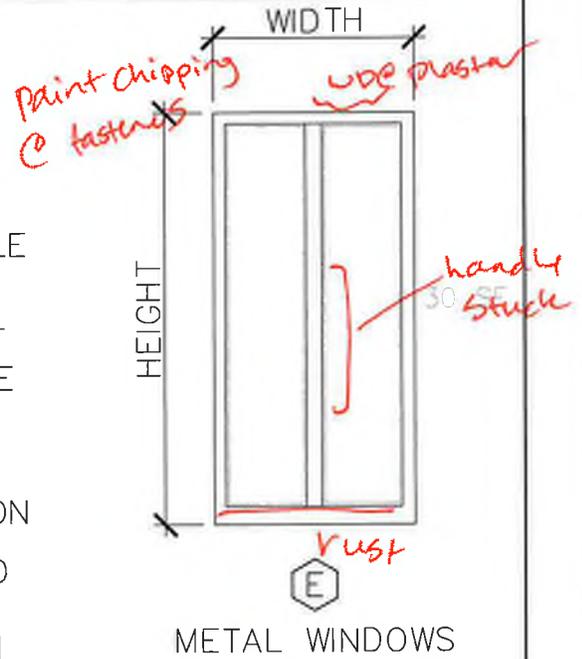

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 226			E																				
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
E-226-S		METAL	S.G.		—	Poor	Good	Fair	—	Fair	—	Bad	Fair	Fair	Bad	Fair							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE E																			
				Sheet__of__																			

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

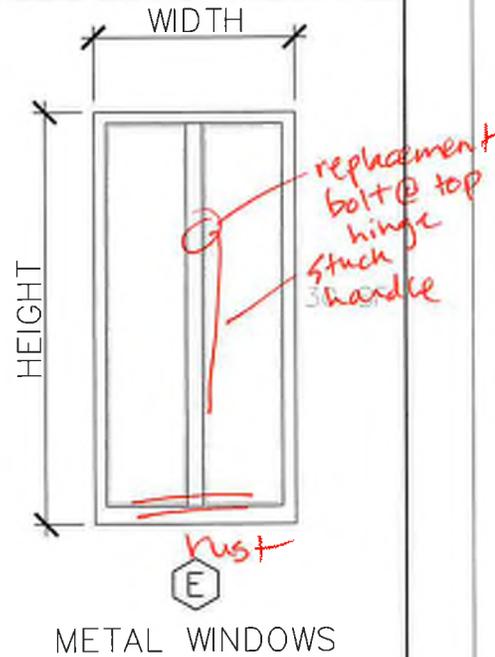

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 228																						
EXPOSURE	E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds						
		METAL	S.G.		—	Poor	Good	Fair	—	Fair	—	Bad	Fair	Fair	Bad	Poor						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE E								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

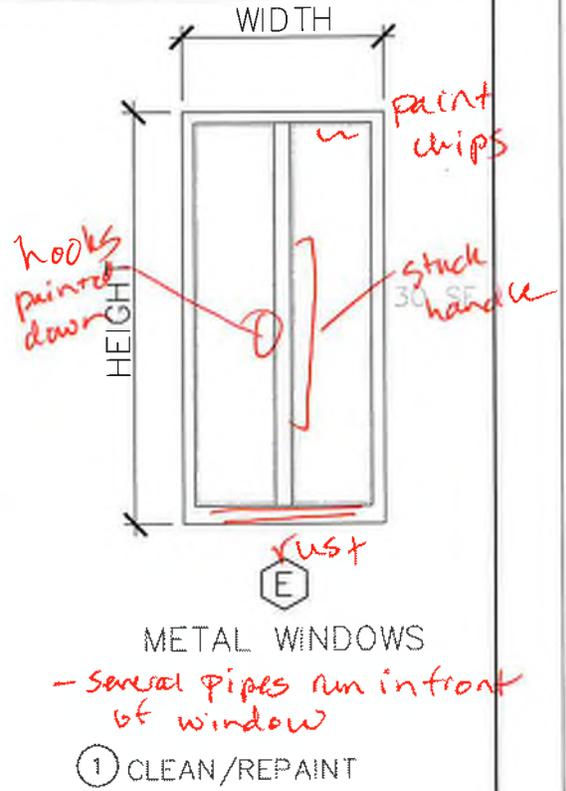

XREFS:


WINDOW					SPECIFIC CONDITION NOTES												
WINDOW NO. 229	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds - Don't open all the way
E-229-S			METAL	S.G.		—	Poor	Good	Fair	—	Fair	—	Bad	Fair	Good	Bad	Fair - Poor
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES												
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE												
KOMATSU ARCHITECTURE					121 E. DALLAS STREET CANTON, TEXAS 75103												
TYPE E																	
Sheet ___ of ___																	

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

Window does not fully close

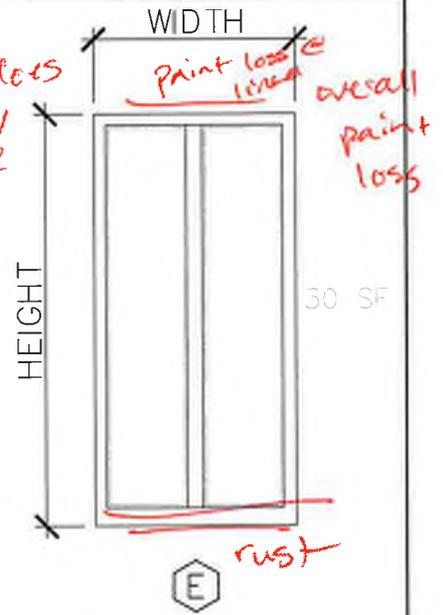

① CLEAN/REPAINT


WINDOW						SPECIFIC CONDITION NOTES													
WINDOW NO. 230	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds		
E-230-S			METAL	S.G.			Poor	Good	Fair-Poor		Fair		Bad	Fair	Fair-Good	Bad	Good		
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES													
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE													
		KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103													
																TYPE E			
																Sheet__of__			

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

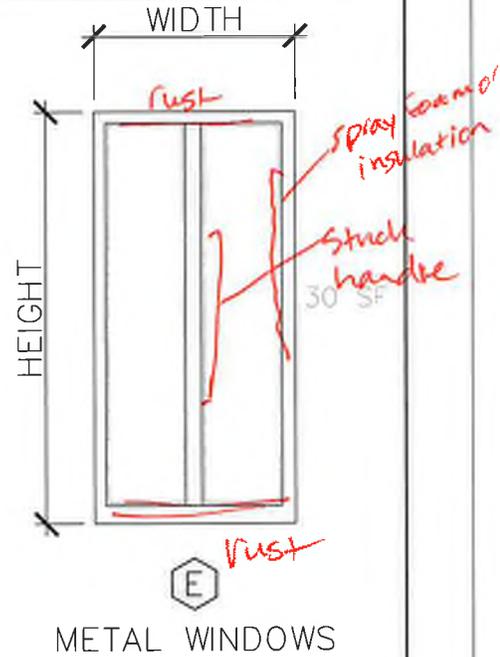

① CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES												
WINDOW NO. 232	EXPOSURE	TYPE E	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds
E-232-S	METAL	S.G.	—	Poor	Good	Fair	—	Fair	—	Bad	Good	Fair-Good	Bad	Good
SCALE: 1/4" = 1'-0"			WINDOW SURVEY/WINDOW TYPES										TYPE E	
DATE:		JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE											
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___		


XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

Paint chipping @ fasteners

(wide plaster 30 SF)

rust & paint loss

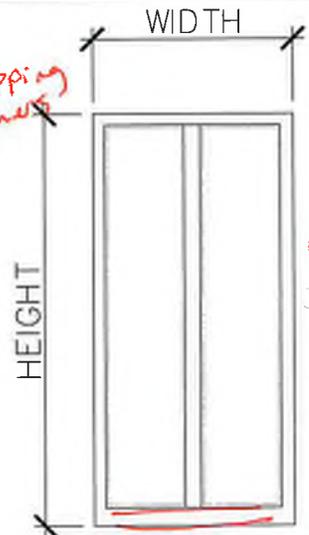

METAL WINDOWS

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 233																						
EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds						
E-233-S		METAL	S.G.		—	Poor	Good	Fair	—	Fair	—	Bad	Good	Good	Bad	Good						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE												TYPE E								
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

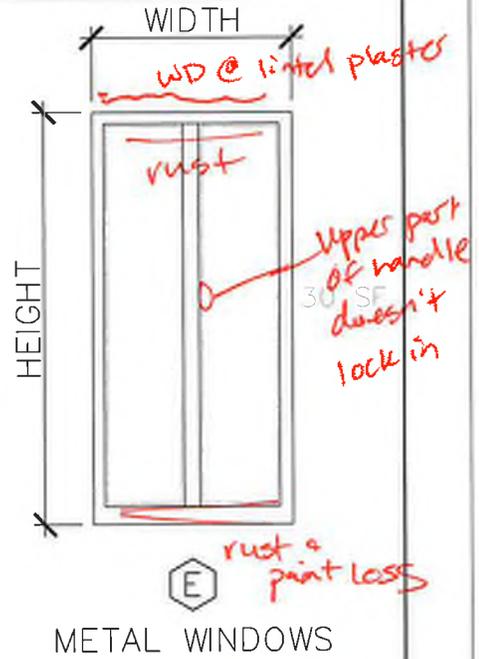

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 234	EXPOSURE																			
	TYPE	E																		
E-234-S	FRAME MATERIAL	METAL																		
	GLAZING MATERIAL	S.G.																		
	OVERALL CONDITION																			
	EXTERIOR FINISH	—																		
	INTERIOR FINISH	Poor																		
	GLASS	Good																		
	FRAME	Fair-Poor																		
	SASHES	—																		
	HARDWARE	Fair-Poor																		
	GLAZING MATERIAL	—																		
	WEATHERSTRIPPING	Bad																		
	SUPPORT MATERIAL	Fair																		
	SILL	Fair																		
	PERIMETER SEALANT	Bad																		
	Metal Blinds	Good																		
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE E								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

XREFS:

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

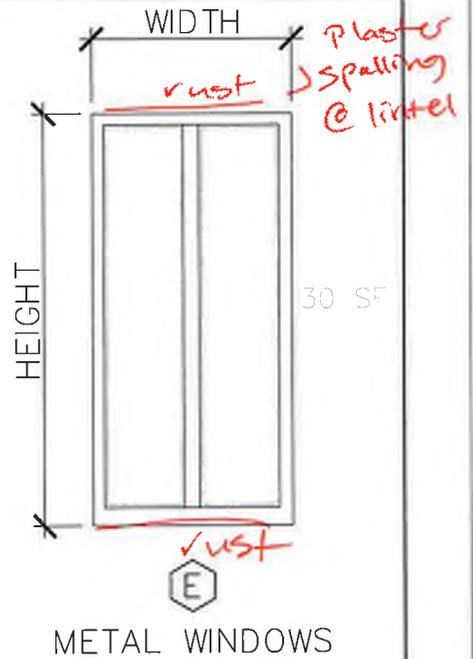

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES													
E-235-S	235		E	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds		
		METAL			Poor	Good	Fair - Poor		Fair		Bad	Poor	Good	Bad	Fair		
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES													
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE													
				121 E. DALLAS STREET CANTON, TEXAS 75103													
				TYPE E													
				Sheet ___ of ___													

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

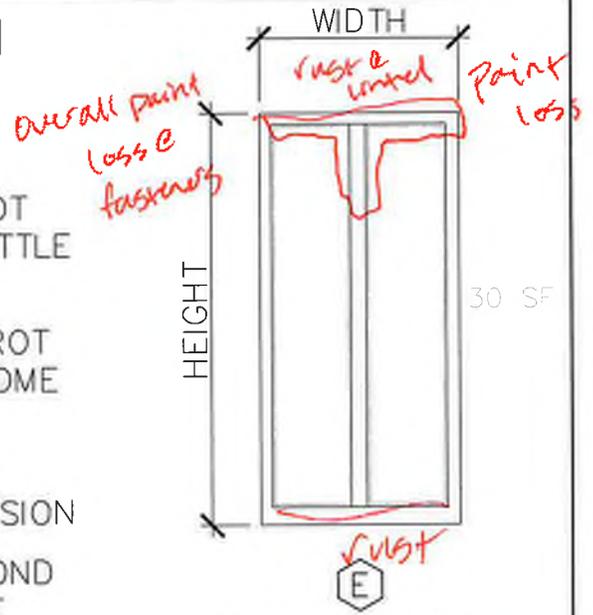

METAL WINDOWS
 Window does not fully close
 ① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
E-236-S	236	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds				
			E	METAL	S.G.		—	Poor	Good	Fair-Poor	—	Fair	—	Bad	Poor	Fair	Bad	Good				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103																				
		TYPE E																				
		Sheet ___ of ___																				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

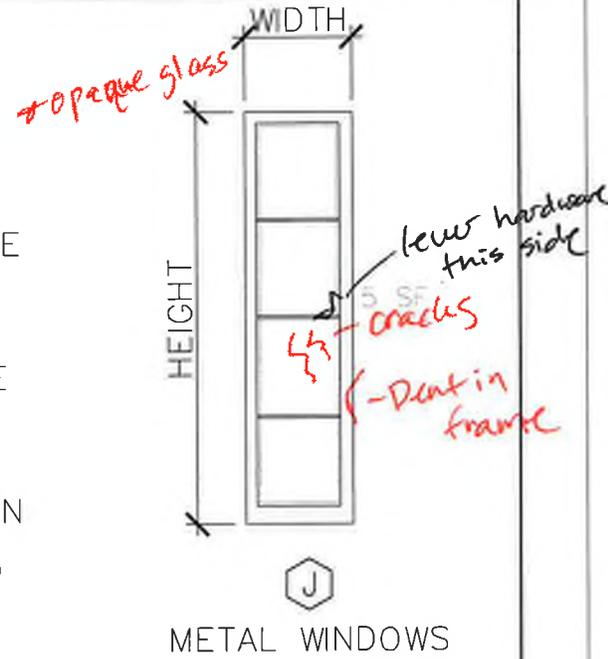

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES														
WINDOW NO. 237	J	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT
J-237-S			METAL	S.G.		—	Fair	Poor - Bad	Fair	—	Fair	—	Bad	Good	Good	Bad
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE J				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE														
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

XREFS:

**WOOD WINDOW RESTORATION
ASSESSMENT CODING**

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

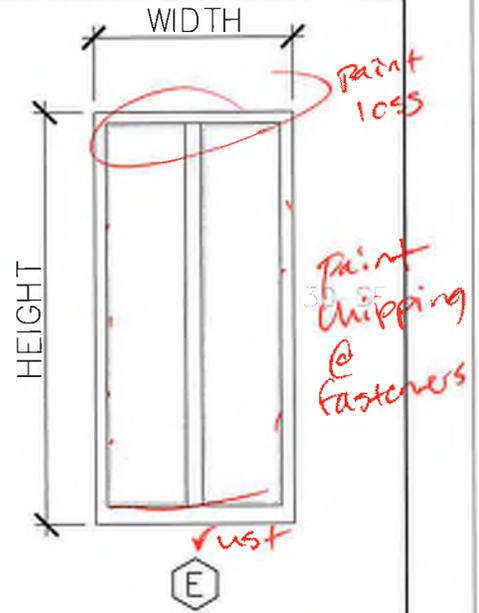

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																						
238	E	WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds					
E-238-S					METAL	S.G.		—	Fair	Good	Fair	—	Fair	—	Bad	Good	Good	metal	Bad	Good				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																						
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103																						
		TYPE E																						
		Sheet ___ of ___																						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

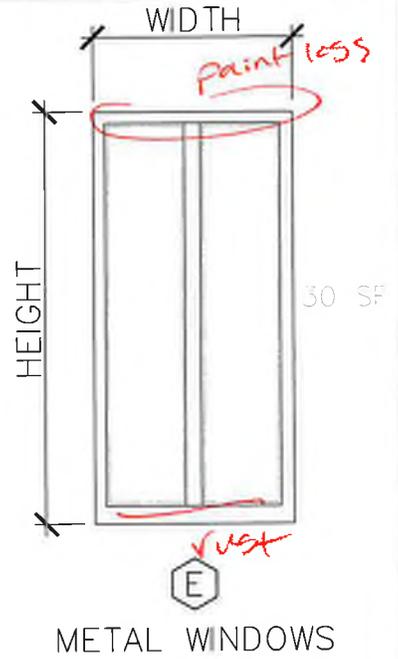

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES												
WINDOW NO. 239	EXPOSURE	TYPE E	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds
E-239-S			METAL	S.G.		—	Fair	Good	Fair	—	Fair	—	Bad	Good	Good	Bad	Good
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES												
DATE:					JOB NO.: 2023.113					VAN ZANDT COUNTY COURTHOUSE					TYPE E		
					121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet__of__		

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

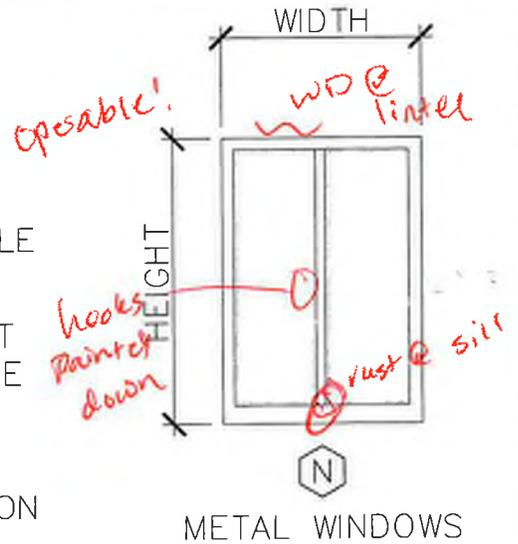

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 302																						
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds						
N-302-E	N	METAL	S.G.		—	Poor	Good	Poor	—	Fair	—	Bad	Fair	Fair	Bad	Good-Fair						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE N								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

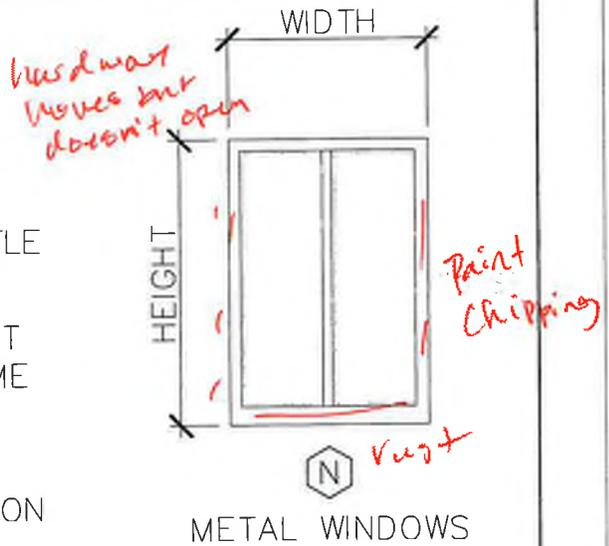

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES												
WINDOW NO.	EXPOSURE	TYPE	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds	
N-303-E		N		—	Poor	Good	Fair-Poor	—	Fair	—	Bad	Good	Fair	Bad	Good	Metal Blinds
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												
				121 E. DALLAS STREET CANTON, TEXAS 75103												
TYPE N																
Sheet ___ of ___																

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

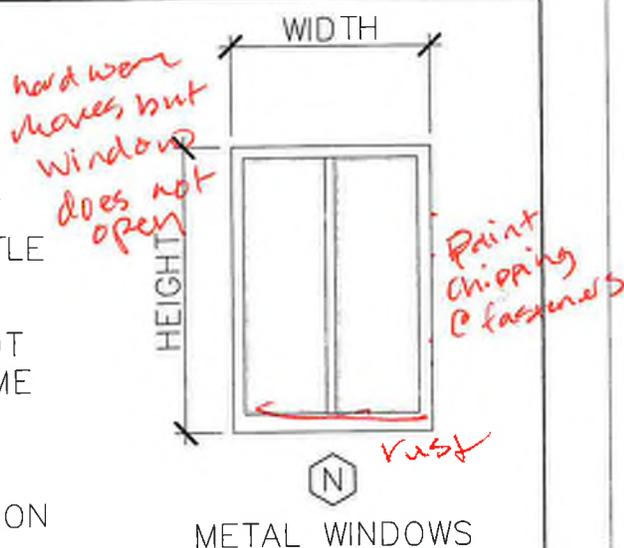

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 306	N	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds
N-306-E			METAL	S.G.		—	Poor	Good	Fair-Poor	—	Fair	—	Bad	Good	Fair-Poor	Bad	Fair
SCALE: 1/4" = 1'-0"		WINDOW SURVEY / WINDOW TYPES															
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE															
		121 E. DALLAS STREET CANTON, TEXAS 75103															
		TYPE N															
		Sheet ___ of ___															

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

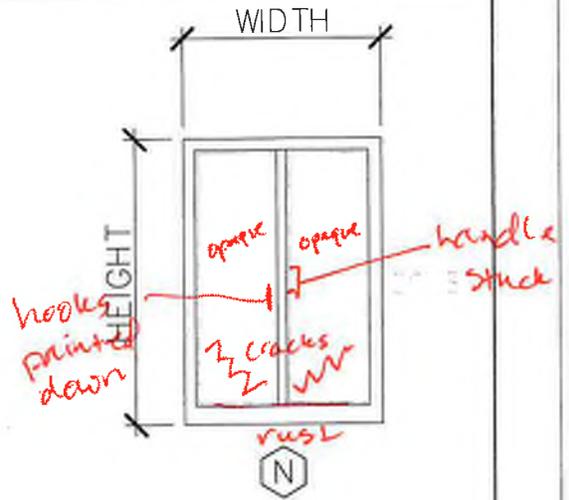

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																
WINDOW NO. 307	EXPOSURE	TYPE N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Plastic Blinds				
N-307-E		METAL	—	Fair	Bad	Fair	—	Fair-Poor	—	Bad	Good	Good	Bad	Good				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE N				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

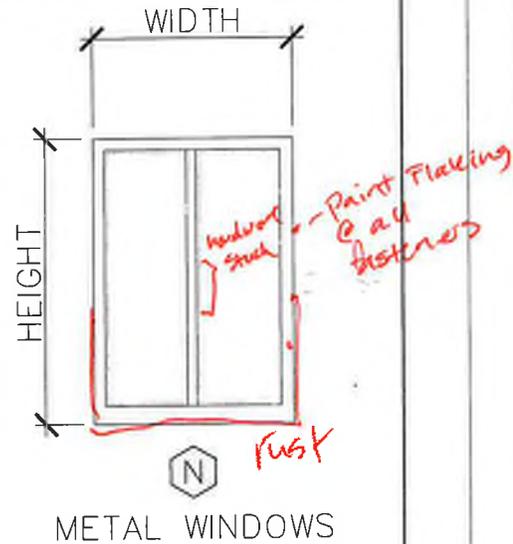

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES																	
WINDOW NO. 310	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
N-310-N		N	METAL	S.G.		—	Poor	Good	Fair	—	Fair	—	Bad	Fair - Good linter	Fair - Poor	Bad	Fair						
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
						121 E. DALLAS STREET CANTON, TEXAS 75103																	
TYPE N																							
Sheet ___ of ___																							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

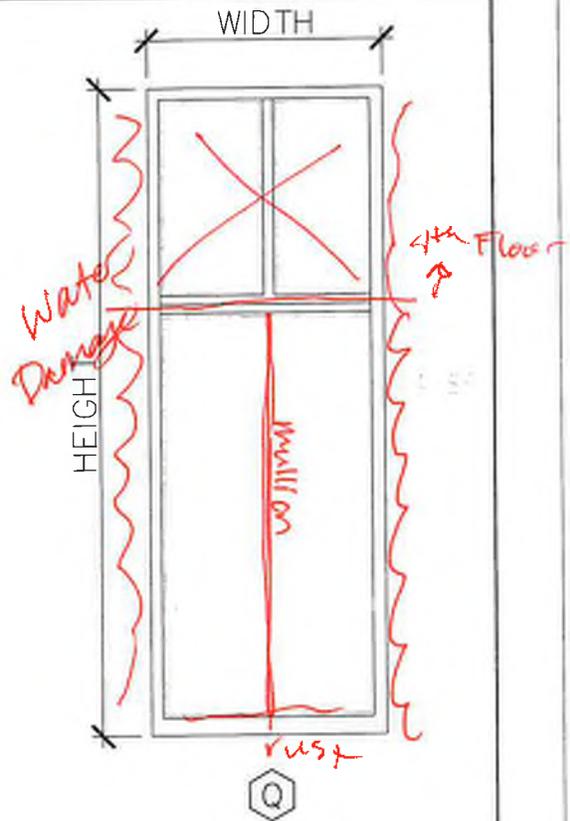

METAL WINDOWS


CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES																
WINDOW NO. 311	EXPOSURE	TYPE Q	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Wood shutters	
Q-311-N			METAL	S.G.		—	Poor	Good	Fair - Poor	—	intact, non-operable	—	Bad	—	littered	Metal	Bad	Good
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE Q				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet__of__				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

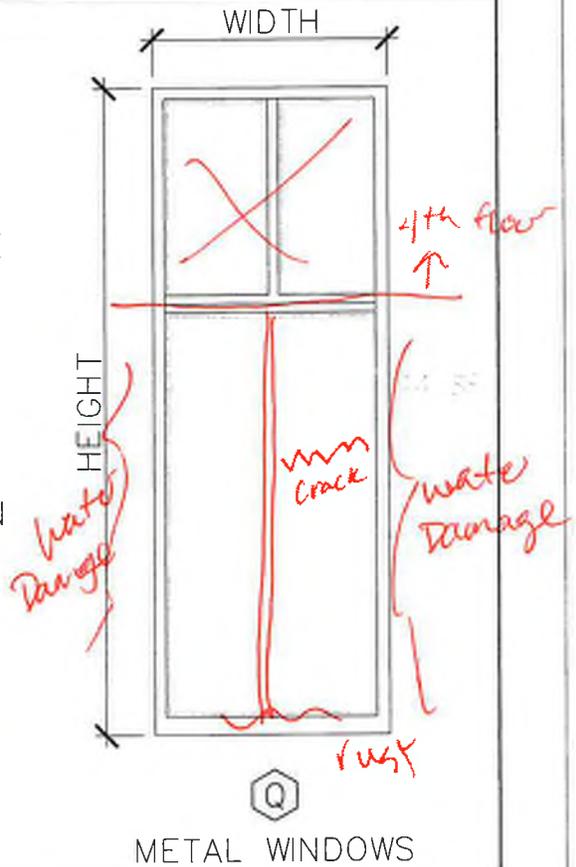

XREFS:

CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Wood Shutters
Q-312-N		Q	METAL	S.G.		—	Poor	Fair-Poor	Fair	—	Fair	—	Bad	—	Good	Bad	Good
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES											TYPE Q				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE											Sheet ___ of ___		
		121 E. DALLAS STREET CANTON, TEXAS 75103															

locks
Painted shut


Movers, but window does not open

Lime

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

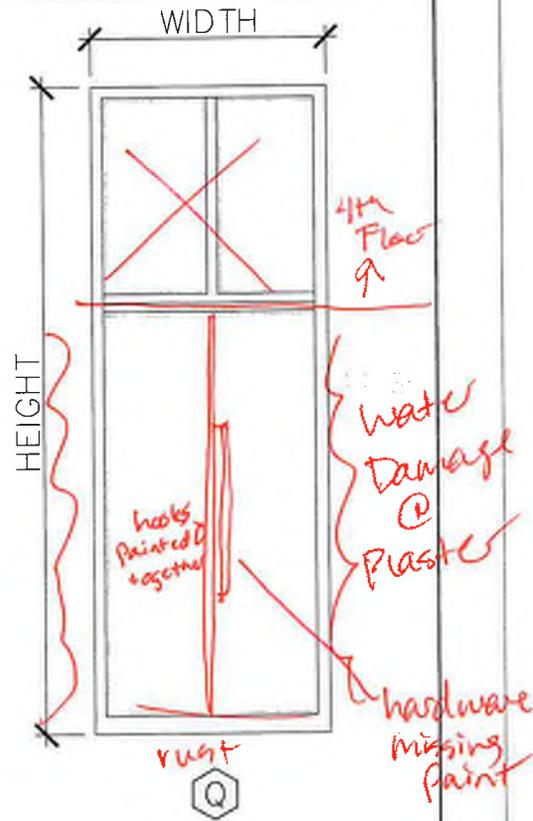

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES												
WINDOW NO. 313	Q	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	WOOD SHUTTERS		
Q-313-N		—	Poor - Fair	Good	Fair	—	Fair	—	Bad	—	Good	Bad	Good	
SCALE: 1/4" = 1'-0"	WINDOW SURVEY/WINDOW TYPES											TYPE Q		
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE												
		121 E. DALLAS STREET CANTON, TEXAS 75103											Sheet ___ of ___	

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

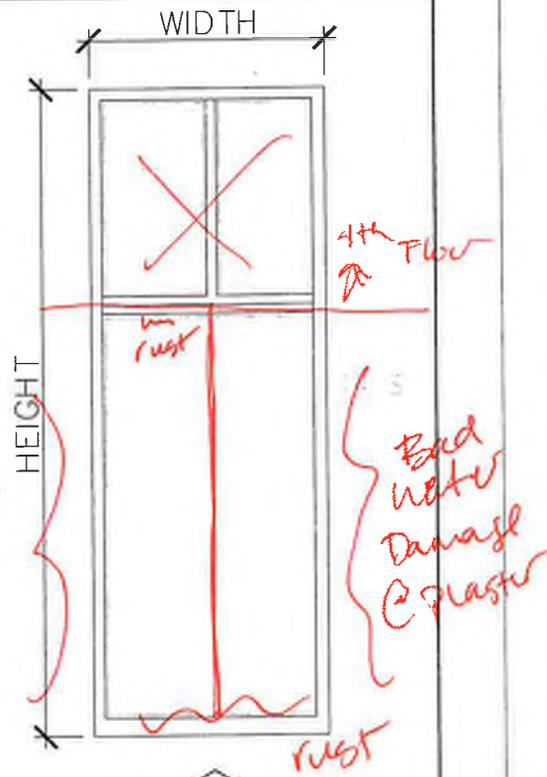

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO. 314	EXPOSURE	TYPE Q		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
Q-314-N									<i>Window does not open</i>				<i>Metal</i>								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE Q							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																	
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

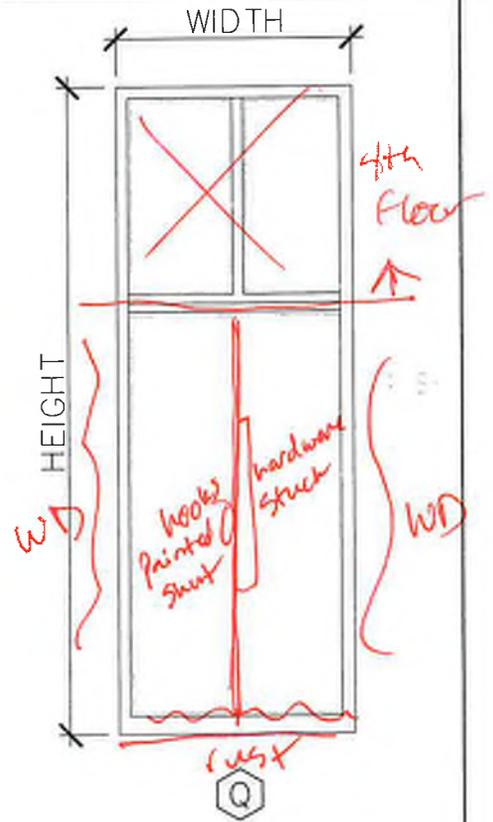

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW					SPECIFIC CONDITION NOTES												
WINDOW NO. 315	EXPOSURE	TYPE Q	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Wood shutters
Q-315-N			METAL	S.G.		—	Poor	Good	Fair	—	Fair - Poor	—	Bad	—	Good	Bad	Good
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES												
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE												
					121 E. DALLAS STREET CANTON, TEXAS 75103												
TYPE Q																	
Sheet ___ of ___																	

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

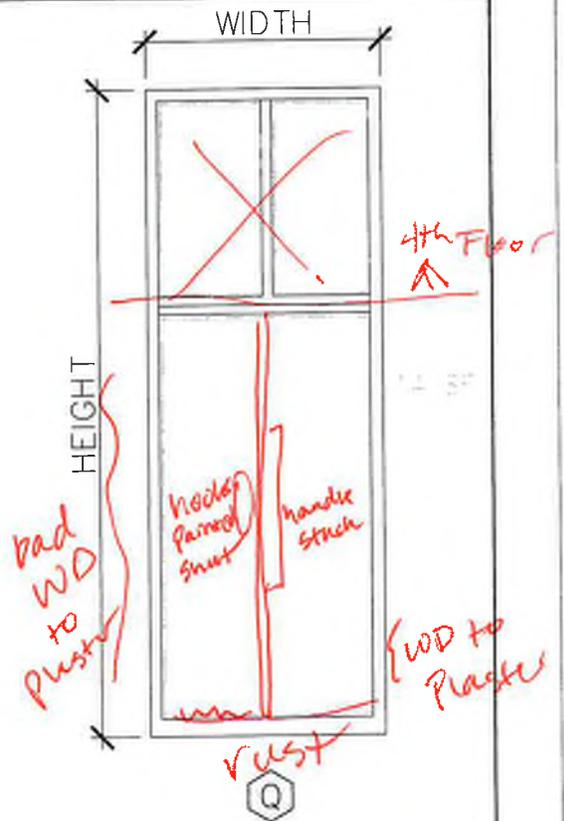

METAL WINDOWS


CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES																	
WINDOW NO. 317	Q	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	WOOD SHUTTERS	
Q-317-N				METAL	S.G.		—	Poor-Fair	Good	Fair-Poor	—	Fair-Poor	—	Bad	—	Good	Bad	Good-Fair	
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE Q							
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																	
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

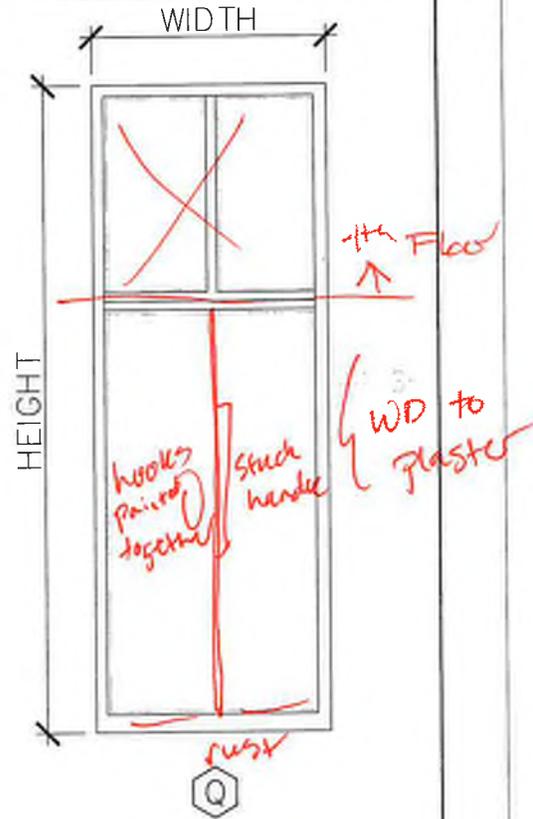

METAL WINDOWS

XREFS:

CLEAN/REPAINT

WINDOW						SPECIFIC CONDITION NOTES													
WINDOW NO. 319	EXPOSURE	TYPE Q	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	WOOD SHUTTERS		
Q-319-N			METAL	S.G.		—	Poor-Fair	Good	Fair	—	Fair-Poor	—	Bad	—	Good	Bad	Good		
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES										TYPE Q			
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE												Sheet ___ of ___	
						121 E. DALLAS STREET CANTON, TEXAS 75103													

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION



① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 320	EXPOSURE	TYPE N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-320-N		METAL	—	Fair	Good	Fair	—	Fair	—	Bad	Good	Good	Bad				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES															
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE															
		121 E. DALLAS STREET CANTON, TEXAS 75103															
		TYPE N															
		Sheet ___ of ___															

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

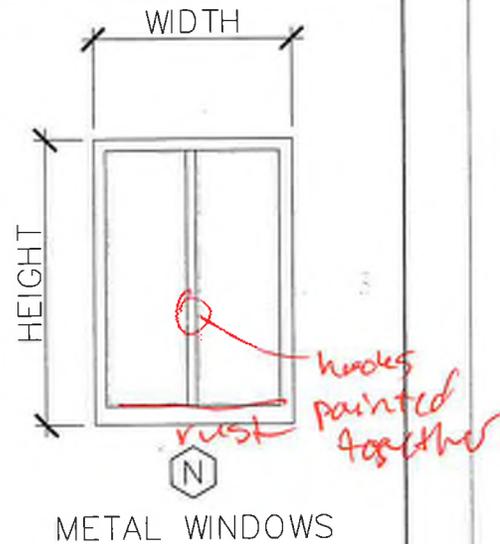

① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
N-322-W	322	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
			N	METAL	S.G.		—	Fair	Good	Fair	—	Fair	—	Bad	Good	Good	Bad				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE N							
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___							

For hooks painted together


hook painted together

rust

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

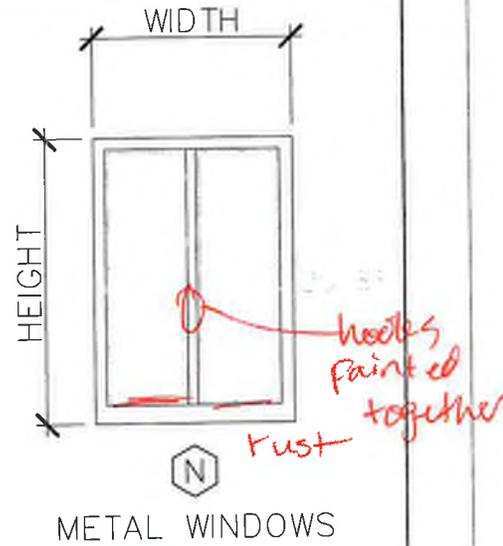

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																
WINDOW NO. 323	EXPOSURE	TYPE N	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
N-323-W			METAL	S.G.		—	Fair	Good	Fair-Poor	—	nooks painted together	—	Bad	Good	Good	Bad	F-G				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES										TYPE N						
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																
					121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

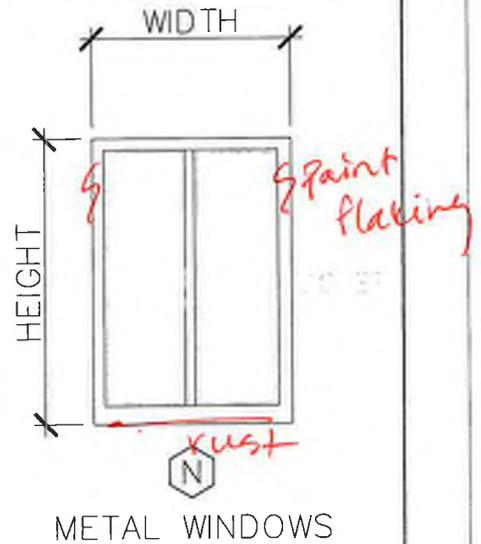

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO.	EXPOSURE	TYPE	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
N-324-W				—	Fair	Good-fair	Fair	—	Good	—	Bad	Good	Good	Bad	Good								
	METAL											lintex	Metal										
	S.G.																						
	OVERALL CONDITION																						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE N																			
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

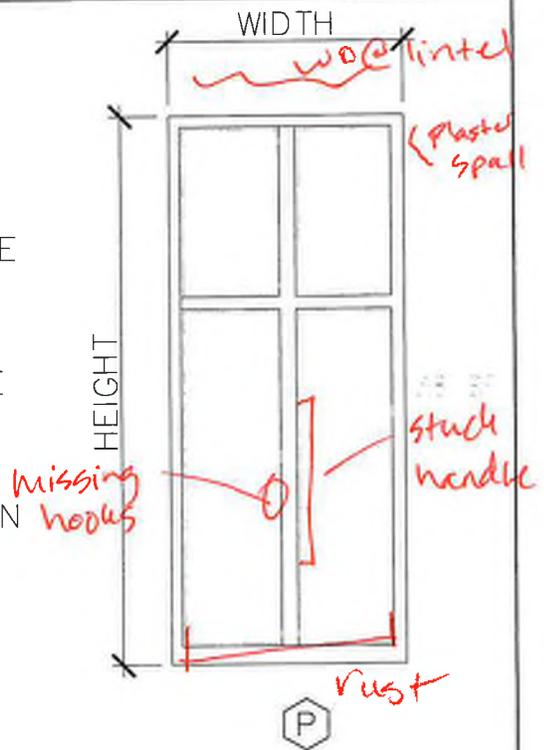

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																					
WINDOW NO. 326	P	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	evidence of Metal Blinds					
P-326-W				METAL	S.G.		—	Fair-Poor	Good	Fair	—	Fair - Bad	—	Bad	Poor	Good	Bad						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE P									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE												Sheet ___ of ___									
		121 E. DALLAS STREET CANTON, TEXAS 75103																					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

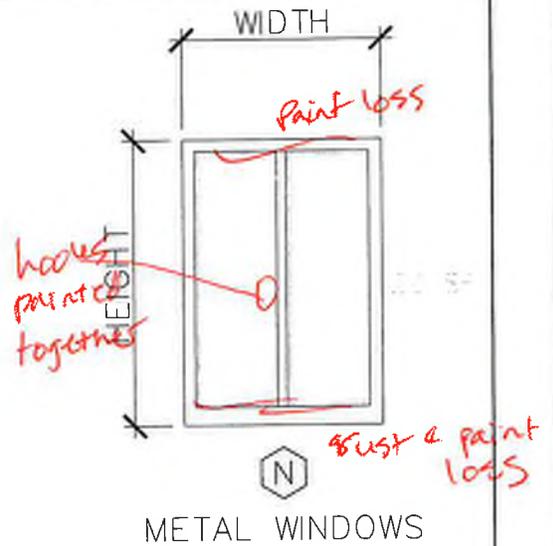

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 329	EXPOSURE	TYPE N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
N-329-W		METAL	—	Poor	Good	Fair	—	Fair	—	Bad	Good	Good	Bad	Good			
		S.G.									linref	metal					
		OVERALL CONDITION															
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES															
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE															
		121 E. DALLAS STREET CANTON, TEXAS 75103															
		TYPE N															
		Sheet ___ of ___															

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

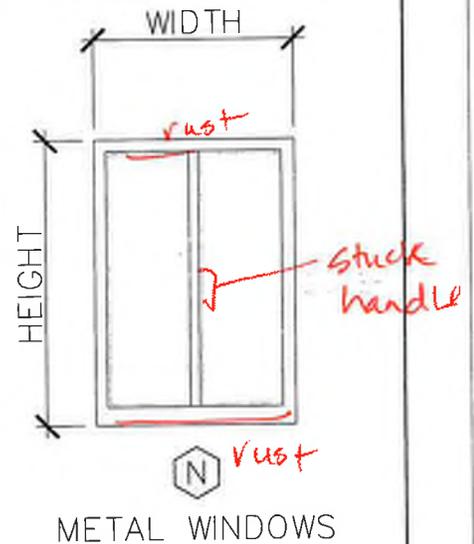


① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																	
WINDOW NO. 330	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds		
N- 330-S		N	METAL	S.G.		—	Poor-Fair	Good	Fair	—	Fair	—	Bad	Good	Fair	Bad	Fair	Metal Blinds - won't stay up	
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE N							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										Sheet ___ of ___					
 KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103																	

WOOD WINDOW RESTORATION ASSESSMENT CODING

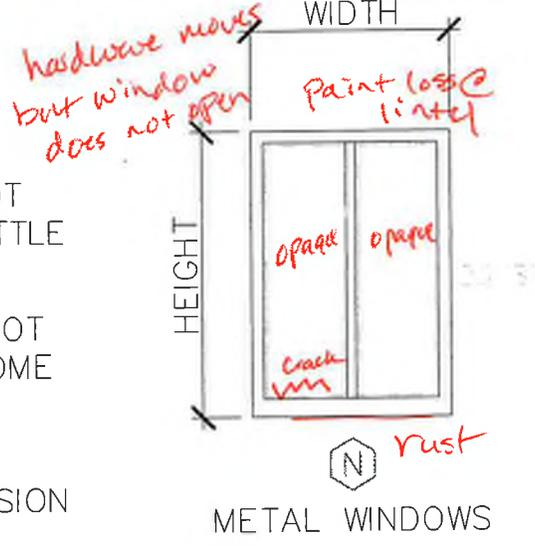

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES																	
N-332-S	WINDOW NO. 332	EXPOSURE	TYPE N	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds					
				METAL	S.G.		—	Fair-Poor	Poor-Bad	Fair	—	Fair	—	Bad	Good	Good-fair metal	Bad	Fair-	Good				
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
		KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																	
TYPE N																							
Sheet ___ of ___																							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

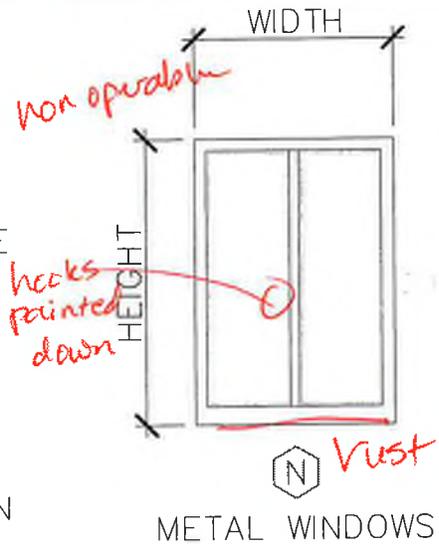

① CLEAN/REPAINT

* lots of pipes run in front of window

WINDOW						SPECIFIC CONDITION NOTES													
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds		
N-333-S		N	METAL	S.G.		—	Fair-Poor	Good	Fair	—	Fair	—	Bad	Good	Fair	Bad	Fair		

SCALE: 1/4" = 1'-0"

DATE:

JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE N

Sheet ___ of ___




KOMATSU
ARCHITECTURE

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

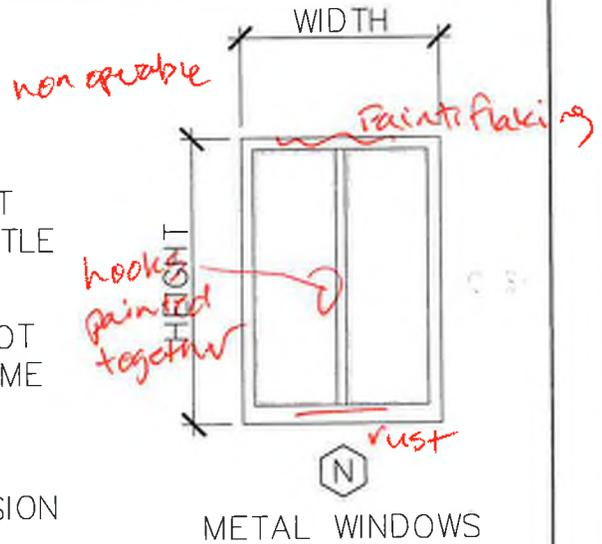

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																				
WINDOW NO. 334	EXPOSURE	TYPE	N																					
N-334-S				METAL	S.G.			EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal Blinds					
								—	Fair - floor	Good	Fair	—	Fair	—	Bad	Good	Fair	Bad	Good					
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																				
				TYPE N																				
				Sheet ___ of ___																				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

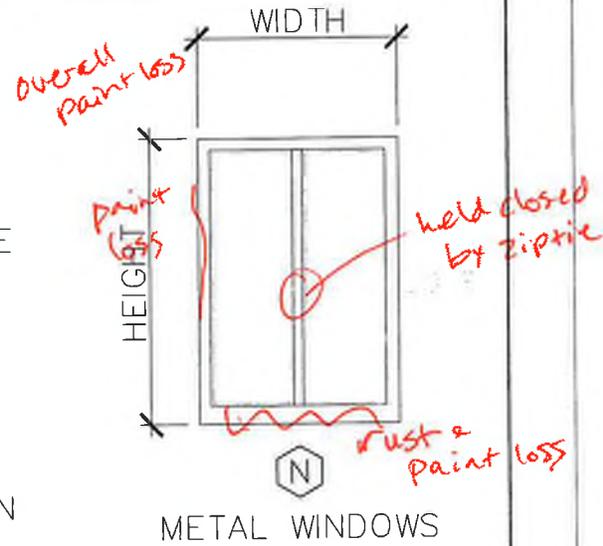

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES												
WINDOW NO. 335	EXPOSURE	TYPE N	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	evidence of binds
N-335-S			METAL	S.G.		—	Poor	Good	Poor	—	Fair-Poor	—	Bad	Fair	Fair	Bad	
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES												
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE												
					121 E. DALLAS STREET CANTON, TEXAS 75103												
TYPE N																	
Sheet ___ of ___																	

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

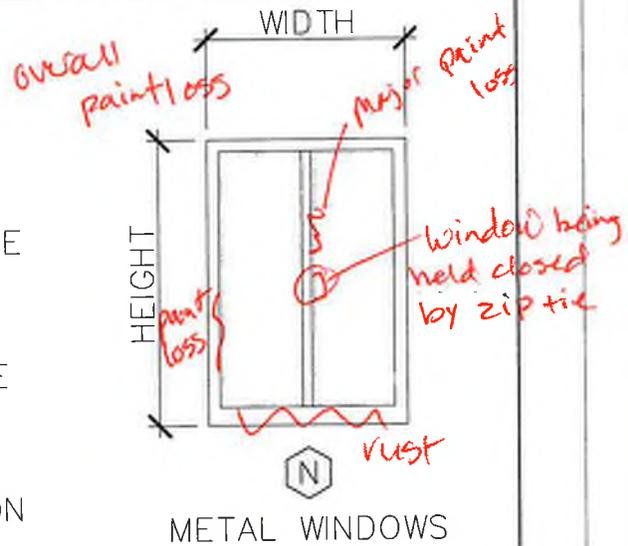

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES											
WINDOW NO. 336	N	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	evidence of blinds
N-336-S	METAL	—	Poor	Good	Poor	—	Fair - Poor	—	Bad	Fair - Good	Fair	Bad	
SCALE: 1/4" = 1'-0"	WINDOW SURVEY/WINDOW TYPES										TYPE N		
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE											
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___	

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

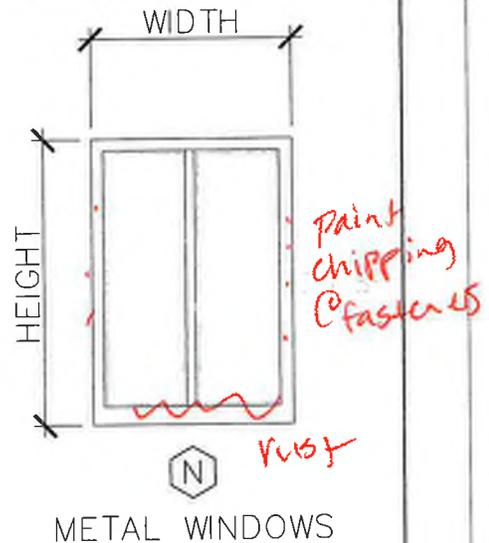

① CLEAN/REPAINT


WINDOW						SPECIFIC CONDITION NOTES												
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds	
N-338-S		N	METAL	S.G.		—	Poor	Good	Fair - Poor	—	Fair	—	Bad	Good	Fair	Bad	Fair	metal Blinds
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES												
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE												
						121 E. DALLAS STREET CANTON, TEXAS 75103												
TYPE N																		
Sheet ___ of ___																		

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

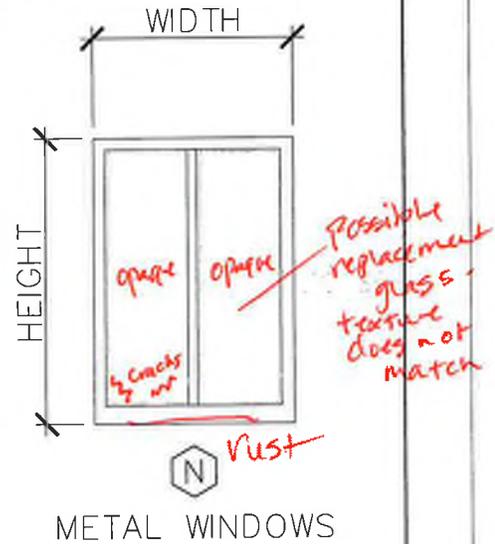

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES											
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Plastic blinds
N-339-S		N	METAL	S.G.		—	Poor	Poor - Bad	Fair - Poor	—	Fair	—	Bad	Good	good	Bad	
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES											
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE													
DATE:		JOB NO.: 2023.113		TYPE N													
						121 E. DALLAS STREET CANTON, TEXAS 75103 Sheet ___ of ___											

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

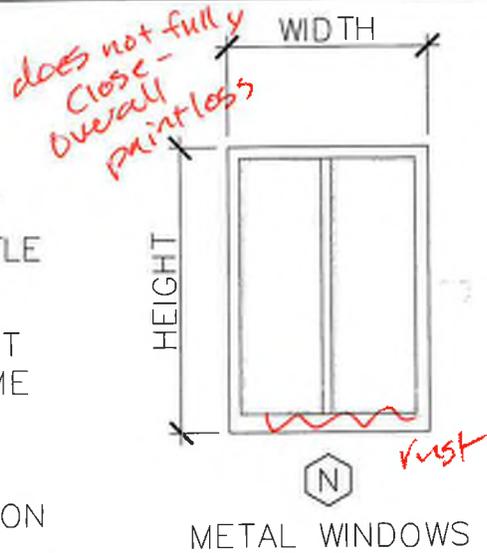

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
N-340-S		N	METAL	S.G.		—	Poor	Good	Fair-Poor	—	Fair	—	Bad	Fair	Poor	Bad	Poor				
														linnet	Metal		metal Blinds				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES										TYPE N						
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																
					121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

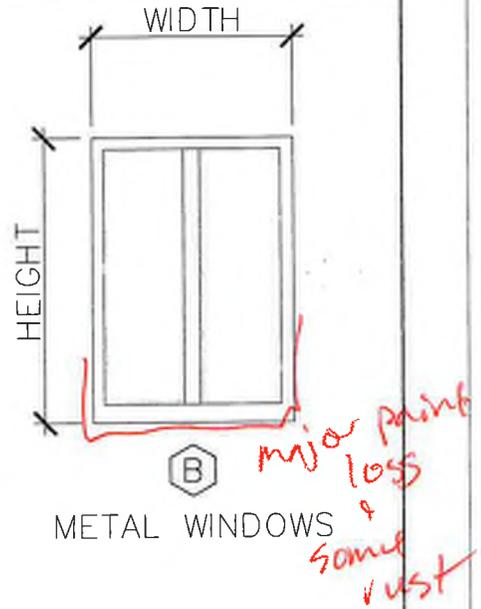

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 401	EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Blinds
B-401-E			METAL	S.G.		—	Poor	Good	Fair-Poor	—	Fail	—	Bad	lintel	Metal	Bad	F-P
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE B					
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE															
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

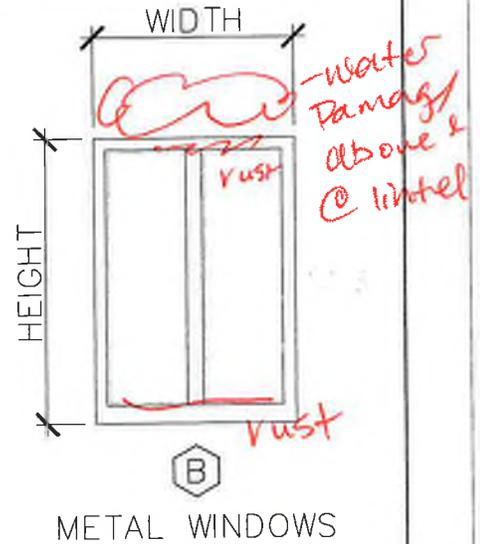

① CLEAN/REPAINT

XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 402																				
EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-402-E		METAL	S.G.		—	Poor	Gr-F	Poor	—	Fair	intact, can't tell if operable	Bad	Poor-Bad	metal	Bad					

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE B


Sheet ___ of ___

KOMATSU ARCHITECTURE

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

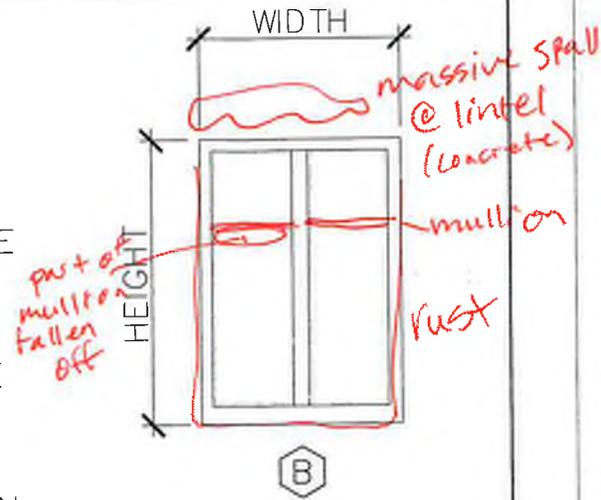

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 403																						
EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-403-E		METAL	S.G.		—	Bad	Good-fair	Poor	—	Fail	—	Bad	Bad	Poor	Bad							
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE B								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

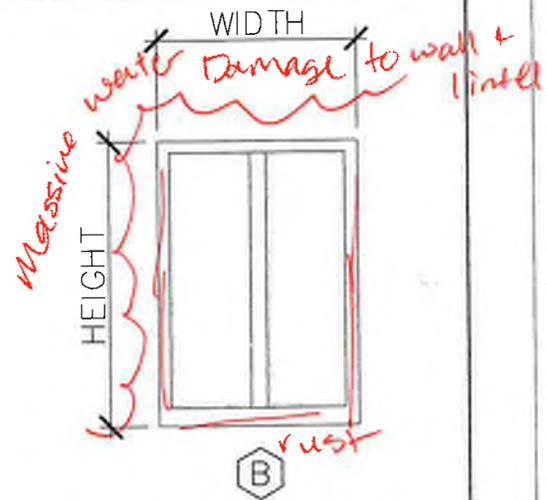

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES															
WINDOW NO. 404	EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
B-404-E			METAL	S.G.		—	Poor	Good	Poor	—	Good-Fair	—	Bad	Bad	Fair-Poor Metal	Bad				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE															
					121 E. DALLAS STREET CANTON, TEXAS 75103															
															TYPE B					
															Sheet ___ of ___					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

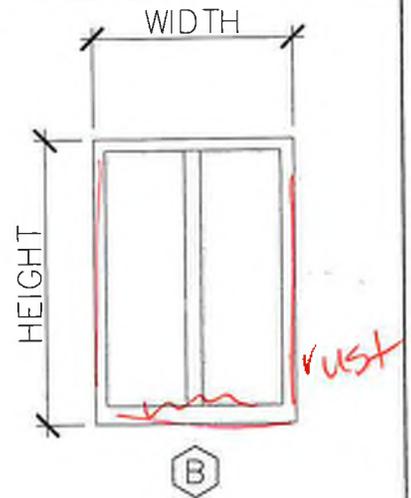

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																		
WINDOW NO. 405	EXPOSURE	TYPE	B	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
B-405-E		METAL		—	Poor	Good	Poor	—	intact & operable Fair/Good	—	Bad	Good	Poor-Fair metal	Bad								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY / WINDOW TYPES																		
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																		
				121 E. DALLAS STREET CANTON, TEXAS 75103																		
				TYPE B																		
				Sheet ___ of ___																		

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

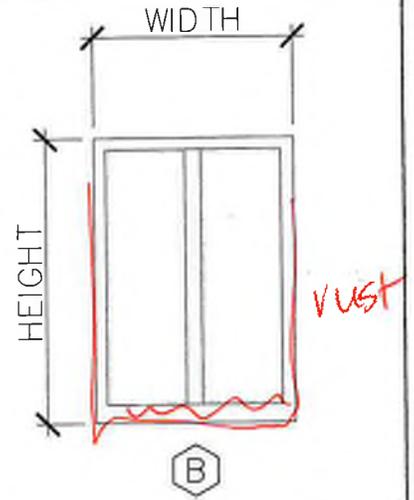

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																			
WINDOW NO. 406	B	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
B-406-E				METAL	S.G.		—	Poor	Good	Fair - Poor	—	Fair - Good	—	Bad	Good	Fair	Bad				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE B							
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

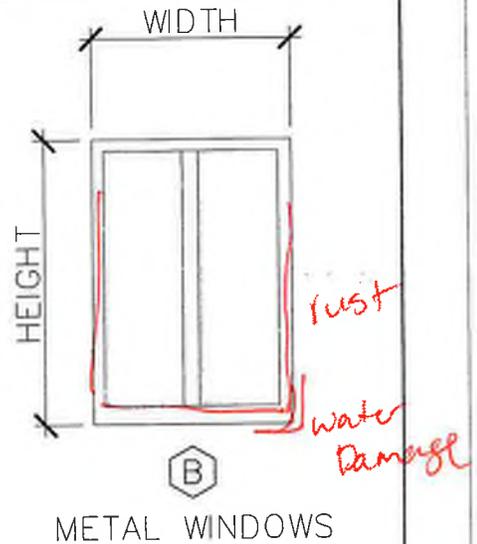

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO. 407	EXPOSURE	TYPE	B	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-407-E		METAL		—	Poor	Good	Poor	—	Fair	—	Bad	Fair	Fair-Poor metal	Bad							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE B							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																	
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

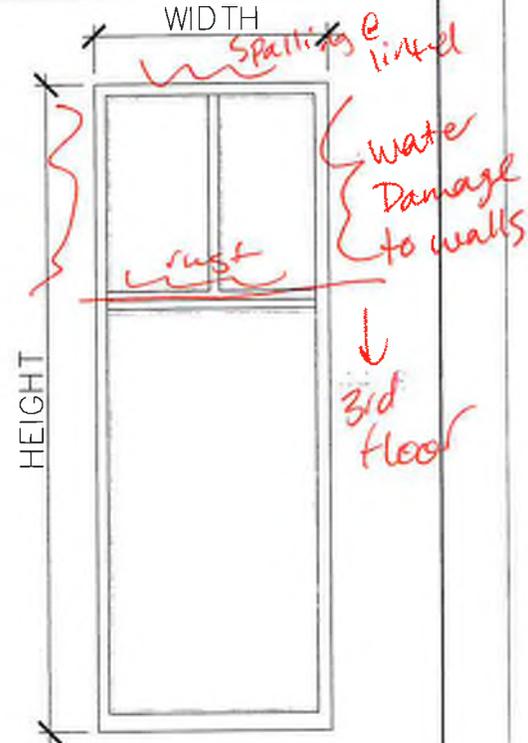

METAL WINDOWS

XREFS:


LEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																			
Q-408-N	(ABOVE 311)	WINDOW NO. 408	Q	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	PERIMETER SEALANT					
						METAL	S.G.		—	Poor	Good	F-P	—	N/A	—	Bad	Poor	Fail	Bad	Good			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE Q																			
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

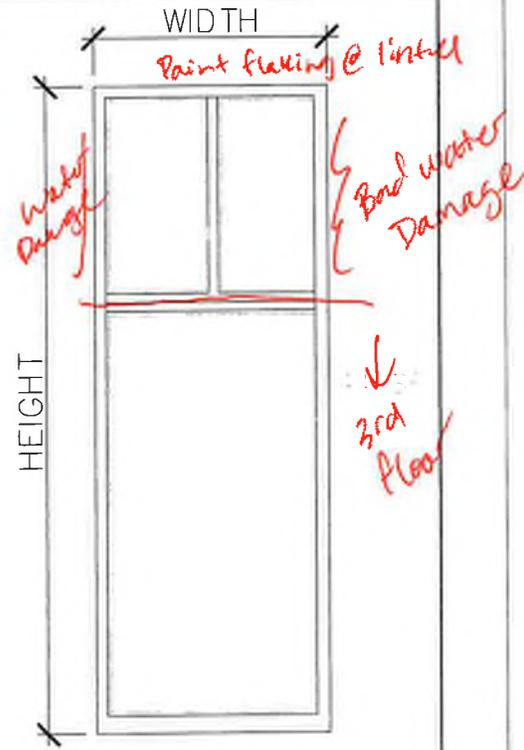

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																				
Q-409-N	(ABOVE 312)	WINDOW NO. 409	Q	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Wood Shutters				
				METAL		S.G.			—	Poor	Good	Fair-P	—	N/A	—	Bad	Fair	F-P	Bad	Good				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
				121 E. DALLAS STREET CANTON, TEXAS 75103																				
				TYPE Q																				
				Sheet ___ of ___																				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

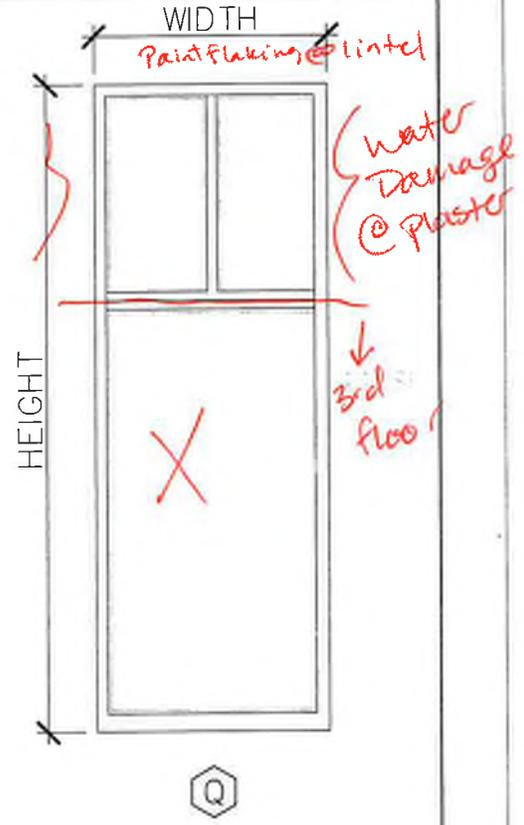

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES																
Q-410-N	410	(ABOVE 313)	WINDOW NO.	EXPOSURE	TYPE	Q	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Wood shutters
							—	Poor	Good	Fair	—	N/A	—	Bad	F	G-F	Bad	Good
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES											TYPE Q					
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																
		121 E. DALLAS STREET CANTON, TEXAS 75103											Sheet ___ of ___					

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

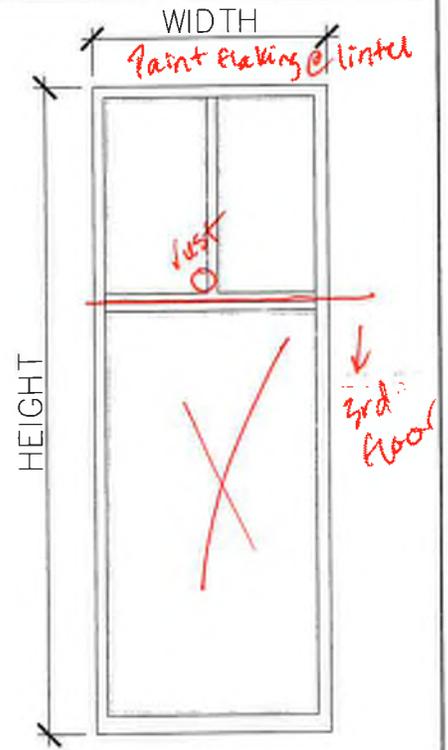

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES																		
Q-411-N	(ABOVE 314)	WINDOW NO. 411	Q	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	WOOD SHUTTERS		
				METAL		S.G.			—	Poor	Good	Fair-Poor	—	N/A	—	Bad		Fair-Poor	Bad	Good		
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												TYPE Q						
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																		
				121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

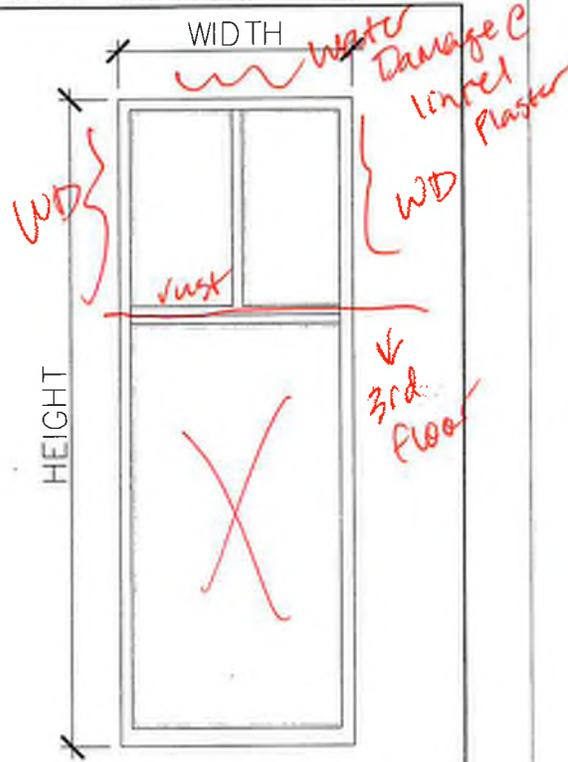

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES																								
Q-412-N	(ABOVE 315) WINDOW NO. 412	EXPOSURE	TYPE Q																							
METAL		FRAME MATERIAL		EXTERIOR FINISH		INTERIOR FINISH		GLASS		FRAME		SASHES		HARDWARE		GLAZING MATERIAL		WEATHERSTRIPPING		SUPPORT MATERIAL		SILL		PERIMETER SEALANT		Wood shutters
S.G.		GLAZING MATERIAL		—		Poor		Good		Fair		—		N/A		—		Bad		Fair-Poor		metal		Bad		Good
		OVERALL CONDITION																								
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE Q												
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																								
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___												

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

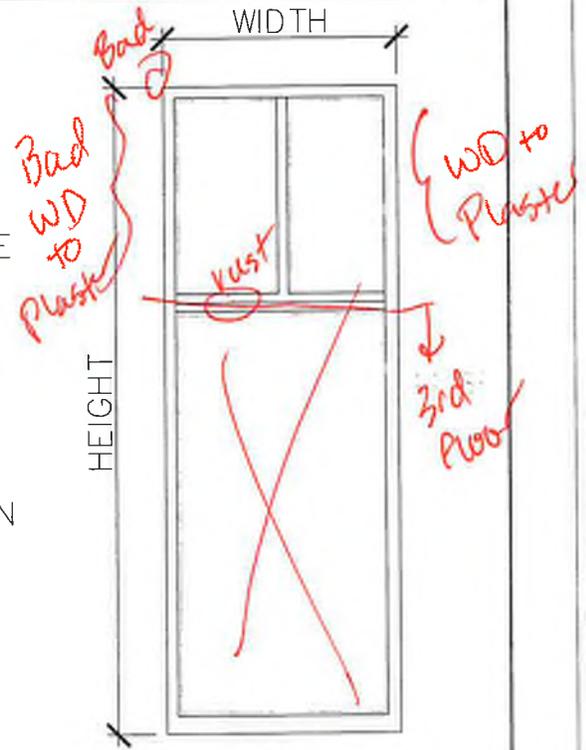

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES																
Q-413-N	(ABOVE 316) WINDOW NO. 413	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Wood Shutters
			Q	METAL	S.G.		—	Poor	Good	Fair-Poor	—	N/A	—	Bad	Poor	Poor	Bad	Good
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE Q						
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE										Sheet ___ of ___				
		121 E. DALLAS STREET CANTON, TEXAS 75103																

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

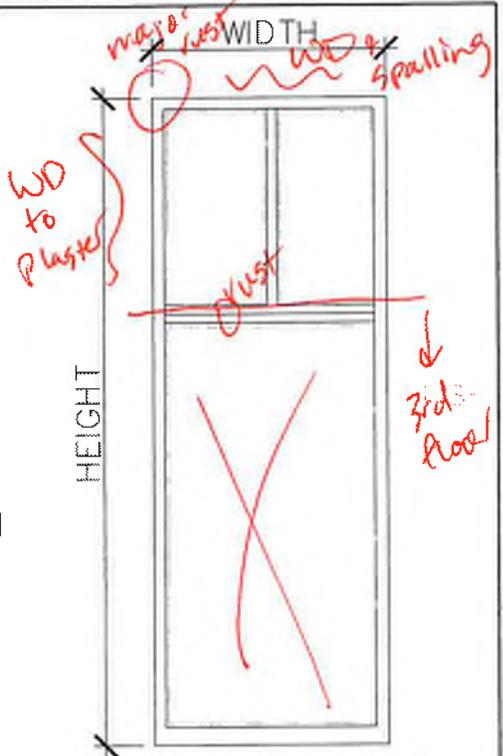

METAL WINDOWS

XREFS:


CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES																
Q-414-N	(ABOVE 317) WINDOW NO. 414	EXPOSURE	TYPE Q	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	WOOD SHUTTERS
		METAL		S.G.			—	Fair-Poor	Good	Fair	—	N/A	—	Bad	Poor-Bad (lined)	Fair metal	Bad	Good-fair
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												TYPE Q		
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

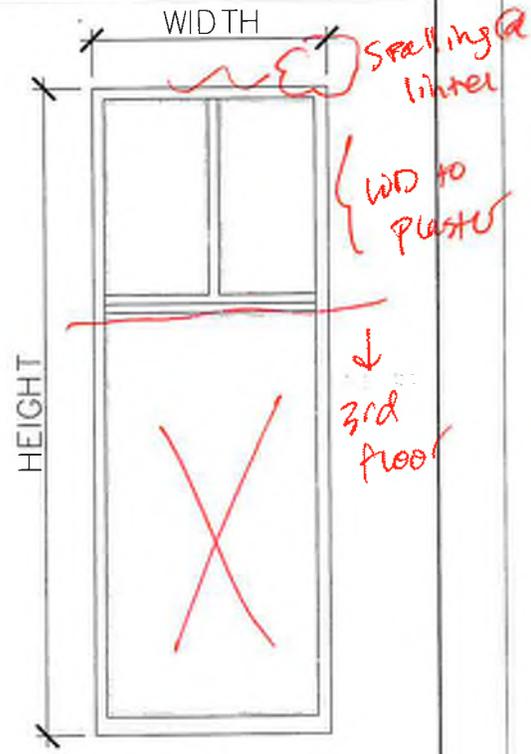

METAL WINDOWS

XREFS:

CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																					
416	(ABOVE 319) WINDOW NO. 416	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
Q-416-N			Q	METAL	S.G.		—	Fair	Good	Fair	—	N/A	—	Bad	Poor-Bad	linnet	Metal	Bad	Good				
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE Q									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																					
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___									

~~Metal~~ Wood Shutters

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

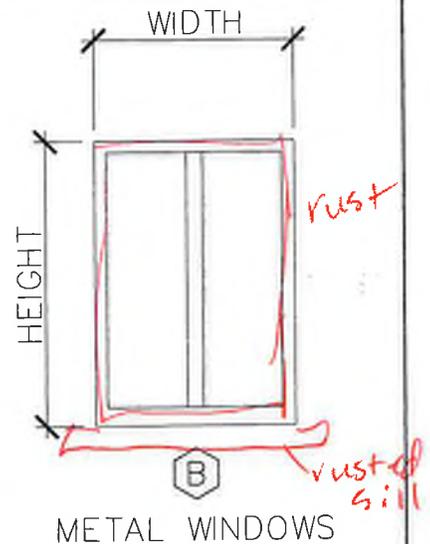

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 417																						
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-417-W	B	METAL	S.G.		—	Poor	Good	Fair-Poor	—	Good	—	Bad	Good	Poor	Bad							
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE B								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

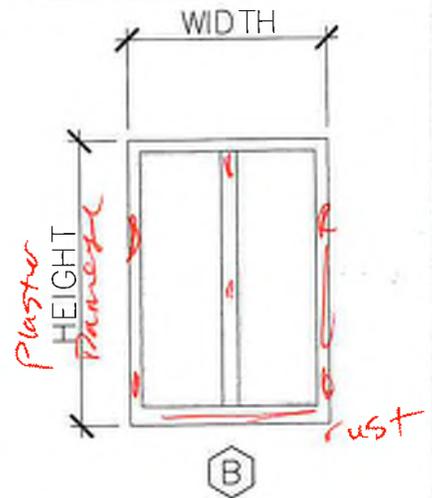

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES											
WINDOW NO. 418	EXPOSURE												
	TYPE	B											
	FRAME MATERIAL	METAL											
	GLAZING MATERIAL	S.G.											
	OVERALL CONDITION	—											
	EXTERIOR FINISH	Poor											
	INTERIOR FINISH	Good											
	GLASS	Fair - Poor											
	FRAME	—											
	SASHES	non-operable											
	HARDWARE	Fair											
	GLAZING MATERIAL	—											
	WEATHERSTRIPPING	Bad											
	SUPPORT MATERIAL	Good											
	SILL	Fair											
	PERIMETER SEALANT	Bad											
SCALE: 1/4" = 1'-0"		WINDOW SURVEY / WINDOW TYPES										TYPE B	
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE											
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___	

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

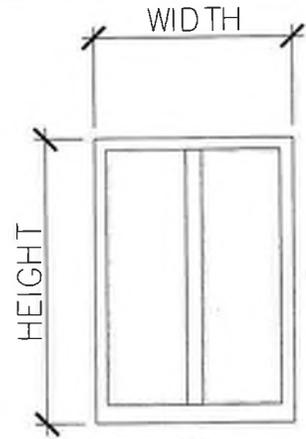

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 419	EXPOSURE	TYPE	B																				
B-419-S	METAL	S.G.		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE B Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

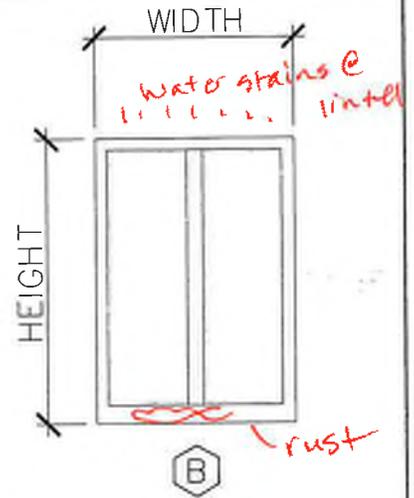

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES												
WINDOW NO. 420	EXPOSURE	TYPE B		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	interior green intact	metal blinds
B-420-S		METAL	S.G.	—	Poor	Good	Fair-Poor	—	Good	—	Bad	Good	Fair-Poor	Bad		Good
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES												
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE												
				121 E. DALLAS STREET CANTON, TEXAS 75103												
TYPE B																
Sheet ___ of ___																

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

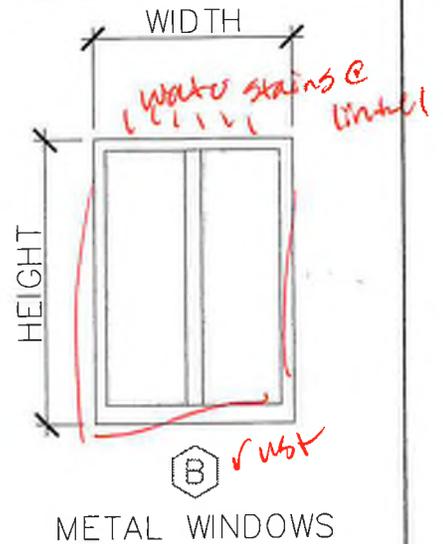

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 421	B	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
B-421-S				METAL	S.G.		—	Poor	Good	Fair-Poor	—	Intact	—	Bad	Good	Fair	Bad			
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE B								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

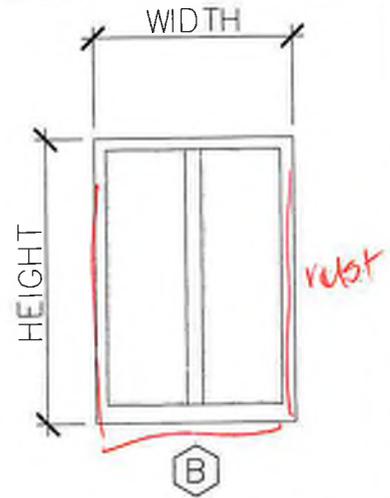

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES															
WINDOW NO. 422	EXPOSURE	TYPE B		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-422-S		METAL	S.G.	—	Poor	Good	Fair-Poor	—	Good	—	Bad	Good	Fair-Poor	Bad	Good				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE															
				121 E. DALLAS STREET CANTON, TEXAS 75103															
				TYPE B															
				Sheet ___ of ___															

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

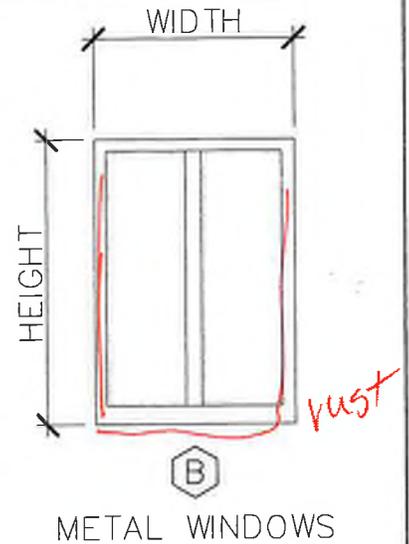

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES														
WINDOW NO. 423	EXPOSURE	TYPE B		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
B-423-S		METAL	S.G.															
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES														
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE														
				121 E. DALLAS STREET CANTON, TEXAS 75103														
				TYPE B														
				Sheet ___ of ___														

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

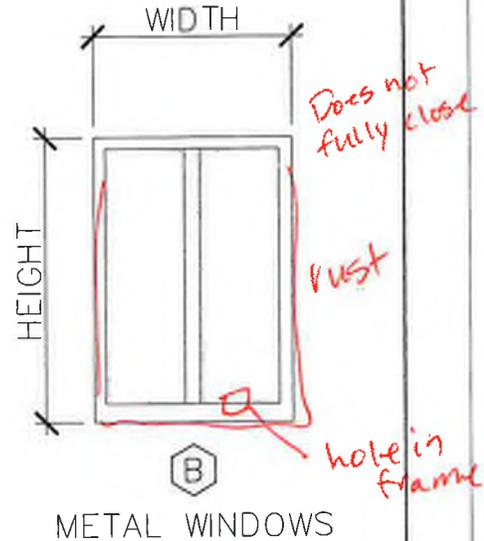

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																
424		B																			
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-424-S			METAL	S.G.		—	Poor	Good	Poor	—	Fair	—	Bad	Good	Fair-Poor metal	Bad	Good				
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES																
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE										TYPE B						
					121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___				

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

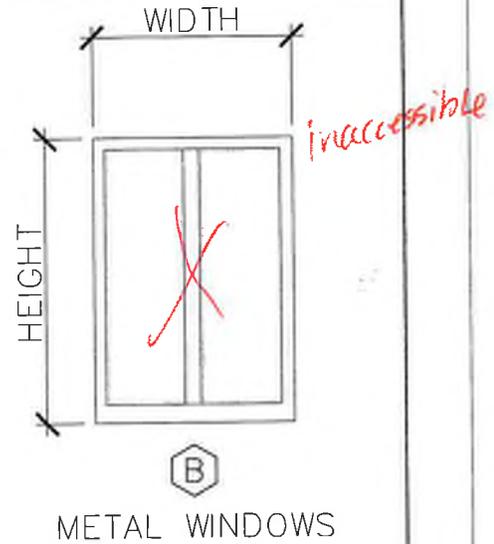

① CLEAN/REPAINT

XREFS:


WINDOW		SPECIFIC CONDITION NOTES																					
WINDOW NO. 426	B																						
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
B-426-S		METAL	S.G.																				
SCALE: 1/4" = 1'-0"																WINDOW SURVEY/WINDOW TYPES							
DATE:		JOB NO.: 2023,113				VAN ZANDT COUNTY COURTHOUSE												TYPE B					
		KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___					

Fry
Plastic
Blinds

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

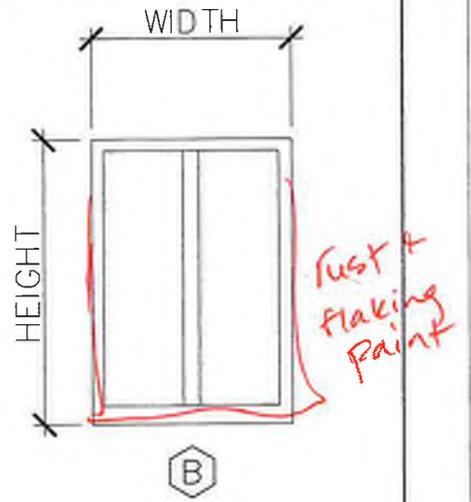

METAL WINDOWS

① CLEAN/REPAINT

rust & flaking paint
opens, but not fully, does not fully close

XREFS:

WINDOW						SPECIFIC CONDITION NOTES											
WINDOW NO.	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Plastic Blinds
B-427-S		B	METAL	S.G.		—	Poor	Good	Fair-Poor	—	Fair	—	Bad	Good	Fair	Bad	

SCALE: 1/4" = 1'-0"

DATE:

JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

TYPE B

121 E. DALLAS STREET
CANTON, TEXAS 75103

Sheet ___ of ___




KOMATSU
ARCHITECTURE

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

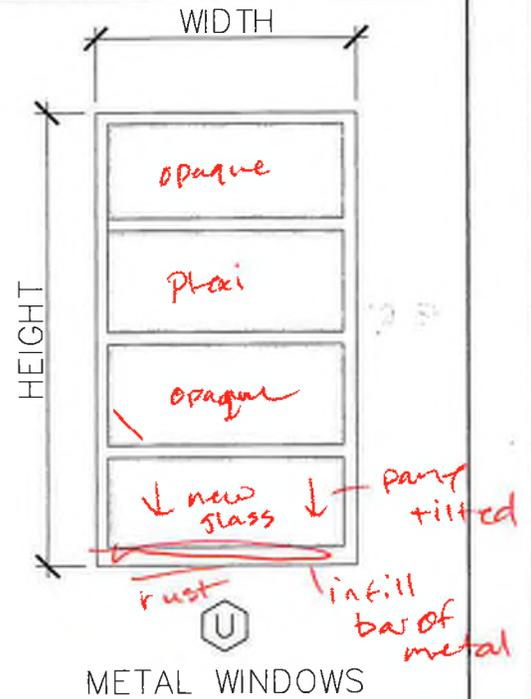

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO. 501	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	non-operable HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
U-501-E				—	Poor - Bad	Bad	Fair - Poor	—	Fair	—	Bad	Good	Good	Bad							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										<h2 style="margin: 0;">TYPE U</h2> <p style="margin: 0;">Sheet ___ of ___</p>							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103																	
KOMATSU ARCHITECTURE				VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103																	

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

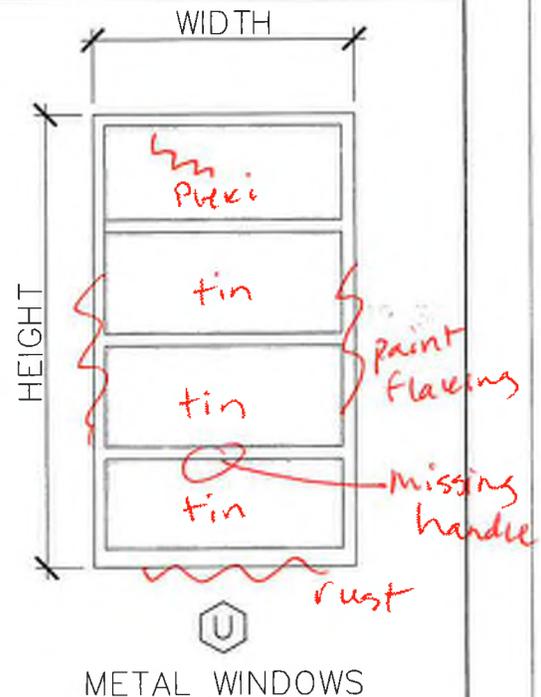

METAL WINDOWS

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																	
WINDOW NO.	EXPOSURE	TYPE		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
U-502-E		U		—	Poor-Bad	Bad	Poor	—	Bad	—	Bad	Good	Good	Bad							
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES										TYPE U							
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																	
				121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet__of__							

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

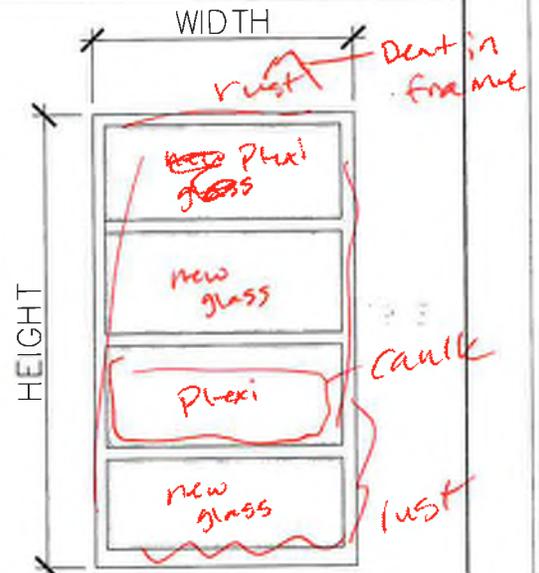

METAL WINDOWS

① CLEAN/REPAINT

WINDOW					SPECIFIC CONDITION NOTES																		
WINDOW NO. 503	EXPOSURE	TYPE U	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
U-503-E			METAL	S.G.		—	Poor	Bad	Poor	—	—	—	Bad	Good	Good	Bad							

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

TYPE U




121 E. DALLAS STREET
CANTON, TEXAS 75103

Sheet ___ of ___

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

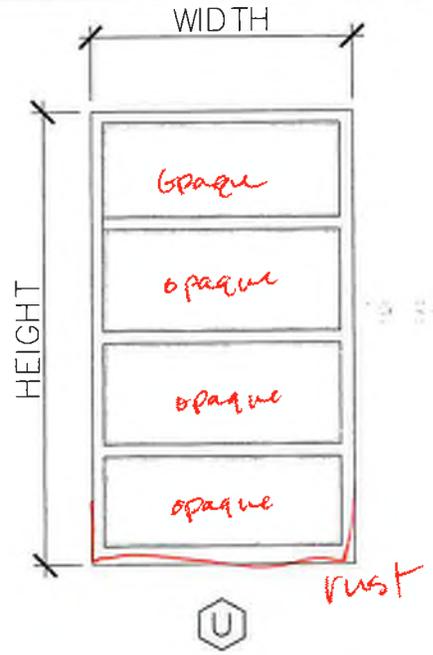

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO.	504	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
U-504-E	U	—	Poor	Good-Fair	Poor-Fair	—	—	Bad	Good	Fair	Bad						
EXPOSURE		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
FRAME MATERIAL	METAL	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
GLAZING MATERIAL	S.G.	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
OVERALL CONDITION		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE U					
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE										Sheet ___ of ___					
		121 E. DALLAS STREET CANTON, TEXAS 75103															

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

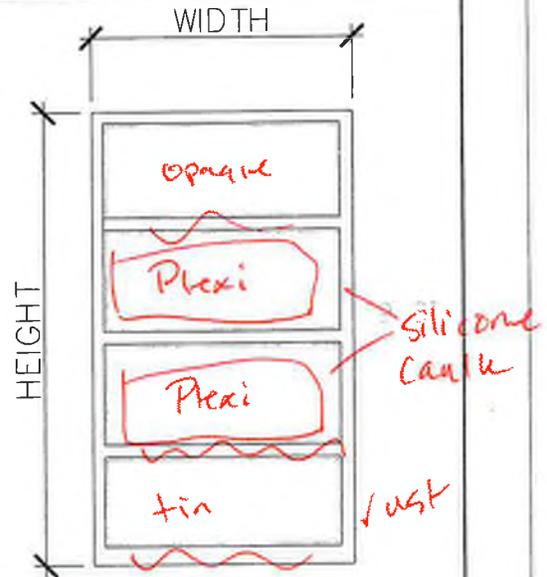

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW					SPECIFIC CONDITION NOTES																
WINDOW NO. 505	EXPOSURE	TYPE U	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	non operating hardware	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
U-505-E			METAL	S.G.		—	Poor	Bad	F-P	—	F-P	—	Bad	Good	Fair	Bad					
SCALE: 1/4" = 1'-0"					WINDOW SURVEY/WINDOW TYPES																
DATE:		JOB NO.: 2023.113			VAN ZANDT COUNTY COURTHOUSE																
					121 E. DALLAS STREET CANTON, TEXAS 75103																
															TYPE U						
															Sheet__of__						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

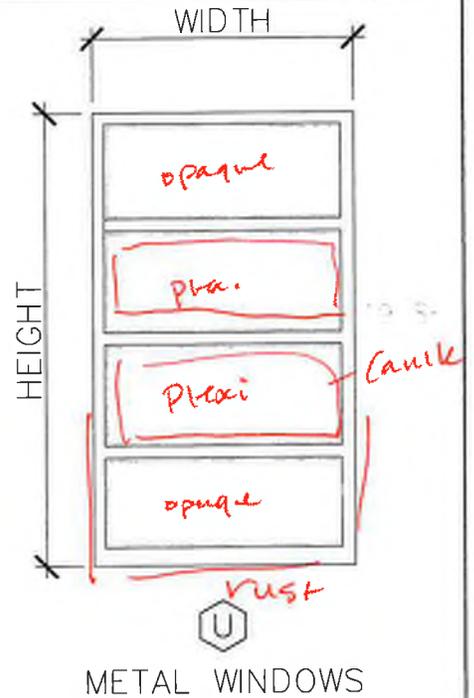

① CLEAN/REPAINT

WINDOW				SPECIFIC CONDITION NOTES															
WINDOW NO. 506	EXPOSURE	TYPE U	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
U-506-E		METAL	S.G.	—	Poor	Bad	F-P	—	Fair	Bad	Good	Good	Bad						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE															
				121 E. DALLAS STREET CANTON, TEXAS 75103															
														TYPE U					
														Sheet ___ of ___					


XREFS:

WINDOW NO. 507

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

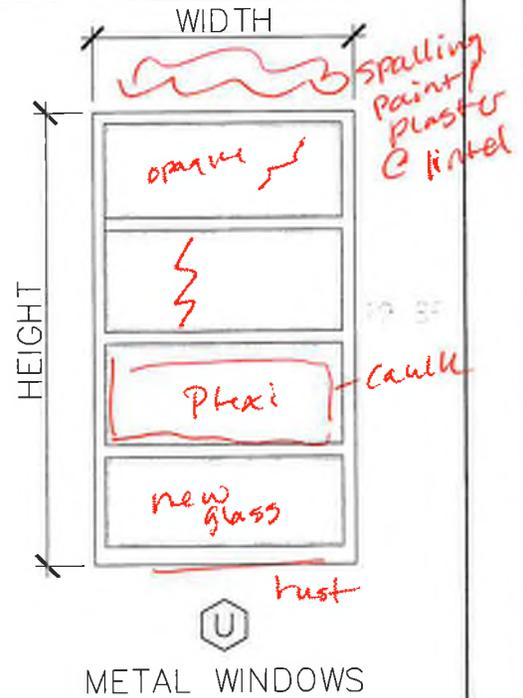

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																				
WINDOW NO.	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	non-operable	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
U-507-E		METAL			Poor	Bad	Poor		Fair		Bad	Poor	Good	Bad										
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																				
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																				
				121 E. DALLAS STREET CANTON, TEXAS 75103																				
				TYPE U																				
				Sheet ___ of ___																				

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

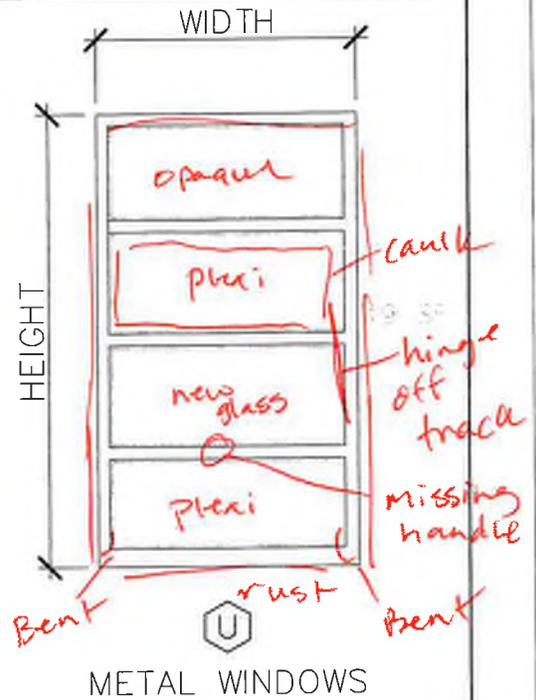

METAL WINDOWS

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES															
508	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
U-508-E		METAL	S.G.	—	Poor	Bad	Poor	—	Bad	—	Bad	Good	Fair	Bad			
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES															
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE										TYPE U					
KOMATSU ARCHITECTURE		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___					

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

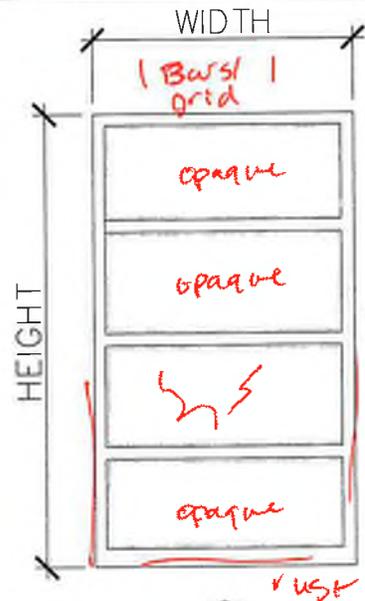

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO.	EXPOSURE	TYPE	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
U-509-N				—	Poor	Bad-Poor	Poor	—	Fair	—	Bad	Fair	F-P	Bad									
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE U																			
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

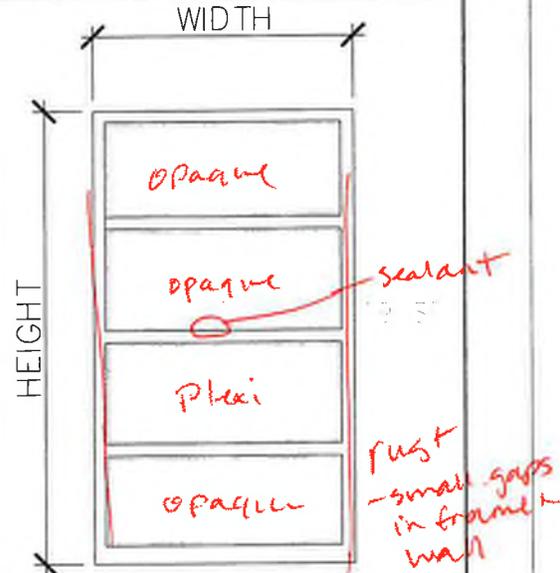

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 510	U	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	operable & hardware intact	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
U-510-N			METAL	S.G.		—	Bad	Bad-Poor	Poor	—	Fair	—	Bad	Fair	Fair	Bad						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE														TYPE U						
		121 E. DALLAS STREET CANTON, TEXAS 75103														Sheet ___ of ___						

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

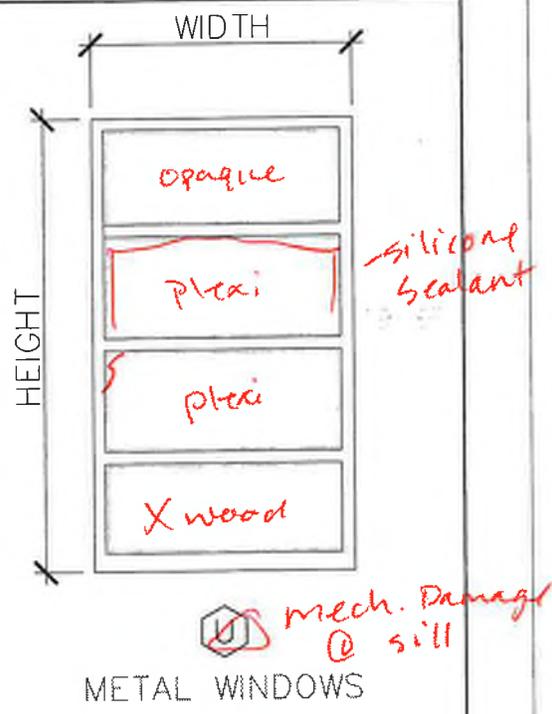

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																		
WINDOW NO. 511	EXPOSURE	TYPE U		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT								
U-511-N				—	Poor	Bad	Poor	—	Fair	—	Bad	Fair	Fair-Poor	Bad								
SCALE: 1/4" = 1'-0"			WINDOW SURVEY/WINDOW TYPES												TYPE U							
DATE:		JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																			
			121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___							

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

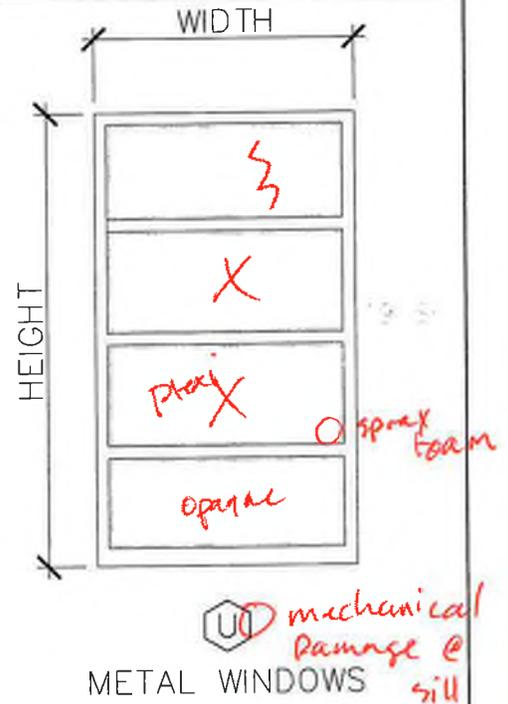

① CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 512	U	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT
U-512-N				METAL	S.G.		—	Poor	Bad	Poor	—	Fair	—	Bad	Good	Fair-Poor	Bad
												intact, operable			linings	tile	

SCALE: 1/4" = 1'-0"

DATE: _____ JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE U

Sheet ___ of ___


KOMATSU ARCHITECTURE

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

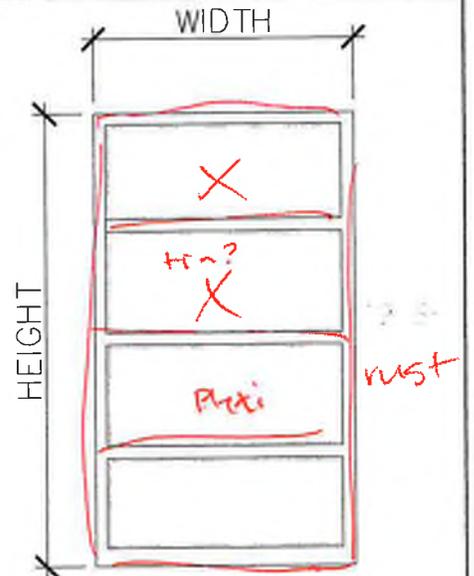

METAL WINDOWS

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 514	U																			
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
U-514-N		METAL	S.G.		—	Poor	Bad	F-P	—	Fair	—	Bad	Good	Fair-Poor	Bad					
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE U								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

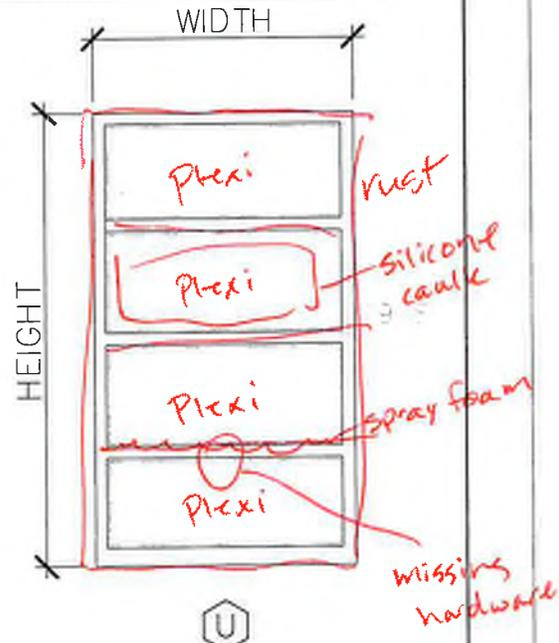

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW						SPECIFIC CONDITION NOTES																	
WINDOW NO. 515	EXPOSURE	TYPE U	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
U-515-N			METAL	S.G.		—	Poor	Bad Plexi	Poor	—	Bad missing	—	Bad	Good	Fair-Poor file	Bad							
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
						121 E. DALLAS STREET CANTON, TEXAS 75103																	
TYPE U																							
Sheet ___ of ___																							

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

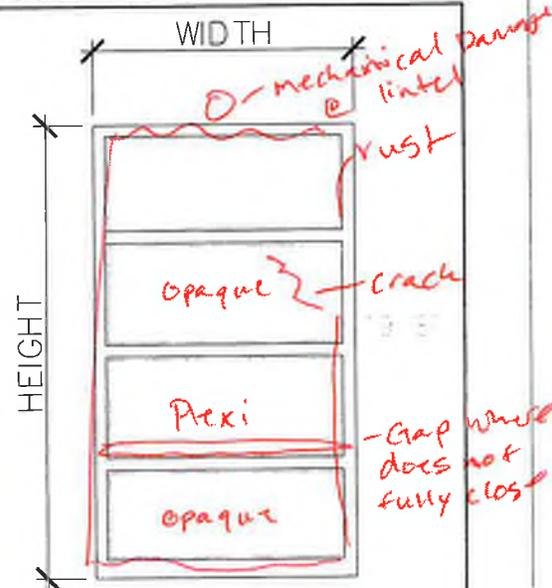

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																
WINDOW NO. 516	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
U-516-N	North	-	Poor	Poor-Bad	Poor	-	Poor	-	Bad	Fair	Fair	Bad						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																
		121 E. DALLAS STREET CANTON, TEXAS 75103																
		TYPE U																
		Sheet__of__																

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

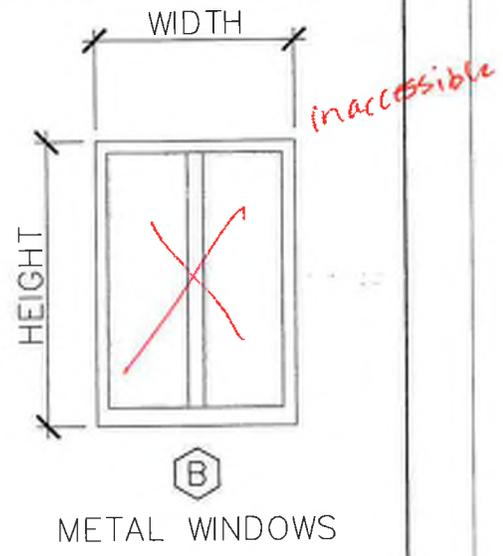

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 517	EXPOSURE	TYPE	B																				
FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
METAL	S.G.																						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE B																			
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

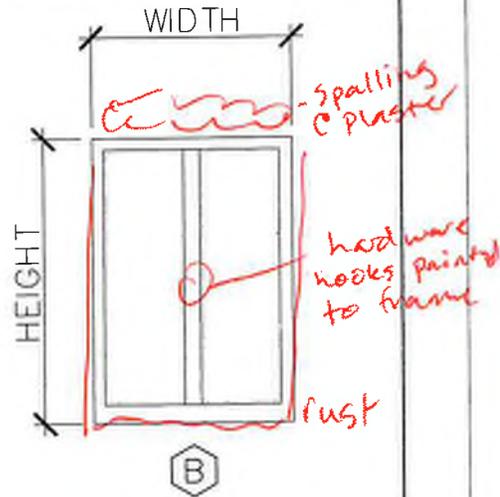

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 518	B	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	SEALANT					
B-518-N	North	—	Fair	Good	F-P	—	Fair	—	Bad	Poor	Poor	Bad					
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION													
		METAL	S.G.														
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE B					
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE										Sheet ___ of ___					
		121 E. DALLAS STREET CANTON, TEXAS 75103															

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

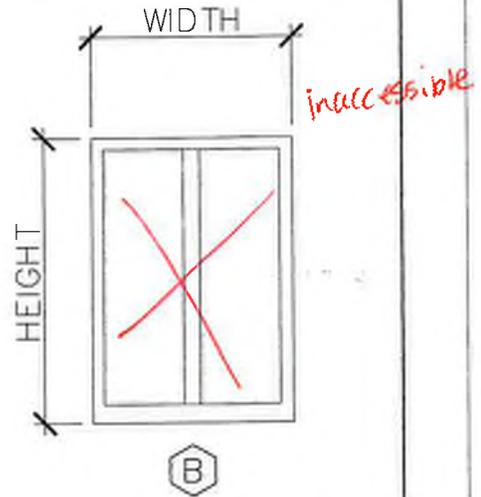

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 519	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
B-519-N			METAL	S.G.							<i>looks intact</i>											
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES						TYPE B										
DATE:		JOB NO: 2023.113				VAN ZANDT COUNTY COURTHOUSE																
						121 E. DALLAS STREET CANTON, TEXAS 75103						Sheet ___ of ___										

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

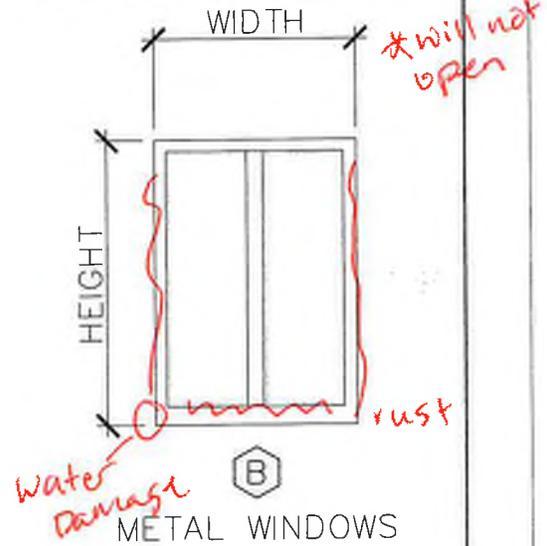

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																
B-521-W	521	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal blinds
West	B			METAL	S.G.		—	Fair-Poor Paint	Good	Poor	—	Poor/fair	—	Bad	Fair	Fair	Bad	Good
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES																
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE												TYPE B				
		121 E. DALLAS STREET CANTON, TEXAS 75103													Sheet ___ of ___			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

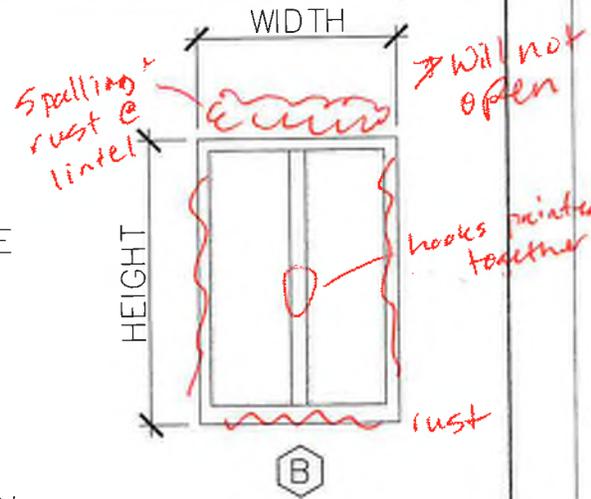

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 522																				
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-522-W	<i>West</i>	METAL	S.G.		<i>—</i>	<i>Poor</i>	<i>Frosted/Opaque</i>	<i>Fair</i>	<i>N/A</i>	<i>Fair-Poor</i>		<i>Bad</i>	<i>Poor</i>	<i>Fair</i>	<i>Bad</i>					
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE B								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

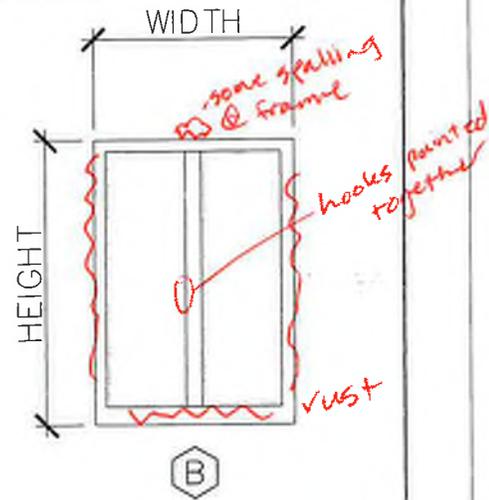

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES											
WINDOW NO. 523	EXPOSURE	TYPE	B	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT	Metal blinds
B-523-W	<i>West</i>	METAL	S.G.	<i>Poor</i>	<i>Paint</i>	<i>G-F</i>	<i>Poor</i>	<i>N/A</i>	<i>Fair</i>	<i>intact - Painted together looks</i>	<i>Bad</i>	<i>Fair</i>	<i>Fair</i>	<i>Bad</i>	<i>Fair</i>
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES											
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE											
KOMATSU ARCHITECTURE				121 E. DALLAS STREET CANTON, TEXAS 75103											
TYPE B															
Sheet ___ of ___															

WOOD WINDOW RESTORATION
ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

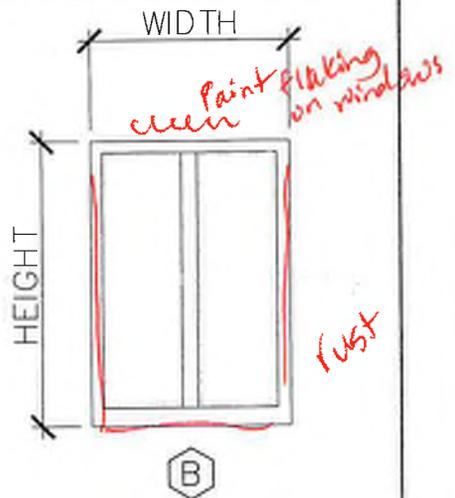

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES															
WINDOW NO.	EXPOSURE	TYPE	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
B-524-W	West	B			F-P	Good	Poor-Bad	N/A	Fair	intact	Bad	Fair	Good	Bad	Fair				
524																			
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES															
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE															
				121 E. DALLAS STREET CANTON, TEXAS 75103															
TYPE B																			
Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

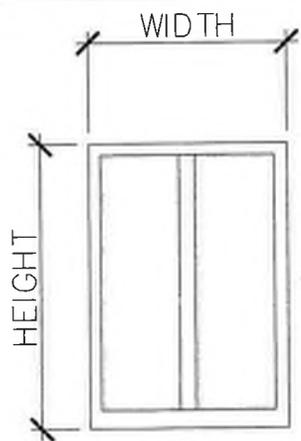

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO.	EXPOSURE	TYPE		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT									
B-526-W		B			Paint			N/A	Fair				Concrete										
526																							
	METAL																						
	S.G.																						
	OVERALL CONDITION																						
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE B																			
				Sheet ___ of ___																			

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

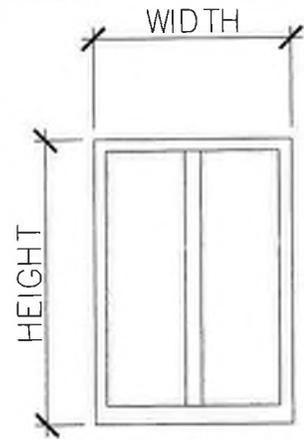

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																		
WINDOW NO. 527	B	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
B-527-S			METAL	S.G.				Pool	Good	Fair	N/A	Fair		Bad		Bad	Bad			
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE B								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																		
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

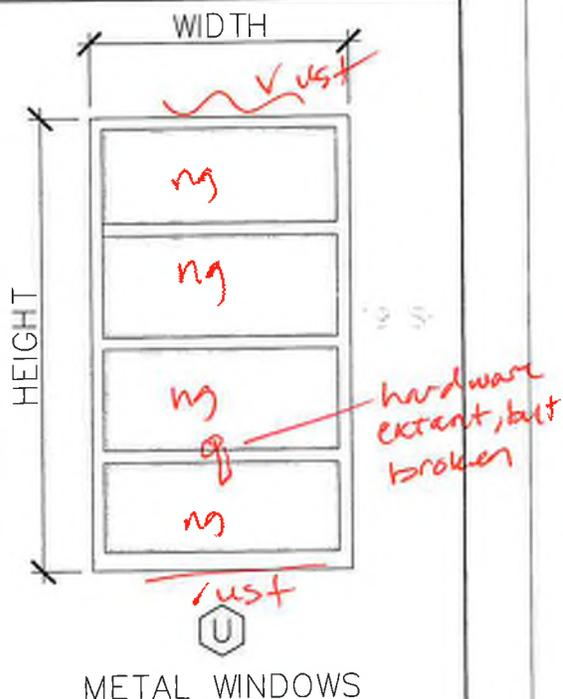

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 528	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
U-528-S		—	Poor	Poor	Fair-Poor	—	Poor	—	Bad	Fair	Good	Bad					
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES															
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE															
		121 E. DALLAS STREET CANTON, TEXAS 75103															
		TYPE U															
		Sheet ___ of ___															

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

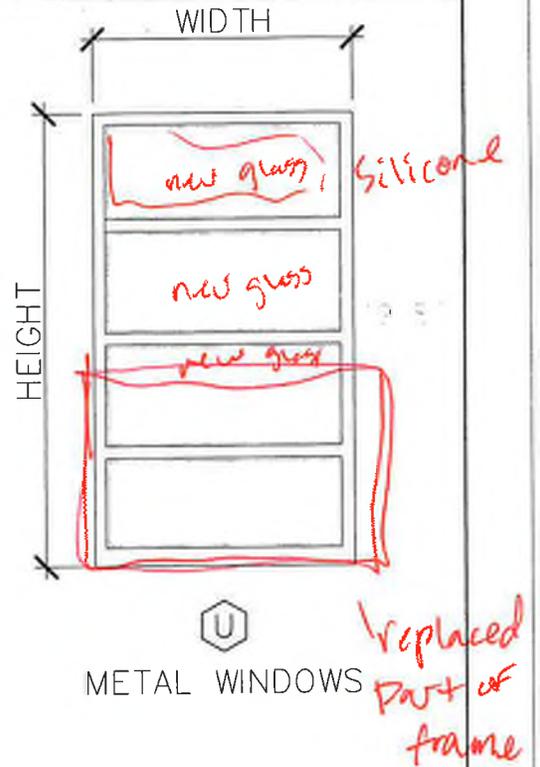

① CLEAN/REPAINT

WINDOW

SPECIFIC CONDITION NOTES

WINDOW NO. 529	U																		
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT				
U-529-S		METAL	S.G.		—	Poor	Poor-Bad	Poor-Bad	—	Bad missing	—	Bad	Fair lintel	Good tile	Bad				

SCALE: 1/4" = 1'-0"

DATE:

JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE U

Sheet ___ of ___




KOMATSU ARCHITECTURE

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

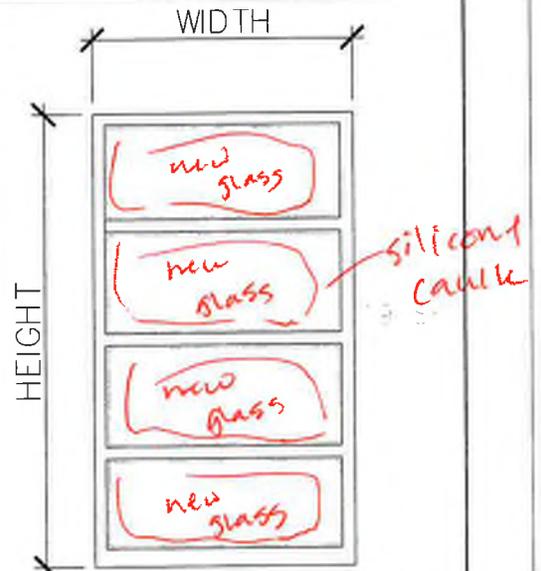

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																				
WINDOW NO. 530	U	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
U-530-S			METAL	S.G.		—	Poor	Fair	Bad	—	Fair	—	Bad	Good	Good	Bad						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE U								
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																				
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___								

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

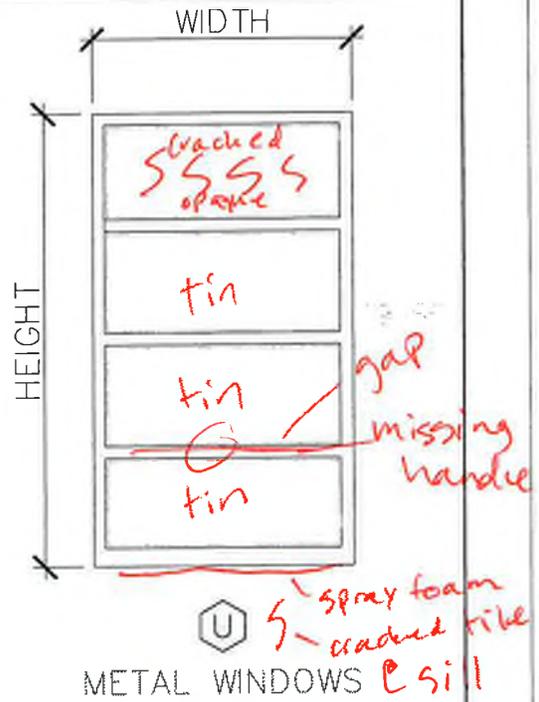

① CLEAN/REPAINT


WINDOW		SPECIFIC CONDITION NOTES														
WINDOW NO. 531	U	EXPOSURE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT
U-531-S			METAL	S.G.		—	Poor	Bad	F.P	—	Bad	—	Bad	Fair	Fair	Bad
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES										TYPE U				
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE														
		121 E. DALLAS STREET CANTON, TEXAS 75103										Sheet ___ of ___				

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD** FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR** FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR** FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD** THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

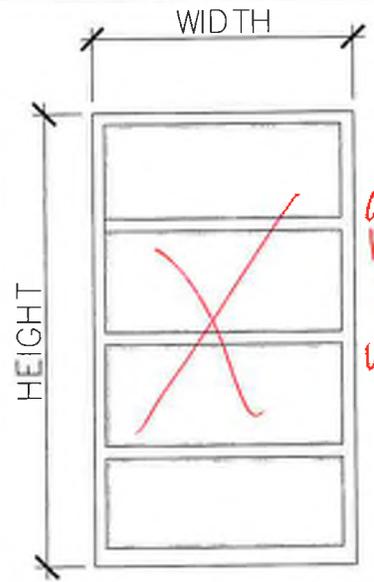

METAL WINDOWS

① CLEAN/REPAINT


XREFS:

WINDOW		SPECIFIC CONDITION NOTES																					
WINDOW NO. 532	U	EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT						
U- 532-S				METAL	S.G.									Bad	lintel	tile	Bad						
SCALE: 1/4" = 1'-0"		WINDOW SURVEY/WINDOW TYPES												TYPE U									
DATE:	JOB NO.: 2023.113	VAN ZANDT COUNTY COURTHOUSE																					
		121 E. DALLAS STREET CANTON, TEXAS 75103												Sheet ___ of ___									

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

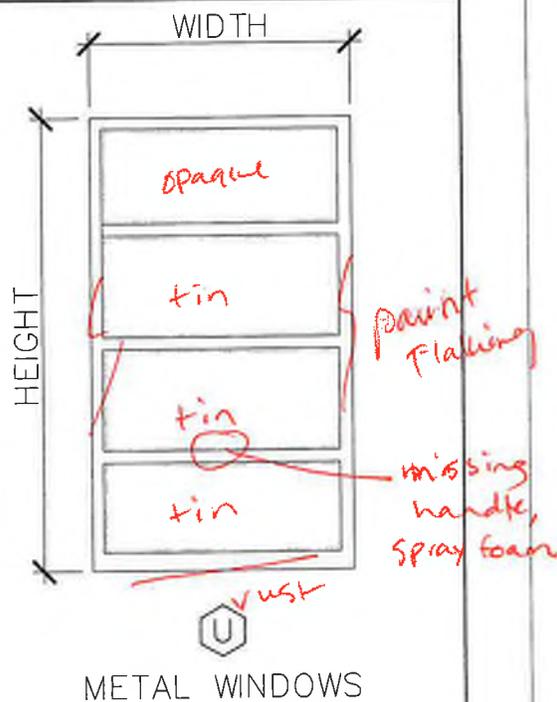

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																		
WINDOW NO. 533	EXPOSURE	TYPE U		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	missing handle	GLAZING MATERIAL	WEATHERSTRIPPING	lint	SILL	PERIMETER SEALANT								
U-533-S				—	Poor	Bad	F-P	—	Bad	—	Bad	Good	Good	Bad								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																		
DATE:				JOB NO.: 2023.113																		
				VAN ZANDT COUNTY COURTHOUSE 121 E. DALLAS STREET CANTON, TEXAS 75103																		
				TYPE U																		
				Sheet ___ of ___																		

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

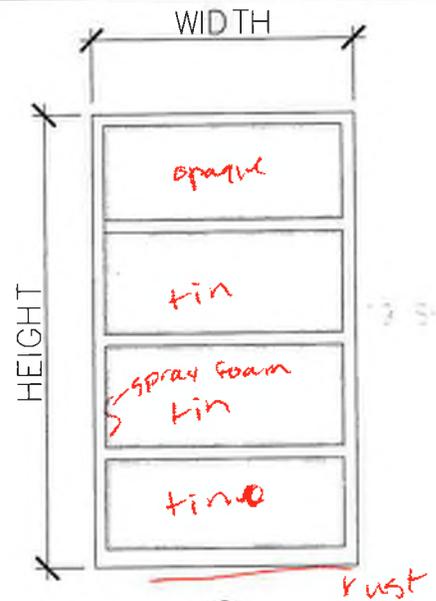

METAL WINDOWS

① CLEAN/REPAINT

WINDOW		SPECIFIC CONDITION NOTES															
WINDOW NO. 534	U	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT					
U-534-S		—	Poor	Bad	Fair	—	Fair	—	Bad	Good	Good	Bad					
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION													
		METAL	S.G.														
							intact, non-operable			lintel	tile						

SCALE: 1/4" = 1'-0"

DATE:

JOB NO.: 2023.113

WINDOW SURVEY/WINDOW TYPES

VAN ZANDT COUNTY COURTHOUSE

121 E. DALLAS STREET
CANTON, TEXAS 75103

TYPE U

Sheet ___ of ___




KOMATSU ARCHITECTURE

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

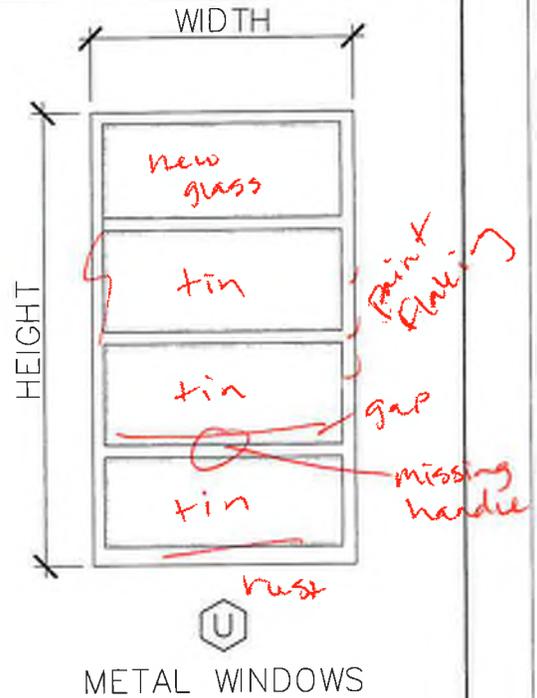

① CLEAN/REPAINT


WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 535		U																					
EXPOSURE	TYPE	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	missing handle	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
U-535-S		METAL	S.G.		—	Poor	Bad	Fair-Poor	—	Bad	—	Bad	Good	Fair	Bad								
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES																			
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE																			
				121 E. DALLAS STREET CANTON, TEXAS 75103																			
				TYPE U																			
				Sheet ___ of ___																			

XREFS:

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

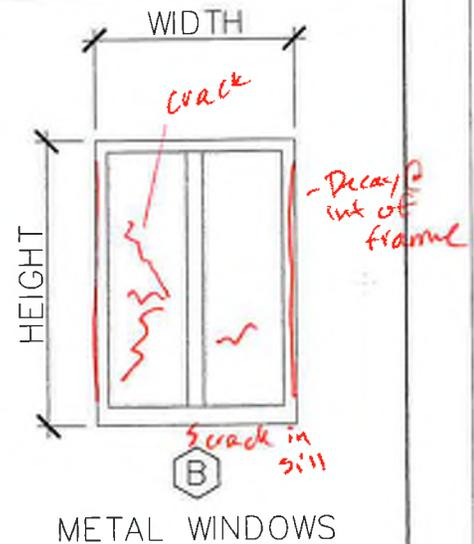

① CLEAN/REPAINT


XREFS:

WINDOW				SPECIFIC CONDITION NOTES																			
WINDOW NO. 601	EXPOSURE	TYPE B	FRAME MATERIAL	GLAZING MATERIAL	OVERALL CONDITION	EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT							
B-601-E			METAL	S.G.			<i>Paint</i>				<i>interc-stiff</i>				<i>concrete</i>								
SCALE: 1/4" = 1'-0"						WINDOW SURVEY/WINDOW TYPES																	
DATE:		JOB NO.: 2023.113				VAN ZANDT COUNTY COURTHOUSE																	
KOMATSU ARCHITECTURE						121 E. DALLAS STREET CANTON, TEXAS 75103						<h1 style="font-size: 2em;">TYPE B</h1> Sheet ___ of ___											

WOOD WINDOW RESTORATION ASSESSMENT CODING

CONDITION DEFINITIONS:

- GOOD FRAME SHOWS LESS THAN 5% ROT OR CORROSION, FINISH SHOWS LITTLE SIGN OF PAINT FAILURE
- FAIR FRAME SHOWS LESS THAN 30% ROT OR CORROSION, FINISH SHOWS SOME SIGNS OF PAINT FAILURE
- POOR FRAME SHOWS SIGNIFICANT (BUT LESS THAN 50%) ROT OR CORROSION
- BAD THE WINDOW IS MISSING OR BEYOND REPAIR, MORE THAN 50% OF THE WINDOW SHOWS ROT OR CORROSION

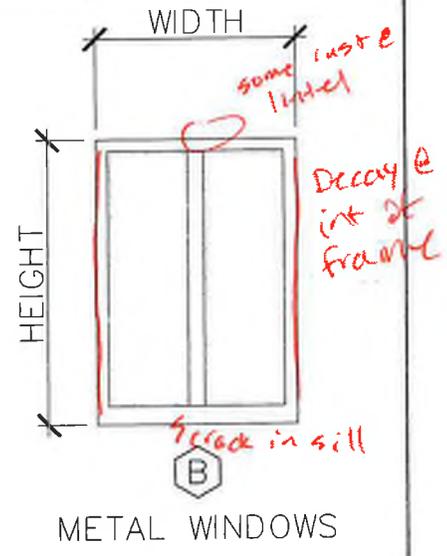

① CLEAN/REPAINT

XREFS:

WINDOW				SPECIFIC CONDITION NOTES													
WINDOW NO. 602	EXPOSURE	TYPE			P	G	F		P	B	B	G	P				
B-602-W	W	B		EXTERIOR FINISH	INTERIOR FINISH	GLASS	FRAME	SASHES	HARDWARE	GLAZING MATERIAL	WEATHERSTRIPPING	SUPPORT MATERIAL	SILL	PERIMETER SEALANT			
B-602-W		METAL			Paint			N/A	in tact			int. lintel -	Concrete				
SCALE: 1/4" = 1'-0"				WINDOW SURVEY/WINDOW TYPES													
DATE:		JOB NO.: 2023.113		VAN ZANDT COUNTY COURTHOUSE													
				121 E. DALLAS STREET CANTON, TEXAS 75103													
														TYPE B			
														Sheet ___ of ___			

